



Recall 17V-488

Basic Module of Authority Vehicle

R 1200 RT (K52, 0A13)

Service Information No. SI 61 003 17

Leadership circle	_____
Marketing	_____
Sale New motorcycles	_____
Sale Used motorcycles	_____
Aftersales	_____
Administration	_____

Service Information No. SI 61 003 17

Recall 17V-488 Basic Module of Authority Vehicle

Situation

During the course of quality inspections, BMW Motorrad has determined that in the case of authority motorcycles, when the lights are switched off, the brake light function is deactivated due to a software error. This is not in accordance with the description given in the rider's manual and also does not fulfil the statutory requirements for the functioning of the brake light. As a result of this, the visibility for other road users may be inadequate.

Vehicles affected

In order to determine if a specific vehicle is affected by this Technical Campaign, it will be necessary to verify all vehicle VINs through a DCS Vehicle History Check. Based on the response of the system, either proceed with the repair or take no further action. Please note, affected VINs may not appear until 24-72 hours after the release of this bulletin.

NHTSA Statement

Please be reminded that it is a violation of federal law (The Safety Act) for you to sell, lease or deliver any new motor vehicle covered by this notification until the recall repair has been performed. This means that centers may not legally deliver new motor vehicles to consumers until they are fixed or use/sell replacement equipment/parts subject to this recall. Note also that substantial civil penalties apply to violations of the Safety Act.

Also, you should not sell, lease or deliver any Certified Pre-Owned or used vehicles subject to a safety recall until the repair is completed.

Please follow any special instructions that we provide to you for the return or disposition of recall parts.

Series solution

As of 07/21/2017 production, authority vehicles in series production are delivered with the correct software for the basic module.

Aftersales solution

Update vehicles to I level K001-17-07-510 with **ISTA/P version 3.62.2** or **ISTA version 4.06.30** or later. It is essential that the I level is mentioned in the final report.

Warranty processing

Defect code

00 00 61 14 00	Updating the software version for the basic module of the special vehicle
----------------	---

FRU numbers

00 60 284	Updating software, 5 FRUs
-----------	---------------------------

Questions regarding this bulletin?

For technical inquires in relation to this bulletin	Please contact the PuMA team
For warranty inquires in relation to this bulletin	Motorrad.Warranties@bmwna.com
For parts inquires in relation to this bulletin	Adam.Sacher@bmwnaext.com
Motorcycle Service and Technical Manager	Gordon.McDonnell@bmwna.com
Bulletin authored/published by	Gery.Torok@bmwna.com