



# Thor Motor Coach Recall Repair Instructions

Recall #	17V-522		
Description/Title:	<b>LP Rubber Hose</b>		
Affected Product Line(s):	<b>Certain 2018 Chateau, Four Winds, and Freedom Elite motorhomes</b>		
Service Campaign # :	<b>RC000144</b>	Released Date:	<b>10/4/2017</b>
Failure Code:	<b>Inspect: TMCRC80468Y Repair: TMCRC80468V</b>	Document Date:	<b>10/4/2017</b>
Time Allowed:	<b>Inspect: 0.2 Repair: 0.4</b>	Document Revision:	<b>A</b>

**Issue:**


On certain 2018 Chateau, Four Winds, and Freedom Elite motorhomes, the rubber LP hose may have been incorrectly secured by TMC which could cause the hose to sag and become pinched between the frame and the leaf spring u-bolts.

**Part(s) Required:**

Additional p-clamps (as needed)

**Instructions:**

Inspect the routing of the rubber LP hose in the wheel well to determine the need for additional p-clamps or relocation of p-clams for proper securement to eliminate potential for sagging. (Figure 1)

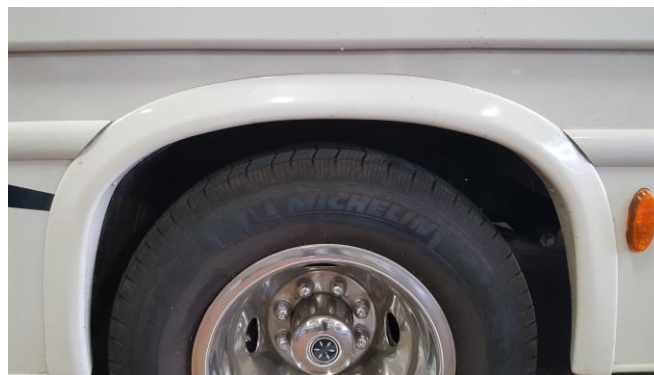

**Figure 1**

## Instructions (cont.):

There should be a minimum of 3 clamps located in the wheel well for proper securement of the LP hose (left, center, right). (Figure 2)



**Figure 2**

If there is less than 3 p-clamps securing LP hose to chassis, install additional p-clamps as needed. Required locations of p-clamps seen below (Figures 3 & 4)



**Figure 3**



**Figure 4**