

PSB-PW-2017-001

NHTSA Campaign
Number: 17T-013

VOLUNTARY RECALL

Primewell Valera Touring II

185/65R14 86H, 195/60R15 88H, 205/55R16 91H
205/60R16 92V, 215/60R17 96H, 235/60R17 102T


PT. Gajah Tunggal Tbk, a manufacturer of PRIMEWELL tires, has determined that the subject tires may develop a crack in the lower sidewall area of the tire. The crack may be attributable to an anomaly in the lower sidewall area of the tire and may become visible crack usually after the tire is in service for several months. In most instances, the crack happens on the side of the tire opposite to the one with full DOT serial number which is usually mounted inboard on the vehicle, thereby making visual detection difficult. The crack may result in tire air pressure loss, making the vehicle more difficult to maneuver.

1. What tires are subject to this recall: "Eligible Tires"?

Tire Line	Tire Sizes	DOT Tire Identification Number Manufacturing Range
PRIMEWELL Valera Touring II	185/65R14 86H	Y9 LX CLHX 1415 to 4616
	195/60R15 88H	Y9 K5 CLHX 1415 to 5216
	205/55R16 91H	Y9 JL CLHX 2714 to 5216
	205/60R16 92V	Y9 J5 CLVX 3114 to 5216
	215/60R17 96H	Y9 H0 CLHX 2714 to 4816
	235/60R17 102T	Y9 HR CLTX 3614 to 4716

2. How do I identify the tire in question?

All of the tires subject to this recall require matching "Tire Line, Size, and DOT" to be eligible for a replacement.

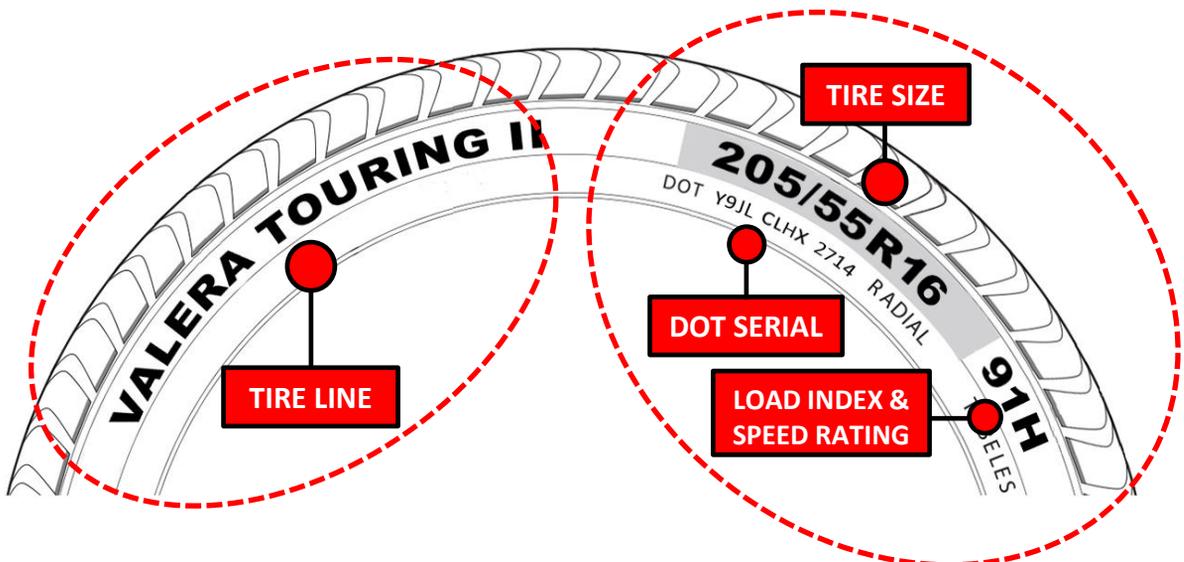

If you have any questions please contact us at Primewell-recall@us.giti.com

GITI Tire (USA) Ltd. 10404 Sixth Street - Rancho Cucamonga, CA 91730

Tel: 1-877-342-0882 - Fax: 1-909-476-4028

www.primewelltires.com