

DEFECT INFORMATION REPORT

REVIEWED BY:
JOHN TURLEY
JUN-29-2017
John Turley

573.6(c)(1)

Name of manufacturer:

Honda of America Mfg., Inc.
Honda de Mexico
Honda Motor Co., Ltd.

Manufacturer's agent:

John Turley
American Honda Motor Co., Inc.
1919 Torrance Blvd.
Torrance, CA 90501-2746

573.6(c)(2)

Identification of potentially affected vehicles:

See Attachment 1

573.6(c)(2)(iv)

Identification of affected component:

Component: CR-V Inflator Kit
Part No.: 04790-SWA-407
Country of Origin: USA
Manufacturer: T.K. Holdings, Inc.
Contact Name: D. Michael Rains
Address: 111 Peyer Court, Romeo, MI 48065
Telephone No.: (586) 336-5552

573.6(c)(3)

Total number of potentially affected vehicles: 629

573.6(c)(4)

Percentage of affected vehicles that contain the defect: Unknown

Description of the basis for the determination of the recall population:

The recall population was determined based on manufacturing records. The VIN range reflects all possible vehicles that could potentially experience the problem.

573.6(c)(5)

Defect description:

Honda CR-V passenger frontal airbag inflator repair kits shipped to dealers from the supplier may have been assembled with an incorrect wire harness that is designed for use in a different Honda vehicle. If an inflator with an incorrect wire harness is installed into the CR-V it will affect the deployment of the passenger frontal airbag in a crash, increasing the risk of injury.

573.6(c)(6)

Chronology:

- May 15, 2017 Honda received two field reports for incorrect wire harnesses in CR-V inflator kits.
- May - June 2017 Honda launched an investigation and found that the supplier had mixed Honda Fit inflator wire harnesses with Honda CR-V inflator wire harnesses.
- June 22, 2017 Honda made the determination that a defect related to motor vehicle safety exists and decided to conduct a safety recall.
- Honda has received three field reports, no warranty claims, and no reports of injuries or crashes related to this issue.

573.6(c)(8)(i)

Program for remedying the defect:

Registered owners of all affected vehicles will be contacted by mail and asked to take their vehicle to a Honda automobile dealer. The dealer will inspect the passenger frontal airbag inflator to see if the correct wire harness was installed and, if necessary, replace the passenger frontal airbag inflator free of charge.

573.6(c)(8)(ii)

The estimated date to start notification to dealers: June 30, 2017
The estimated date to start notifications to owners: August 1, 2017

573.6(c)(9)

Representative copies of all notices, bulletins and other communications:

A copy of the dealer service bulletin, the final customer notification letter and other dealer communication will be submitted to your office as soon as possible.

573.6(c)(10)

Proposed owner notification letter submission:

A draft of the owner notification letter will be submitted to your office as soon as possible.

573.6(c)(11)

Manufacturer's campaign number: KF9

Attachment 1

Make/Model	Description	VIN Range/Dates of Manufacture
Honda CR-V	Certain 2007 model year	JHLRE38507C000134 - JHLRE38527C083033 7/26/2006 – 8/21/2007
		JHLRE48737C000944 - JHLRE48537C121004 8/3/2006 – 8/3/2007
		5J6RE38397L000333 5/8/2007
		5J6RE48547L000151 - 5J6RE48527L016705 3/8/2007 – 9/6/2007
	Certain 2008 model year	JHLRE38398C000598 - JHLRE38518C057539 8/23/2007 – 7/25/2008
		JHLRE48518C001963 - JHLRE48378C077248 8/27/2007 – 6/30/2008
		5J6RE38368L002347 - 5J6RE38368L010240 2/29/2008 – 9/16/2008
		5J6RE48328L001508 - 5J6RE48768L050360 10/29/2007 – 9/19/2008
		3CZRE38518G700380 - 3CZRE38358G707461 11/22/2007 – 7/15/2008
		3CZRE485X8G700626 - 3CZRE48568G703670 11/14/2007 – 9/30/2008
	Certain 2009 model year	JHLRE38749C000075 - JHLRE387X9C015485 8/18/2008 – 7/22/2009
		JHLRE48599C001064 - JHLRE48329C017783 8/22/2008 – 6/4/2009
		5J6RE38389L000696 - 5J6RE38379L035147 9/29/2008 – 9/4/2009
		5J6RE48529L000779 - 5J6RE48739L070518 9/24/2008 – 9/11/2009
		3CZRE38339G700476 - 3CZRE38349G709400 10/15/2008 – 9/29/2009
		3CZRE48549G700607 - 3CZRE48569G707414 2/18/2009 – 8/26/2009
	Certain 2010 model year	JHLRE3H77AC000740 - JHLRE3H38AC011842 10/27/2009 – 7/29/2010
		JHLRE4H73AC000823 - JHLRE4H72AC013871 8/26/2009 – 7/19/2010
		5J6RE3H32AL002836 - 5J6RE3H78AL049761 9/30/2009 – 9/1/2010
		5J6RE4H37AL011036 - 5J6RE4H71AL100233 10/17/2009 – 9/3/2010
		3CZRE3H30AG700410 - 3CZRE3H31AG706068 10/22/2009 – 10/2/2010
	Certain 2011 model year	JHLRE3H77BC001016 - JHLRE3H76BC012847 8/19/2010 – 7/26/2011
		JHLRE4H77BC002883 - JHLRE4H58BC013843 8/30/2010 – 12/8/2010
		5J6RE3H70BL001236 - 5J6RE3H42BL061346 9/17/2010 – 11/22/2011
5J6RE4H78BL030005 - 5J6RE4H48BL120034 12/8/2010 – 10/31/2011		
3CZRE3H39BG700424 - 3CZRE3H39BG705543 12/21/2010 – 11/18/2011		
3CZRE4H52BG700076 - 3CZRE4H51BG705799 11/2/2010 – 10/28/2011		