



FIAT CHRYSLER AUTOMOBILES

Campaign T59 - Brake Booster on 11-14 WK/WD

November 2017

NAFTA
REGION



Jeep



SRT

Summary of T59



- Some vehicles in T59: 2011-2014 Brake Booster, may have brake booster shields that were incorrectly installed in the completion of P14. **Please provide additional attention to this recall.**
- The repair will consist of inspecting the prior P14 repair and installing a new water shield (part# CBXNP143AA) *if* it was improperly installed in P14. The percentage of vehicles needing a water shield is estimated to be 45% while the rest will just need inspection to verify a previous proper repair. In a very low percentage of cases (~2%), a brake booster (CBXNP141AD and CBXNP142AA) may need to be replaced.
- *As an added measure to ensure proper repair in all cases (including inspection), digital pictures of the repair are required for claim payment showing the date of repair and VIN marked on the brake booster. This will be attached to the safety recall claim.*
- A number of steps (including dealer validations) have been taken to try and ensure that repair occurs properly in this campaign and your assistance in spreading this word will be appreciated as well.
- Instruction Sheet (next slides) are being added to parts boxes as a running change (will be included in the AB level of the water shield when the AA level is exhausted).
- **PLEASE review Dealer Instructions and Instruction Sheet thoroughly to ensure proper repair.**



Brake booster water shield must be installed correctly in order to function properly.



1 Tab edges must be flush with edges of the brake booster.




INCORRECT



CORRECT

2 Tabs must be positioned at three o'clock and nine o'clock positions with booster installed in vehicle.

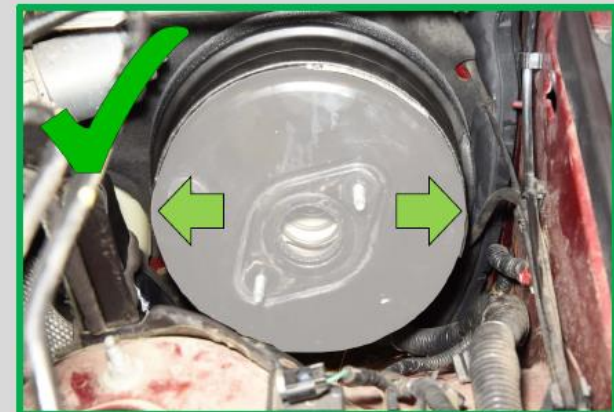

CORRECT

Refer to the instructions in recall document T59 for further detail.



Brake booster water shield must be seated correctly in order to function properly.



INCORRECT

Shield **must** be fully seated on the booster in the direction shown (arrows), with the tabs clearly visible (circled).

Refer to the instructions in recall document T59 for further detail.



CORRECT