

Latest Vehicle Concern Fixes



Vehicle	Customer Concern	Details and Status	Publication
XCL	InControl Touch Pro software updates	New InControl Touch Pro software (17C) has been released with PATHFINDER 123 and SDD 152. Some of the top issues that are resolved with this release include: Touch Screen image shifting, SVR Logo missing from startup screen, AM/FM reception improvements, ripped CDs now play in the correct track order, and Rear Seat Entertainment vehicles can now be updated again. Bulletins are currently being updated to reflect the new changes.	LTB01009NAS5 JTB00552NAS5 LTB01108NAS3 JTB00593NAS3 H046 UPS7917 N102 UPS8017
XCL	InControl Remote intermittent operation	Customers may report intermittent issues with the InControl Remote App, more specifically the Remote Climate feature. There have been improvements last month to both the backend server and the apps themselves. Please ensure the customer is on the latest version on the app Apple (1.69.3) & Android (R1.67.1). If you have issues on the latest app, please raise a request for Technical Assistance (TA).	
17-18MY XF/XE/F-PACE 16-17MY XJ	H056 RECALL VIRTUAL TFT IC RECALL REPAIR AVAILABILITY	H056 TSB VERSION 2 on TOPIX provides repair instructions for 18MY vehicles using PATHFINDER and 17MY XJ using SDD manual patch. H056 version 3 will release repair instructions for all models including for use of special applications in SDD and PATHFINDER that reduce sw download time to approx. 2 mins for all models except 16-17MY XJ which continue with the conventional SDD download procedure. Customer recall mailing by Dec 19th	H056 v 3 target release by Dec 19th