

# Part 573 Safety Recall Report

# 18V-009

**Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** JAN 08, 2018**NHTSA Recall No. :** 18V-009**Manufacturer Recall No. :** J071**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 8,925

Address : 555 MACARTHUR BOULEVARD

Estimated percentage with defect : 100 %

MAHWAH NJ 07430

Company phone : 8188500

**Vehicle Information :**

Vehicle 1 : 2013-2013 JAGUAR XF

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : 2013 MY Jaguar XF Vehicles in select VIN range that were originally sold or ever registered in Zone A (Priority Group 9).

Production Dates : MAY 15, 2012 - SEP 13, 2013

VIN Range 1 : Begin : SAJWA0E74D8S51674 End : SAJWA0E70D8U09024  Not sequential

Vehicle 2 : 2010-2010 JAGUAR XF

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : 2010 MY Jaguar XF Vehicles in select VIN range that were originally sold or ever registered in Zone B (Priority Group 9).

Production Dates : SEP 24, 2008 - MAR 02, 2010

VIN Range 1 : Begin : SAJWA0GB4ALR36915 End : SAJWA0JC3AMR79315  Not sequential

Vehicle 3 : 2009-2009 JAGUAR XF

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : 2009 MY Jaguar XF Vehicles in select VIN range that were originally sold or ever registered in Zone C (Priority Group 9).

Production Dates : DEC 04, 2007 - FEB 11, 2009

VIN Range 1 : Begin : SAJWA06B89HR00581 End : SAJWA05B59HR46998  Not sequential

**Description of Defect :**

Description of the Defect : Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2013 Model Year (MY) Jaguar XF vehicles originally sold in or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Unless included in "Zone A" above, Jaguar is recalling certain 2010 MY Jaguar XF vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B".

Unless included in "Zone A and Zone B" above, Jaguar is recalling certain 2009 MY Jaguar XF vehicles, originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C".

Vehicles outside the model years and zones as described above are not subject to this safety recall.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Supplier Identification :****Component Manufacturer**

Name : TK Holdings

Address : Bahnweg 1

Aschaffenburg FOREIGN STATES 63743

Country : Germany

## Chronology :

On May 18, 2016, Takata notified Jaguar Land Rover that they had submitted DIR's to NHTSA for the subject inflators. Jaguar Land Rover opened an investigation on May 20, 2016 and reviewed the concern at the Product Safety and Compliance Committee (PSCC) meeting on May 24, 2016. The committee concluded that certain Jaguar XF passenger airbags have been fitted with non-desiccated inflators containing ammonium nitrate. The issue was progressed to the Senior Review Panel (SRP) for determination.

On May 26, 2016 the SRP concluded that, despite Jaguar Land Rover not being aware of any field incidents with the subject Takata inflators, based on the information above provided by Takata and in an abundance of caution, Jaguar Land Rover will conduct a voluntary recall of the vehicles equipped with non-desiccated inflators containing ammonium nitrate in the United States as identified by Takata in their DIR - Equipment Reports 16E-042, 16E-043 and 16E-044.

There have been no reported injuries in Jaguar Land Rover vehicles as a result of this concern.

As part of Jaguar Land Rover's commitment to the co-ordinated remedy program initiated by NHTSA, this notification commences Phase 3 of the recall campaign to target certain Jaguar XF 2009, 2010 and 2013 MY vehicles as defined in the Third Amendment to the Coordinated Remedy Order (ref. Docket No. NHTSA-2015-0055).

## Description of Remedy :

Description of Remedy Program : Jaguar will notify owners, and authorized dealers will replace the passenger frontal air bag assemblies. There will be no charge to owners for this repair.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

## Recall Schedule :

Description of Recall Schedule : Distribution of interim notification letters will occur on or before February 28, 2018. Notifications to dealers will occur on January 11, 2018.

Planned Dealer Notification Date : JAN 11, 2018 - JAN 11, 2018

Planned Owner Notification Date : FEB 28, 2018 - FEB 28, 2018

\* NR - Not Reported