

# Part 573 Safety Recall Report

# 18V-022

**Manufacturer Name :** Ford Motor Company

**Submission Date :** JAN 11, 2018

**NHTSA Recall No. :** 18V-022

**Manufacturer Recall No. :** 18S02



## Manufacturer Information :

**Manufacturer Name :** Ford Motor Company

**Address :** 330 Town Center Drive

Suite 500 Dearborn MI 48126-2738

**Company phone :** 1-866-436-7332

## Population :

**Number of potentially involved :** 2,700

**Estimated percentage with defect :** NR

## Vehicle Information :

**Vehicle 1 :** 2006-2006 Ford Ranger

**Vehicle Type :** LIGHT VEHICLES

**Body Style :**

**Power Train :** NR

**Descriptive Information :** The recall population includes all vehicles produced with a Takata single stage driver, PSAN based, non-desiccated passenger frontal airbag inflator produced by Takata on either 9/3/2005 or 9/5/2005. No inflators were produced by Takata on 9/4/2005.

2006 Rangers not included in this recall are included in 17S42/17V788.

**Production Dates :** SEP 21, 2005 - DEC 15, 2005

**VIN Range 1 : Begin :**

NR

**End :** NR

Not sequential

## Description of Defect :

**Description of the Defect :** The passenger frontal airbag inflator could rupture if the vehicle is involved in a crash where the supplemental frontal airbags are designed to deploy. The vehicles included in this recall will be removed from 17S42/17V788.

An elevated risk of rupture affects only the driver airbag inflators in these vehicles.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** The passenger frontal airbag inflators could rupture if the vehicle is involved in a crash where the supplemental frontal airbags are designed to deploy. If an inflator ruptures, metal fragments could enter the passenger compartment increasing the risk of injury or death to occupants.

Description of the Cause : NR  
Identification of Any Warning NR  
that can Occur :

## Supplier Identification :

### Component Manufacturer

Name : T K Holdings  
Address : 888 16th Street NW  
Washinton DISTRICT OF COLUMBIA 20006  
Country : United States

## Chronology :

An elevated risk of rupture was identified on driver side airbag inflators in this population of vehicles.

On January 8, 2018, Ford's Field Review Committee approved field service action 18S02 to address these higher risk vehicles. Field Service Action program 18S02 includes the driver and passenger airbag inflators to ensure both recalled airbag inflators are replaced when the vehicle is repaired.

## Description of Remedy :

Description of Remedy Program : Owners will be notified by mail and instructed to not drive their vehicles until repairs are completed. Owners will be instructed to contact their Ford or Lincoln dealer to have their driver and passenger frontal airbag inflators replaced. There will be no charge for this service.

Ford is excluding reimbursement for costs because the original warranty program would provide for a free repair for this concern.

Ford will forward a copy of the notification letters to dealers to the agency when available.

How Remedy Component Differs from Recalled Component : The part number for the inflator kit is 8L5Z-10044A74-D. The inflator in this remedy kit does not contain ammonium nitrate as a gas generate.

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Ford plans to notify dealers on 1/10/2018 and contacting customers by telephone and alternative methods on 1/11/2018. Mailing of owner notifications is planned to be completed as soon as possible but no later than 1/19/2018.

Planned Dealer Notification Date : JAN 10, 2018 - JAN 10, 2018

Planned Owner Notification Date : JAN 16, 2018 - JAN 19, 2018

\* NR - Not Reported