

Part 573 Safety Recall Report

18V-294

Manufacturer Name : Starcraft RV**Submission Date :** JUN 11, 2018**NHTSA Recall No. :** 18V-294**Manufacturer Recall No. :** 9902379**Manufacturer Information :**

Manufacturer Name : Starcraft RV

Address : 903 South Main Street

P.O. Box 460 Middlebury IN 46540

Company phone : 800-945-4787

Population :

Number of potentially involved : 508

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2011-2013 Camping Trailer ALL w lifter mechanism

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : 2011 - 2013 model years are affected - Production reports noted camping trailers manufactured with Lippert Power Roof Lift Mechanism Part # 0205134

Production Dates : AUG 02, 2010 - AUG 09, 2012

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Mis-use of the manual over-ride feature on the Lippert Power Roof Lift Mechanism could create higher torque values thru the drive motor. Higher torque values may damage components

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : High torque may damage the lift mechanism which could allow the roof to collapse (fall) and could result in severe personal injury and/or property damage,

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

During investigation of a reported roof collapse on a 2013 Jayco Series Camping Trailer, it was discovered that the failure was due to the mis- use of the manual override. 4-26-18 Safety Committee reviewed details of incident and decided that a safety recall was required.

Description of Remedy :

Description of Remedy Program : Place Warning Label on affected units in close proximity of the manual over-ride feature to alert consumer of risk and proper use - copy of WARNING label downloaded with EDIT 6-11-18 adding supplement instruction sheet regarding the lift system to recall notification letters - adding same to all affected Model year owner manuals on public website - and adding repair step to all units produced prior to 2013 recall 13V-559 remedy - to add end plate and washers

How Remedy Component Differs from Recalled Component : presence of WARNING Label on the camping trailer

Identify How/When Recall Condition was Corrected in Production : System no longer used in current production of camping trailers.

Recall Schedule :

Description of Recall Schedule : Confirming availability of Warning label to enclose with recall notification to current owner on record.

Planned Dealer Notification Date : JUL 03, 2018 - JUL 03, 2018

Planned Owner Notification Date : JUL 03, 2018 - JUL 03, 2018

* NR - Not Reported