

Part 573 Safety Recall Report

18V-369

Manufacturer Name : Volkswagen Group of America, Inc.

Submission Date : JUN 18, 2018

NHTSA Recall No. : 18V-369

Manufacturer Recall No. : 47N8, 47N9, 47N6



Manufacturer Information :

Manufacturer Name : Volkswagen Group of America, Inc.

Address : 3800 Hamlin Road

Auburn Hills MI 48326

Company phone : 1-800-893-5298

Population :

Number of potentially involved : 10,206

Estimated percentage with defect : NR

Vehicle Information :

Vehicle 1 : 2018-2018 Volkswagen Atlas

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N8

Production Dates : APR 09, 2018 - JUN 04, 2018

VIN Range 1 : Begin : 1V2NR2CA0JC565696 **End :** 1V2KR2CA2JC574970 Not sequential

Vehicle 2 : 2018-2018 Volkswagen Passat

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N8

Production Dates : APR 09, 2018 - JUN 04, 2018

VIN Range 1 : Begin : 1VWAA7A33JC033672 **End :** 1VWJM7A32JC041818 Not sequential

Vehicle 3 : 2018-2018 Volkswagen Beetle

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N9

Production Dates : MAR 21, 2018 - MAY 16, 2018

VIN Range 1 : Begin : 3VWFD7AT0JM719633 End : 3VWFD7AT8JM722179 Not sequential

Vehicle 4 : 2018-2018 Audi Q5

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N6

Production Dates : MAR 20, 2018 - MAY 12, 2018

VIN Range 1 : Begin : WA1BNAFY5J2156015 End : WA1CNAFYXJ2185370 Not sequential

Vehicle 5 : 2018-2018 Volkswagen Golf

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N9

Production Dates : MAR 21, 2018 - MAY 25, 2018

VIN Range 1 : Begin : 3VWG17AU7JM278508 End : 3VWG17AU5JM285716 Not sequential

Vehicle 6 : 2018-2018 Volkswagen GTI

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N9

Production Dates : MAR 21, 2018 - MAY 23, 2018

VIN Range 1 : Begin : 3VW447AU6JM278509 End : 3VW547AU7JM285313 Not sequential

Vehicle 7 : 2018-2018 Volkswagen Golf SportWagen

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N9

Production Dates : MAR 21, 2018 - MAY 23, 2018

VIN Range 1 : Begin : 3VWD17AUXJM764197 End : 3VWD17AU0JM765469 Not sequential

Vehicle 8 : 2018-2018 Volkswagen Beetle Convertible

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N9

Production Dates : MAR 21, 2018 - MAY 16, 2018

VIN Range 1 : Begin : 3VW5DAAT2JM510452 End : 3VW5DAATXJM512899 Not sequential

Vehicle 9 : 2018-2018 Audi SQ5

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.
47N6

Production Dates : MAR 20, 2018 - MAY 11, 2018

VIN Range 1 : Begin : WA1A4AFY3J2156013 End : WA1A4AFY5J2185318 Not sequential

Description of Defect :

Description of the Defect : Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Braking performance may be reduced which may increase the risk of a crash.

Description of the Cause : The root cause of the insufficient chrome layer is currently under investigation.

Identification of Any Warning that can Occur : The brake pedal may feel soft after vehicle start.

Supplier Identification :

Component Manufacturer

Name : Kelsey-Hayes Company

Address : 12001 Tech Center Drive
Livonia MICHIGAN 48150

Country : United States

Chronology :

VOLKSWAGEN:

On or around May 17, 2018: Volkswagen Chattanooga began to find vehicles on the outbound yard with low or soft brake pedal feel. All outbound shipments were stopped. Also, cases were found in ports outside of the United States. Analysis was started.

May 18, 2018 First Stop Orders for In-transit vehicles were sent out.

May 21, 2018: Supplier informed Volkswagen about a possible issue with brake caliper pistons produced in a certain time period. Analysis started.

May 25, 2018: Topic was presented in the Volkswagen AG Product Safety Committee and a determination of defect was made. Stop-sale was issued for all potentially affected vehicles in dealer inventory.

AUDI:

May 2018: Routine internal testing identifies a 2018 model year Audi Q5 vehicle with a reduction in rear brake system performance.

May 16, 2018: Audi AG issues a stop order to halt 2018 model year Audi Q5 vehicles in transit from the factory while the issue is being researched.

May 30, 2018: The topic is presented in the Audi AG Product Safety Committee and the recall determination is made.

June 01, 2018: Stop-sale was issued for all potentially affected vehicles in dealer inventory. Audi of America will begin making outbound calls to owners of affected vehicles to advise them of the recall and offer a loaner vehicle.

Description of Remedy :

Description of Remedy Program : The final remedy is under evaluation.

How Remedy Component Differs from Recalled Component : The remedy component is coated sufficiently and produced outside the suspected time period. Part numbers are:

Atlas Front: 3QF.615.105.G/106.L

Passat Rear 561.615.405/406.D or 5QM.615.405/406.L

Golf, Golf Sportwagen Rear: 5QM.615.423/424.A or 5QM.615.423/424

Beetle, Beetle Convertible Rear: 1K0.615.423/424.J

GTI Rear: 5QM.615.423/424.B

Audi Q5 Rear: Part Number: 80A 615 405 AB/406 AB (left and right).

Identify How/When Recall Condition was Corrected in Production : A visual check to identify all non-conforming parts was implemented at supplier, additional process improvements were introduced.

Recall Schedule :

Description of Recall Schedule : VW: Stop-sale May 25, 2018/Audi June 01, 2018; recall repair notice TBD. Audi of America will begin contacting affected owners by telephone on June 01, 2018 to advise of the the recall and offer a loaner vehicle.

Volkswagen continues to scope the affected vehicle population and will begin customer outreach as soon as possible.

Planned Dealer Notification Date : JUL 30, 2018 - JUL 30, 2018

Planned Owner Notification Date : JUL 31, 2018 - JUL 31, 2018

* NR - Not Reported