OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 18V-369

**Manufacturer Name:** Volkswagen Group of America, Inc.

**Submission Date:** JUL 03, 2018 **NHTSA Recall No.:** 18V-369

Manufacturer Recall No.: 47N8, 47N9, 47N6



#### **Manufacturer Information:**

Manufacturer Name: Volkswagen Group of America, Inc.

Address: 3800 Hamlin Road

Auburn Hills MI 48326

Company phone: 1-800-893-5298

# **Population:**

Number of potentially involved: 10,206 Estimated percentage with defect: NR

#### **Vehicle Information:**

Vehicle 1: 2018-2018 Audi Q5

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N6

Production Dates: MAR 20, 2018 - MAY 12, 2018

VIN Range 1: Begin: WA1BNAFY5J2156015 End: WA1CNAFYXJ2185370 ✓ Not sequential

Vehicle 2: 2018-2018 Volkswagen Atlas

Vehicle Type : Body Style : Power Train : NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N8

Production Dates: APR 09, 2018 - JUN 04, 2018

VIN Range 1: Begin: 1V2NR2CA0JC565696 End: 1V2KR2CA2JC574970 ✓ Not sequential

Vehicle 3: 2018-2018 Volkswagen Passat

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N8

Production Dates: APR 09, 2018 - JUN 04, 2018

VIN Range 1: Begin: 1VWAA7A33JC033672 End: 1VWJM7A32JC041818 ✓ Not sequential

Vehicle 4: 2018-2018 Volkswagen Beetle

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N9

Production Dates: MAR 21, 2018 - MAY 16, 2018

VIN Range 1: Begin: 3VWFD7AT0JM719633 End: 3VWFD7AT8JM722179 ✓ Not sequential

Vehicle 5: 2018-2018 Volkswagen Beetle Convertible

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N9

Production Dates: MAR 21, 2018 - MAY 16, 2018

VIN Range 1: Begin: 3VW5DAAT2JM510452 End: 3VW5DAATXJM512899 ✓ Not sequential

Vehicle 6: 2018-2018 Volkswagen Golf

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N9

Production Dates: MAR 21, 2018 - MAY 25, 2018

VIN Range 1: Begin: 3VWG17AU7JM278508 End: 3VWG17AU5JM285716 ✓ Not sequential

Vehicle 7: 2018-2018 Volkswagen GTI

Vehicle Type : Body Style : Power Train : NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N9

Production Dates: MAR 21, 2018 - MAY 23, 2018

VIN Range 1: Begin: 3VW447AU6JM278509 End: 3VW547AU7JM285313 ✓ Not sequential

Vehicle 8: 2018-2018 Volkswagen Golf SportWagen

Vehicle Type: **Body Style:** Power Train: NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N9

Production Dates: MAR 21, 2018 - MAY 23, 2018

VIN Range 1: Begin: 3VWD17AUXJM764197 End: 3VWD17AU0JM765469 ✓ Not sequential

Vehicle 9: 2018-2018 Audi SQ5

Vehicle Type: **Body Style:** Power Train: NR

Descriptive Information: Certain vehicles in a specific time period produced with insufficient coated brake

caliper pistons. Not all vehicles built in this time period are affected.

47N6

Production Dates: MAR 20, 2018 - MAY 11, 2018

VIN Range 1: Begin: WA1A4AFY3J2156013 End: WA1A4AFY5J2185318 ✓ Not sequential

### **Description of Defect:**

Description of the Defect: Certain vehicles in a specific time period produced with insufficient coated brake caliper pistons. Not all vehicles built in this time period are affected. Audi: Due to a supplier production issue, the brake caliper piston coating was not applied according to manufacturing specifications. This can allow gas bubbles to form in the brake system, reducing vehicle brake performance and increasing the risk of a crash.

> Volkswagen: Gas bubbles may form in the brake system due to insufficient chrome coating of the brake caliper pistons. If this happens, braking

performance may be reduced which can increase the risk of a crash. DO NOT DRIVE YOUR VEHICLE. Contact VW Roadside Assistance at 1-800-411-6688 to have your vehicle towed for FREE to your nearest Volkswagen dealer for

repair.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Braking performance may be reduced which may increase the risk of a crash.

Description of the Cause: The root cause of the insufficient chrome layer is currently under investigation.

Identification of Any Warning The brake pedal may feel soft after vehicle start.

that can Occur:

# **Supplier Identification:**

# **Component Manufacturer**

Name: Kelsey-Hayes Company Address: 12001 Tech Center Drive

Livonia 48150

Country: NR

# **Chronology:**

### **VOLKSWAGEN:**

On or around May 17, 2018: Volkswagen Chattanooga began to find vehicles on the outbound yard with low or soft brake pedal feel. All outbound shipments were stopped. Also, cases were found in ports outside of the United States. Analysis was started.

May 18, 2018 First Stop Orders for In-transit vehicles were sent out.

May 21, 2018: Supplier informed Volkswagen about a possible issue with brake caliper pistons produced in a certain time period. Analysis started.

May 25, 2018: Topic was presented in the Volkswagen AG Product Safety Committee and a determination of defect was made. Stop-sale was issued for all potentially affected vehicles in dealer inventory.

June 29, 2018: Volkswagen AG Product Safety Committee determines recall repair will be to bleed the front and rear brake calipers.

#### **AUDI:**

May 2018: Routine internal testing identifies a 2018 model year Audi Q5 vehicle with a reduction in rear brake system performance.

May 16, 2018: Audi AG issues a stop order to halt 2018 model year Audi Q5 vehicles in transit from the factory while the issue is being researched.

May 30, 2018: The topic is presented in the Audi AG Product Safety Committee and the recall determination is made.

June 01, 2018: Stop-sale was issued for all potentially affected vehicles in dealer inventory. Audi of America will begin making outbound calls to owners of affected vehicles to advise them of the recall and offer a loaner vehicle.

# **Description of Remedy:**

Description of Remedy Program: Affected Audi models: Bleed the rear brakes.

Affected Volkswagen models: Bleed the front and rear brake calipers. Because all vehicles are New Vehicle Limited Warranty, neither Volkswagen nor Audi will offer a reimbursement program under this

recall.

How Remedy Component Differs The remedy for Audi is to bleed the rear brakes; no parts needed.

from Recalled Component: The remedy for Volkswagen is to bleed the front and rear brake calipers.

No parts needed.

Affected part numbers are:

Atlas Front: 3QF.615.105.G/106.L

Passat Rear 561.615.405/406.D or 5QM.615.405/406.L

Golf, Golf Sportwagen Rear: 5QM.615.423/424.A or 5QM.615.423/424

Beetle, Beetle Convertible Rear: 1K0.615.423/424.J

GTI Rear: 5QM.615.423/424.B

Audi Q5 Rear: Part Number: 80A 615 405 AB/406 AB (left and right).

Identify How/When Recall Condition A visual check to identify all non-conforming parts was implemented at

was Corrected in Production: supplier, additional process improvements were introduced.

#### **Recall Schedule:**

Description of Recall Schedule: VW: Stop-sale May 25, 2018/Audi Stop-sale June 01, 2018.

Audi recall repair for vehicles in Recall Code 47N6: owner notification

06/29/2018

Audi of America began contacting affected owners by telephone on June

01, 2018 to advise of the the recall and offer a loaner vehicle.

Volkswagen of America began contacting affected owners by telephone on June 15, 2018 to advise them of the recall and associated stop-drive.

Volkswagen anticipates mailing affected owners before July 31, 2018.

Planned Dealer Notification Date : JUL 30, 2018 - JUL 30, 2018 Planned Owner Notification Date : JUL 31, 2018 - JUL 31, 2018

<sup>\*</sup> NR - Not Reported