18V-405

OMB Control No.: 2127-0004

Part 573 Safety Recall Report

Manufacturer Name :Mercedes-Benz USA, LLC.Submission Date :JUN 15, 2018NHTSA Recall No. :18V-405Manufacturer Recall No. :NR



Manufacturer Information :

Manufacturer Name :Mercedes-Benz USA, LLC.Address :13470 International Parkway
Jacksonville FL 32218Company phone :1-877-496-3691

Population :

Number of potentially involved : 399 Estimated percentage with defect : 100 %

Vehicle Information :

Vahiela 1 ·	2018-2018 Me	reados Ban	7 CI A 250	
			Z GLA2JU	
• •	LIGHT VEHICL	ES		
Body Style :	SUV			
Power Train :	GAS			
Descriptive Information :	156.944 TG4E	130 Vehicl	es	
•			determined through proc	luction records.
Production Dates :	MAR 13, 2017	- APR 28, 20)17	
VIN Range 1:	Begin :	NR	End: NR	☐ Not sequential
Vehicle 2:	2018-2018 Me	rcedes-Ben	z GLA250 4MATIC	
Vehicle Type :	LIGHT VEHICL	ES		
Body Style :	SUV			
Power Train :	GAS			
Descriptive Information :	156.946 TG4G	269 Vehicle	es	
			determined through proc	luction records.
Production Dates :	MAR 13, 2017	- APR 28, 20)17	
VIN Range 1:		NR	End: NR	☐ Not sequential

Description of Noncompliance :

-	Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain GLA vehicles (156 platform), the top tether anchorage point on the center position of the rear seat might be missing.
FMVSS 1 :	225 - Child restraint anchorage systems
FMVSS 2 :	NR
Description of the Safety Risk :	The customer might not be able to attach a child restraint system to the top tether anchorage point on the center position of the rear seat bench as

Part 573 Safety Recall Report

18V-405

Page 2

-	described in the user manuals. Due to a documentation issue, the top tether anchorage on the inboard side of the rear seat backrest might be missing. The customer will be made aware of the missing anchorage point during child
	seat installation at the center position of the rear seat bench.

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology :

In September 2017 Daimler AG started initial investigations based on feedback from the Australian Vehicle Preparation Center regarding a vehicle with a missing top tether anchorage point on the center position of the rear seat bench.

In late 2017 analysis showed that certain vehicles might be missing the top tether anchorage point on the center position of the rear seat bench. The error was due to incorrect documentation.

Immediate action led to rework of all affected vehicles still available in the production plants. In May 2018, after a review of plant actions, Daimler concluded that some vehicles were released by the production plant. Subsequently, Daimler determined which vehicles in the field were potentially affected. In June 2018, Daimler AG determined that a potential non-compliance of subject vehicles with the requirements of FMVSS 225 S4.4 could not be ruled out.

Description of Remedy :

Description of Remedy Program :	An authorized Mercedes-Benz dealer will replace the rear seat backrest on the affected vehicles. Pursuant to 49 C.F.R. § 577.11(e), MBUSA does not plan to provide notice about pre-notice reimbursement to owners since all involved vehicles remain covered under the vehicle's New Vehicle Limited Warranty.
How Remedy Component Differs from Recalled Component :	Rear seat backrest with installed top tether anchorage on the center position
	A correction of the parts documentation ensures that this issue can no longer occur in vehicles produced from October 26, 2017 onwards.

Recall Schedule :

Description of Recall Schedule :	Owners will be notified in August, 2018, approximately one week after recall launch to the dealers. Dealers will be notified of the voluntary recall campaign in July, 2018. A copy of all communications will be provided when available.
Planned Dealer Notification Date :	JUL 27, 2018 - NR
Planned Owner Notification Date :	AUG 03, 2018 ⁻ AUG 03, 2018

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573