

# Part 573 Safety Recall Report

# 18V-546

**Manufacturer Name :** Winnebago Industries, Inc**Submission Date :** AUG 17, 2018**NHTSA Recall No. :** 18V-546**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Winnebago Industries, Inc

Address : PO BOX 152  
605 W. Crystal Lake Rd. Forest City IA  
50436

Company phone : 1-641-585-3535

**Population :**

Number of potentially involved : 6,700

Estimated percentage with defect : NR

**Vehicle Information :**

Vehicle 1 : 2016-2019 Winnebago Era, Travato, Fuse, View, Trend, Aspect, Paseo, Via, Adventurer, Journey, Tour, Grand Tour

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : All models that have had the auxiliary solar charging port offered were reviewed by Winnebago Motorhomes design team, identifying which models did not have overcurrent protection. Models not included were verified to contain overcurrent protection, or the auxiliary solar charging port was not offered.

Production Dates : NOV 18, 2014 - JUL 13, 2018

VIN Range 1 : Begin : NR End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The auxiliary solar charging port does not have overcurrent protection.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Increased risk of fire if solar panels are connected through the auxiliary solar charging port and exceed the amperage capacity of the circuit.

Description of the Cause : NR

Identification of Any Warning NR  
that can Occur :**Supplier Identification :**

**Component Manufacturer**

Name : NR  
Address : NR  
NR  
Country : NR

**Chronology :**

Upon design review of the auxiliary solar charging port instructions, it was noted that the required fuse was missing. On 06/25/2018 a change request was submitted to add the required fuse. An investigation started on 06/28/2018 to identify potential population and rework options. An internal campaign was issued 07/13/2018 to stop shipment and rework the units in house. On 08/08/2018, a meeting of the Safety Committee was held and the determination was made to conduct a recall campaign.

**Description of Remedy :**

Description of Remedy Program : Dealer will remove the existing auxiliary charging port and install an inline 15 AMP fuse. Winnebago authorized service center will submit a Warranty Service Claim to Winnebago.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : An inline 15 AMP fuse has been added to the wire loom leading to the auxiliary solar charging port.

**Recall Schedule :**

Description of Recall Schedule : NR  
Planned Dealer Notification Date : NR - NR  
Planned Owner Notification Date : NR - NR

\* NR - Not Reported