OMB Control No.: 2127-0004

Part 573 Safety Recall Report

Manufacturer Name :Chrysler (FCA US LLC)Submission Date :AUG 23, 2018NHTSA Recall No. :18V-556Manufacturer Recall No. :U88

Manufacturer Information :

Manufacturer Name : Chrysler (FCA US LLC)

Address : 800 Chrysler Drive CIMS 482-00-91 Auburn Hills MI 48326-2757 Company phone : 1-800-853-1403

Vehicle Information :

Vehicle 1:	2018-2019 RAM 1500	
Vehicle Type :		
Body Style :	PICKUP TRUCK	
Power Train :	NR	
Descriptive Information :	Some 2018-2019 model year Ram 1500 vehicles built from April 23, 2018 to August 8, 2018, may be equipped with a rear axle that was delivered from the supplier with an inadequate oil level. The recall population was determined through an understanding of the process failure mode at the supplier, the serial numbers of the axles potentially affected, and traceability analysis from those serial numbers to the affected vehicle population. Similar 2018-2019 model year Ram 1500 vehicles not included in the recall were not identified by supplier production records and traceability information as potentially being built with a rear axle containing an inadequate oil level.	
Production Dates :	APR 23, 2018 - AUG 08, 2018	
VIN Range 1:	Begin: NR End: NR	□ Not sequential
Description of Defect :		

Description of the Defect :The rear axle assembly may have an inadequate oil level which may cause the
axle gears and bearings to generate excessive heat and wear, create a whine or
growling noise, and the rear axle may fail prematurely.FMVSS 1 :NR
FMVSS 2 :FMVSS 2 :NRDescription of the Safety Risk :A rear axle assembly that fails prematurely may result in a loss of motive
power, and may cause the rear axle to seize.Description of the Cause :NRIdentification of Any WarningOperating the truck with an inadequate rear axle oil level will result in rear axle

The information contained in this report was submitted pursuant to 49 CFR §573



18V-556

Population :

Number of potentially involved : 4,171 Estimated percentage with defect : 1 %

Page 2

that can Occur : gear noise (whine or growling) as a warning prior to rear axle failure. If this warning is not heeded, vehicle crash can occur.

Supplier Identification :

Component Manufacturer

Name: ZF

Address : 475 Davis Rd Marysville MICHIGAN 48040

Country: United States

Chronology :

• On August 8, 2018, the FCA US Vehicle Safety and Regulatory Compliance ("VSRC") organization was informed of an issue with inadequate oil level on RAM 1500 rear axles.

• On August 9, 2018, an investigation was opened for this issue based on eleven warranty claims.

• On August 11, 2018, Rapid Response Transmittal ("RRT") 03-001-18 was issued to authorize inspection and repair of unsold vehicles for this condition.

- As of August 16, 2018, FCA US identified one CAIR, no VOQs and one field report related to this issue.
- As of August 16, 2018, FCA US has identified 11 warranty claims related to this issue, or 2.6 c/1000 in the affected population.
- As of August 16, 2018, FCA US is aware of one accident and no injuries potentially related to this issue.
- On August 16, 2018, FCA US determined, through the Vehicle Regulations Committee, to conduct a voluntary safety recall of the affected vehicles.

Description of Remedy :

Description of Remedy Program :	FCA US will conduct a Voluntary Safety Recall to inspect all vehicles affected for rear axle oil level. The rear axle will be replaced on those vehicles found with no, or low, oil. This Voluntary Safety Recall will supersede the RRT and also include the sold population. FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.
How Remedy Component Differs from Recalled Component :	

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

68334756AD, 68334757AD

Identify How/When Recall Condition NR was Corrected in Production :

Recall Schedule :

Description of Recall Schedule :8/23/18: FCA US will notify dealers and begin notifying owners on or
about October 12, 2018.Planned Dealer Notification Date :0CT 12, 2018 - 0CT 12, 2018Planned Owner Notification Date :0CT 12, 2018 - 0CT 12, 2018

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573