

Part 573 Safety Recall Report

18V-618

Manufacturer Name : Jayco, Inc.**Submission Date :** OCT 01, 2018**NHTSA Recall No. :** 18V-618**Manufacturer Recall No. :** 9901410**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 416

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2019-2019 Travel Trailer White Hawk , Jay Flight, Jay Flight SLX

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Dexter PO report of recalled axle serial numbers was compared to Production reports to note units manufactured on the recalled axles. We are finalizing the scope will add number of units and specific unit serial number information as available.

White Hawk 2019

K14A0141-0200 K14D00181-0086 K14E0081-0086 K14H0050 K14K0051-0080

K14L0141-0170 K14Y0081-0098 K14Z0087-0098

Jay Flight SLX 2019

K17M0081-0116

Jay Flight 2019

K1TC0141, TC0143-0260 K1TD0141-0230 K1TN0111-0128 K1TZ0113-0170

Production Dates : JUN 20, 2018 - JUL 26, 2018

VIN Range 1 : Begin : NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Per Dexter, the D44 axles manufacture 6-20-18 thru 7-31-18 may be missing inner bearing races on the hubs. 4000lb axles Jayco part # 319501 322162

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Premature bearing failure, which could lead to separation of the hub from the axle, creating a safety hazard.

Description of the Cause : Bearing cap was not installed in hub during Dexter manufacturing process.

Identification of Any Warning : Per Dexter, if bearing cap is missing, hub may initially heat up. If this were to occur, hub may start to smoke from bearing grease. Wheel may become

that can Occur : wobbly if bearing starts to fail.

Supplier Identification :

Component Manufacturer

Name : Dexter Axle Company
Address : 2900 Industrial Parkway East
Elkhart INDIANA 46516
Country : United States

Chronology :

8-23-18 Dexter met with Jayco Corp to inform of issue with D44 axles manufactured without a bearing cup on hubs. Dexter submitted list of axles delivered to Jayco Divisions with in time frame of 6-20-18 thru 7-31-18. Jayco Corp. Safety Steering Committee reviewed information and agreed that Jayco would be required to file recall after Dexter filed for products built on the recalled Dexter Axles.

Description of Remedy :

Description of Remedy Program : Jayco Dealers will replace defective axles or service axle (hubs replaced) as required at NO charge to the customer
How Remedy Component Differs from Recalled Component : NR
Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Jayco will contact current owner on record due to parts availability from Dexter and Instructions from Dexter
Planned Dealer Notification Date : NOV 16, 2018 - NOV 16, 2018
Planned Owner Notification Date : NOV 16, 2018 - NOV 16, 2018

* NR - Not Reported