

Part 573 Safety Recall Report

18V-769

Manufacturer Name : Suzuki Motor of America, Inc.

Submission Date : NOV 28, 2018

NHTSA Recall No. : 18V-769

Manufacturer Recall No. : CY



Manufacturer Information :

Manufacturer Name : Suzuki Motor of America, Inc.

Address : 3251 East Imperial Highway
Brea CA 92821-6795

Company phone : 714-996-7040

Population :

Number of potentially involved : 21,063

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2010-2013 Suzuki Kizashi

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : The recall population was determined based on production records. All 2010 to 2013 model year vehicles are included.

Production Dates : OCT 13, 2009 - OCT 31, 2012

VIN Range 1 : Begin :

NR

End : NR

☐ Not sequential

Description of Defect :

Description of the Defect : When driving on very dusty roads, a large amount of dust can enter the vent line that provides fresh air to the carbon canister, causing a restriction in the vent line. If this occurs, air flow through the evaporative system may be impacted such that excessive negative pressure is created in the fuel tank. This can cause deformation of the fuel tank, which can lead to fuel tank cracks.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the fuel tank becomes cracked, fuel leakage and venting of gasoline vapors can occur, increasing the risk of a fire.

Description of the Cause : NR

Identification of Any Warning that can Occur : When the fuel tank becomes cracked, a pressure sensor will detect fuel vapor leakage and will illuminate the Malfunction Indicator Lamp (MIL), alerting the driver to seek corrective action.

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

The chronology is attached as a separate document.

Description of Remedy :

Description of Remedy Program : The remedy has not yet been determined. Suzuki will notify NHTSA through an amended Part 573 report when the remedy has been determined.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Interim notification letters will be mailed initially. Second notification letters will be mailed when Suzuki is ready to provide recall repairs.

Planned Dealer Notification Date : DEC 05, 2018 - DEC 05, 2018

Planned Owner Notification Date : DEC 07, 2018 - DEC 07, 2018

* NR - Not Reported