OMB Control No.: 2127-0004

Part 573 Safety Recall Report

18V-790

Manufacturer Name: Keystone RV Company

NHTSA Recall No.: 18V-790

Manufacturer Recall No.: 18-339



Manufacturer Information:

Manufacturer Name: Keystone RV Company

Address: PO Box 2000

2642 Hackberry Drive Goshen IN

46527

Company phone: 574-535-2100

Population:

Number of potentially involved: 95 Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2018-2019 Keystone Raptor 353TS

Vehicle Type: TRAILERS

Body Style : Power Train : NR

Descriptive Information: Only model 353TS

Production Dates: JUN 14, 2017 - JUL 30, 2018

 VIN Range 1 : Begin :
 4YDF35322JR800174
 End :
 4YDF35329JR800902
 ✓ Not sequential

 VIN Range 2 : Begin :
 4YDF35322KR800029
 End :
 4YDF35329KR800268
 ✓ Not sequential

Description of Defect:

Description of the Defect: It has been decided that the vehicles in this recall population have been

manufactured with tires that may come into contact with the frame outrigger.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: The tires and frame outriggers touching during travel may lead to an

increased risk of property damage and poor vehicle handling.

Description of the Cause: The frame outrigger was incorrectly placed over the tire area.

Identification of Any Warning The tires rubbing on the frame outriggers.

that can Occur:

Supplier Identification:

Component Manufacturer

Name : NR Address : NR NR

Country: NR

Chronology:

10/1/2018 – Report was made of a tire coming in contact with frame outrigger. Investigation opened.

11/5/2018 – Investigation concluded and scope completed.

Description of Remedy:

Description of Remedy Program: The remedy is to cut a notch in the affected frame outrigger allowing a

minimum of 3 inches of clearance between the tire and the frame

outrigger.

How Remedy Component Differs The modification allows clearance between the frame outrigger and the

from Recalled Component: tire.

Identify How/When Recall Condition Upcoming production units will have correct frame outrigger placement.

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: Keystone will notify the dealers and owners of the recreational vehicles

by letter. A final copy of the owner letter will be provided to NHTSA,

along with the dealer repair procedures.

Planned Dealer Notification Date: DEC 05, 2018 - DEC 05, 2018 Planned Owner Notification Date: DEC 05, 2018 - DEC 05, 2018

* NR - Not Reported