Part 573 Safety Recall Report

Manufacturer Name :Elgin Sweeper Company Inc.Submission Date :DEC 05, 2018NHTSA Recall No. :18V-865Manufacturer Recall No. :NR

Manufacturer Information :

Manufacturer Name : Elgin Sweeper Company Inc. Address : 1300 West Bartlett Road Elgin IL 60120-7259 Company phone : 847-741-5370

Vehicle Information :

Vehicle 1:	2015-2018 Elgin Sweeper Company Broombear, Crosswind, Eagle, Road Wizard, Whirlwing			
Vehicle Type :	LOW VOLUME VEHICLES			
Body Style :	OTHER			
Power Train :	DIESEL			
Descriptive Information :	We identified when the suspect part was received into inventory and used on the assembly floor to the date we change to the corrected part. The units were identified by a bill of materials calling for the suspect part to be installed.			
Production Dates :	OCT 15, 2015 - NOV 30, 2018			
VIN Range 1:	Begin :NREnd :NRNot sequential			

Population :

Description of Defect :

Description of the Defect	The T fitting is not per engineering print and doesn't meet the requirements for this application
FMVSS 1	121 - Air brake systems
FMVSS 2	106 - Brake hoses
Description of the Safety Risk	The T fitting could fail and cause air to leak from the air brake system and cause the parking brake to automatically apply due to low air pressure
Description of the Cause	The T fitting doesn't meet engineering standards and could fail at air line attachment point
Identification of Any Warning that can Occur	Air loss and frequent operation of air compressor system

Supplier Identification :

The information contained in this report was submitted pursuant to 49 CFR §573



Number of potentially involved : 1,230 Estimated percentage with defect : 100 %

18V-865

Part 5	73 Sa	afety	Recall	Report
--------	-------	-------	--------	--------

Component Manufacturer Name: NR Address : NR NR Country: NR **Chronology**: We were notified November 29th that one of our sweeper chassis lost air due to a leak and the parking brake then applied. During the diagnostics of the air loss it was determined the T fitting had failed and it was not the fitting called for by our engineering print. **Description of Remedy :** Description of Remedy Program : We will authorize our dealer network to inspect and replace any T fitting not matching our engineering print. The expense for this inspection and replacement will be funded 100% by Elgin Sweeper Company. How Remedy Component Differs The correct part is a brass T fitting (1065665), the installed part is a from Recalled Component : composite T fitting (1121590) Identify How/When Recall Condition All units at the manufacturing plant complete and in process were was Corrected in Production : inspected and update to the correct T fitting on November 30th **Recall Schedule :** dention of Decall Colorded

Description of Recall Schedule :	NR		
Planned Dealer Notification Date :	NR	- NR	
Planned Owner Notification Date :	NR	- NR	

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573