

Part 573 Safety Recall Report

18V-871

Manufacturer Name : Keystone RV Company**Submission Date :** DEC 07, 2018**NHTSA Recall No. :** 18V-871**Manufacturer Recall No. :** 18-343**Manufacturer Information :**

Manufacturer Name : Keystone RV Company

Address : PO Box 2000
2642 Hackberry Drive Goshen IN
46527

Company phone : 574-535-2100

Population :

Number of potentially involved : 152

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2018-2019 Keystone Raptor 421CK, 423

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Models with outside grill

Production Dates : AUG 14, 2017 - NOV 14, 2018

VIN Range 1 : Begin : 4YDF42135JR800273 End : 4YDF42132JR800912

 Not sequential

VIN Range 2 : Begin : 4YDF42131KR800000 End : 4YDF42337KR800452

 Not sequential**Description of Defect :**

Description of the Defect : It has been decided that the vehicles in the recall population may have a quick disconnect rubber propane line that is incorrectly routed allowing the grill to be stored with the fuel source on.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The grill can be stored while the flame is still lit; storing the grill while the flame is lit can lead to an increased risk of fire and/or property damage.

Description of the Cause : The quick disconnect rubber propane line is incorrectly routed through the slide floor rather than through the compartment door opening.

Identification of Any Warning that can Occur : The grill can be closed and pushed into the stowed position with the quick disconnect rubber propane line still attached.

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

11/16/2018 – Report was made by production that during a routine audit it was found that a quick disconnect rubber propane line was incorrectly routed according to code. The grill can be stored with the fuel source on.
11/17/2018 – Investigation opened. All affected units were put on hold and the incorrectly routed quick disconnect rubber propane line was replaced so that the grill cannot be stowed without disconnecting the quick disconnect rubber propane line.
12/4/2018 – Investigation concluded and scope completed.

Description of Remedy :

Description of Remedy Program : The remedy is to replace the quick disconnect rubber propane line and route it in a manner in which it must be disconnected before stowing the grill.
How Remedy Component Differs from Recalled Component : The replacement quick disconnect propane line is routed in a different manner.
Identify How/When Recall Condition was Corrected in Production : Units were quarantined, inspected then repaired as indicated by inspection.

Recall Schedule :

Description of Recall Schedule : Keystone will notify the dealers and owners of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA, along with the dealer repair procedures.
Planned Dealer Notification Date : JAN 28, 2019 - JAN 28, 2019
Planned Owner Notification Date : JAN 28, 2019 - JAN 28, 2019

* NR - Not Reported