	<p style="text-align: center;">Mitsubishi Motors North America, Inc. PARTS BULLETIN</p>	
<p>SUBJECT:</p> <p>PARKING BRAKE CORROSION- SAFETY RECALL CAMPAIGN</p>	<p>No: BR-OU-01-18</p>	
	<p>Date: April 12, 2018 (revision)</p>	
	<p>Model: See below</p>	

PURPOSE:

This bulletin provides dealers the parts information for allocation of countermeasure parts for the parking brake corrosion safety recall.

BACKGROUND:

(A) Due to insufficient rust prevention to the operating shaft of the parking brake and insufficient sealing performance of the rear brake caliper lever boot, water may penetrate the brake caliper lever boot and the parking brake operating shaft, causing caliper body and/or parking brake operating shaft corrosion. As a result, the operating shaft may bind, causing the rear brakes to drag and/or decrease parking brake performance.

(B) Due to an inappropriate manufacturing process, the automatic adjuster in the rear brake caliper, with built-in parking brake, may not work. If the automatic adjusters do not work, as brake pads wear, the parking brake lever's effective engagement point will increase until the parking brake no longer engages.

If the parking brake does not operate properly, the vehicle, when parked on a slope, may move unexpectedly, increasing the risk of a crash. Please reference the following safety recall campaign for recall background information:


- (a) SR-18-002 – PARKING BRAKE CORROSION

AFFECTED VEHICLES:

Certain 2014 - 2016 Outlander built April 12, 2013 - February 02, 2016
 Certain 2013 - 2016 Outlander Sport built July 20, 2012 - July 08, 2016

IMPORTANT

Affected new or used inventory vehicles must be repaired before the vehicle is sold/delivered. Dealers must check their inventory vehicles' VINs on the Warranty Superscreen to verify whether the vehicle is involved in this recall campaign. It is a violation of Federal law for a dealer to sell/deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by the notification under a sale or lease until the defect or noncompliance is remedied.

	Mitsubishi Motors North America, Inc. PARTS BULLETIN
SUBJECT: PARKING BRAKE CORROSION- SAFETY RECALL CAMPAIGN	No: BR-OU-01-18
	Date: April 12, 2018 (revision)
	Model: See below

PARTS INFORMATION

PART NUMBER	DESCRIPTION	Quantity
4605B841	Caliper body assy (LH)	1
4605B842	Caliper body assy (RH)	1
4605B849	Caliper lever & Boots Kit (LH)	1
4605B850	Caliper lever & Boots Kit (RH)	1
4605B846	Washer Kit	1
4605C046	Piston assy	1
4650B827QA	Gasket (2 gaskets required for each caliper body installation) **	2
MZ341022EX*	Diaqueen, Brake Fluid, DOT4	1

* Use **MZ341022EX** if additional brake fluid is required, use **MZ341022RCL** for claims processing on this recall.

** Revised on 4/12/18

PARTS ORDERING AND ALLOCATION INFORMATION:

Some dealers may be force allocated stock of parts necessary to complete this recall using a formula based on the proximity and percentage of applicable registered VINs by ZIP code. Parts shipments will be processed via the 'R' order type and will start shipping along with your scheduled stock order beginning April 2, 2018. Dealers may place additional orders via the MDL.

