



IMPORTANT SAFETY RECALL

AUTOCAR, LLC SAFETY RECALL ACX-1801
NHTSA RECALL NO. 18V-165
TC RECALL NO. 2018-131
April, 2018

TO: U.S. and Canadian Distributors
Dealer Principals, Service Managers, Warranty Managers, Parts Managers

This notice is being sent to you in accordance with the National Traffic and Motor Vehicle Safety Act and Canadian Motor Vehicle Safety Act.

Autocar, LLC, has decided that a defect that relates to motor vehicle safety exists in 2014-2018 model year Xpeditor chassis. These chassis were manufactured between 16 May 2013 and 14 February 2018 with non-sequential serial numbers in the range 216269 to 226832. Accordingly, a recall to address this issue is being initiated effective 13 April 2018.

MODELS Autocar Xpeditor MY 2014-2018
AFFECTED:

COMPONENTS Methane detector harness and fuse.
AFFECTED:

SAFETY DEFECTS The circuit protection of a factory installed methane detector is inadequate based on the
AND POTENTIAL sensor harness wire gauge. Improper routing of the sensor harness can also lead to it
RISKS: becoming damaged, causing an overcurrent condition. If an overcurrent condition occurs, the fuse may not open before the power wire harness overheats, which could lead to a fire, increasing the risk of personal injury or property damage.

REPAIR A three amp fuse will replace the ten amp fuse installed for the methane detector. The
REQUIRED: harness will be inspected for proper routing, and if needed will be routed to avoid damage.

REPAIR VIN profiles in the Autocar Warranty System will be updated to show the open recall on
AVAILABLE: 13 April 2018.

REMINDER: It is a violation of Federal law to sell or lease a vehicle covered by this recall notice unless the recall remedy has been completed. Substantial civil penalties apply to violations of this law.

If you have any questions or concerns, please contact the Autocar Warranty Department at warranty@autocartruck.com.

Sincerely,
AUTOCAR, LLC

ACF 00002 Rev. 000