

Side Extender Intermediate Marker Lamp Reflector

Author:

6/18/2019

Title	18KWF: Side Extender Intermediate Marker Lamp Reflector					
Search Words						
Bulletin No.	18KWF					
What's New Abstract	Safety Recall – Parts are now available - Certain 2.1m vehicles equipped with side extender mounted intermediate marker lamp/turn signals do not meet FMVSS 108, Table 1-a requirements, for intermediate side marker lamps and reflex reflectors for vehicles 30 ft. and greater overall length. Failure to adequately warn surrounding or oncoming motorists of vehicle presence during conditions of reduced visibility may increase the risk of a crash.					
Supplier	Kenworth Truck Company					
Description	T680, T880, and W990 vehicles equal to or greater than 30 feet long require a reflex reflector.					
Release Date						
Introduction	Kenworth Truck Company has determined that a defect, which relates to motor vehicle safety, exists in certain T680, T880, and W990 chassis manufactured from December 10, 2012 through October 10, 2018 fail to conform to Federal Motor Vehicle Safety Standard (FMVSS/CMVSS) No. 108 - Table 1-a requirements, which require an intermediate side marker lamp and reflex reflector. Failure to adequately warn surrounding or oncoming motorists of vehicle presence during conditions of reduced visibility may increase the risk of a crash.					
	Revision Notes 01/07/2019: Recall has been updated with repair and warranty claim information.					
Situation	1627 (1555 U.S. and 72 Canada) T680, T880, and W990 chassis built from 12/10/2012 through 10/10/2018 equipped with an extender mounted intermediate marker lamp/turn signal.					

Recall Template

Resolution	 Service all chassis affected that enter your dealership, even if the customer has no issue with the chassis. 1. Review the attached chassis list for your dealer code and schedule your customer(s) for service if their chassis is on the list. 2. If you are not using Service Management to start repair orders, review DWWC or SIR for "Complete" next to the "18KWF" campaign code prior to performing this repair. 3. Follow the procedures below to install reflective tape below the extender mounted marker lamp/turn signal. 							
It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.								the defect
Warranty	 There is no time or mileage limit for this recall. Kenworth will pay for parts at dealer net plus applicable mark-up and labor: 0.3 hours labor to install reflective tape on both extenders. File a long form claim. File a long claim for extraordinary circumstances (which must be explained). Take-Off Parts Disposition: N/A							
		Failure Location:		034-004-021		Work Accomplished:	05	-
		Failure Type:		705		Responsibility Code:	01	-
		SRT Cod	ode: 034-018 Clair Recall 18KWF: Install reflective tape on both extenders		Claim Type:	C		
Parts	Parts are available at PPD							
	Qı	Quantity Part N		umber		Description		
	2		41153GR0		REFLECTOR YELLOW MINI STICK-ON RECT			
		2	Source	Locally	Alcohol surface prep/wipe pad or equivalent			
Labor								

Recall Template

Procedure	 If needed, print a copy of the template located in the attachments (there is a decimal and fractional version of the template, print the template that works best for you). Ensure the measurements indicated on the template are accurate, and then cut the template out of the paper. Clean the area below the extender mounted intermediate marker lamp/turn signal. Position the opening in the template over the intermediate marker lamp/turn signal. Install the reflective tape in the opening at the bottom of the template. The finished result should be similar to this image.
Shipping	
Freight	
Contact	
Attachments	Dealer\Chassis List Customer Letter <u>Reflex Reflective Tape Installation Template, decimal measurement</u> <u>Reflex Reflective Tape Installation Template, fractional measurement</u> <u>Reflex Reflective Tape Installation Template, metric measurement</u>