#### **TECHNICAL INSTRUCTIONS**

#### **FOR**

# SAFETY RECALL J0A/J0B/J0C FRONT PASSENGER AIRBAG INFLATOR MODULE CERTAIN 2002 –2007 MODEL YEAR SEQUOIA

**Update 10/17/2019** 

#### **Update 10/17/19**

The model year has been expanded to 2007 model year

#### **Update 6/9/19**

- The scanning process has been updated

#### **Update 12/20/18**

The inflator installation procedure has been updated

#### **Update 12/18/18**


- Images have been updated to reflect the new parts

All dealership technicians performing this recall are required to successfully complete the most current version of the E-Learning course "Safety Recall and Service Campaign Essentials". To ensure that all vehicles have the repair performed correctly; technicians performing this recall repair are required to have successfully completed E-Learning course SC18A (if you had previously completed E-Learning Course SC13B, you do not have to take SC18A), in addition to "Safety Recall and Service Campaign Essentials", and currently hold <u>at least one</u> of the following certifications levels:

- Toyota Certified (Electrical)
- Toyota Expert (Any Specialty)
- Master
- Master Diagnostic Technicians


#### I. OPERATION FLOW CHART

The flow chart is for reference only. *DO NOT* use it in place of the full technical instructions. Follow *ALL* steps as outlined in the full technical instructions to confirm the campaign is completed correctly.

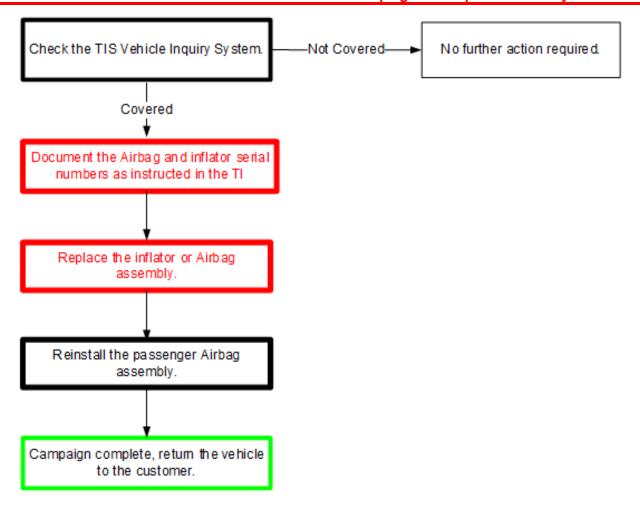

#### II. BACKGROUND

The subject vehicles are equipped with front passenger airbag inflators produced by Takata. The propellant in these inflators may degrade after prolonged exposure to high absolute humidity and fluctuating high temperatures. Degraded propellant can cause the inflator to explode during airbag deployment. In the event of an inflator explosion, metal fragments could pass through the airbag cushion material, striking the vehicle occupants, and result in serious injury or death.

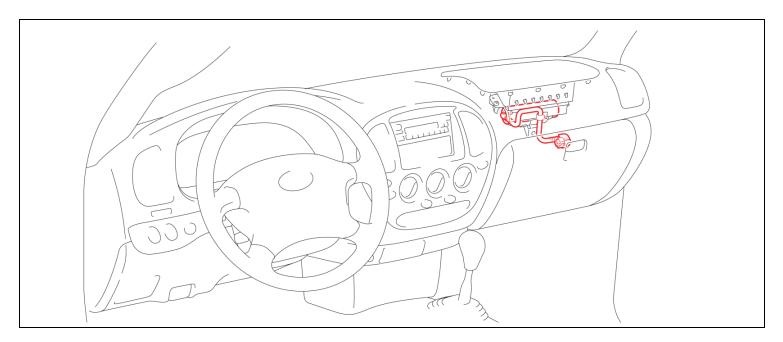

#### III. IDENTIFICATION OF AFFECTED VEHICLES

#### A. INVOLVED VEHICLES

- Check the TIS Vehicle Inquiry System to confirm the VIN is involved in this Safety Recall, and that the campaign has not already been completed prior to dealer shipment or by another dealer.
- TMS warranty will not reimburse dealers for repairs conducted on vehicles that are not affected or were completed by another dealer.

# IV. PREPARATION A. PARTS

Part Number	Part Description		Quantity	
04008-03712	INFLATOR ASSY KI	T, INSTR PI	NL AIR BAG*	1
*The kit above includes the following parts.				
	Inflator	1		
,	Self Locking Nut	4		
	Electro Tap	1		
	04008-03712 *The kit al	04008-03712 INFLATOR ASSY KI  *The kit above includes the following linflator Self Locking Nut	04008-03712 INFLATOR ASSY KIT, INSTR PI  *The kit above includes the following parts.  Inflator 1 Self Locking Nut 4	04008-03712 INFLATOR ASSY KIT, INSTR PNL AIR BAG*  *The kit above includes the following parts.  Inflator 1 Self Locking Nut 4

Model Year	Part Number	Part Description	Quantity
2005-2007 Sequoia	04008-10112	AIR BAG ASSY KIT, INSTR PNL PASS	1

#### **Non-Desiccated Part Recovery**

Dealers should <u>discontinue the installation</u> of the non-desiccated parts listed below for recall, customer pay repairs AND over-the-counter sales (if applicable).

Model	Model Year	Location	Part Number	Part Description	Qty
	2002-2004	48 States in Continental U.S.	04003-2810C		
Cognojo		USTT, Hawaii & AK	04003-1110C	INFLATOR ASSY KIT,	4
Sequoia	2005-2007	48 States in Continental U.S.	04004-7520C	INSTR PNL AIRBAG	'
		USTT, Hawaii & AK	04004-7510C		

Model	Model Year	Part Number	Part Description
Sequoia	2002-2004	73970-0C020-B0	
		73970-0C020-B1	AID DAC ACCV
		73970-0C020-E0	AIR BAG ASSY,
	2005-2007	73970-0C021-B0	INSTR PNL PASS
		73970-0C021-B1	

Toyota requires all dealers to return any parts listed above that still remain in dealer inventory by utilizing the Hazmat Part Return Program available. Dealers will be issued a refund for all part returns. This part return program is outlined in *PANT Bulletin 2014-042*.

#### **Important Note:**

In order to return the inflator, packages must **NOT** be opened/tampered with.

#### A. TOOLS & EQUIPMENT

Standard hand tools

Torque wrench

Electrical Tape

Molding remover set

Techstream


Zip Tie

**OPTIONAL SST** – This is an essential special service tool that the dealership should have. This tool is not mandatory when performing this repair.

Part Number	Part Name	Quantity	
09890-47010-01	Anti-Static Mat Set	1	

**E04 CAMPAIGN TOOLS** – These tools where previously provided to the dealership for campaign D0F and will

be used for campaign E04. These tools are required when performing this repair.

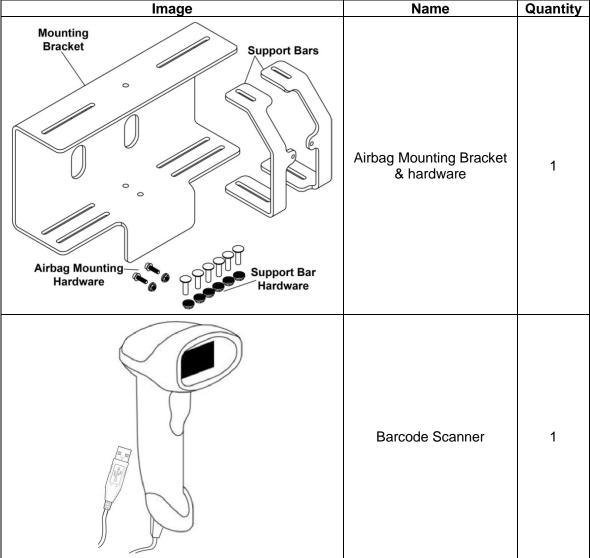

NOTE: These tools *CANNOT* be ordered through the parts or tools system. There is a very limited supply of tools, but if additional tools are needed, contact your regional representative.


#### V. SAFETY PRECAUTIONS



#### **CRITICAL INFORMATION – READ THOROUGHLY**



Failure to follow these procedures correctly could cause the SRS to unexpectedly deploy during servicing or the SRS may fail to operate correctly when required after reassembly. Confirm all work is performed as described in these instructions.

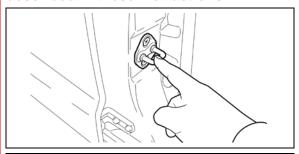

#### 1. ELIMINATE STATIC ELECTRICITY

a) Before starting work and periodically while working on the vehicle, touch a metallic part of the vehicle to discharge static electricity in the body.



#### 2. DO NOT MEASURE RESISTANCE

a) **DO NOT** measure resistance of airbag components, this may cause accidental activation.



 
#### 3. HANDLE THE AIRBAG CAREFULLY

a) If an inflator is dropped, replace it with a **NEW** inflator.



#### 4. DO NOT ALLOW FOREIGN OBJECTS NEAR AIRBAG

- a) Be sure to collect and account for all removed nuts/bolts to prevent them from landing in the airbag assembly.
- b) Any foreign objects in the airbag assembly may cause damage or injury if the airbag is activated.




Wear protective eye wear and work gloves.

#### 5. WEAR PROTECTIVE EQUIPMENT

a) Always wear appropriate protective equipment when working on the SRS.

#### VI. SRS SYSTEM HEALTH CHECK

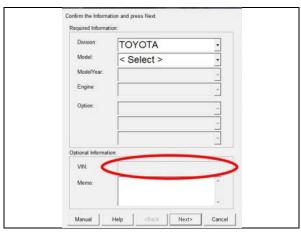

#### 1. PERFORM A HEALTH CHECK

- Confirm the Techstream is connected to the dealership's internet.
- b) When launching the Techstream software the VIN *MUST* be entered manually.


NOTE: All letters of the VIN *MUST* be entered in ALL CAPS, or the VIN will need to be reentered when running the diagnostic report.

c) Perform a health check.

Note: The VIN may auto populate on the later model year vehicles, if this happens DO NOT change the VIN.

#### 2. RUN A DIAGNOSTIC REPORT

a) After the health check has completed, run a diagnostic report by clicking on the link on the health check screen.

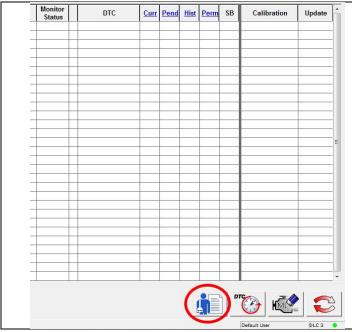

NOTE: If the VIN was not entered in ALL CAPS when Techstream was launched, an error will be displayed and there will be a prompt to reenter the VIN






 Enter the vehicle mileage and repair order information, then click the 'report' button.



- The VIN MAY NEED to be entered manually in ALL CAPS when launching the Techstream software. The VIN MAY NOT auto-populate on vehicles prior to the 2006 MY.
- A health check and diagnostic report with VIN *MUST* be performed within the last 36 hours and recorded by TMS. If the diagnostic report is not run, the healthcheck will not be recognized by TMS.
- The serial number checker application will be disabled and the inspection cannot be completed if a health check and diagnostic report is not performed and recorded by TMS.

#### **VII. INSPECT INFLATOR TYPE**

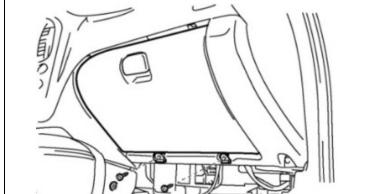



#### 1. REMOVE THE GLOVE BOX AND FINISH PANEL

- a) Remove the 2 screws and the glove box.
- b) Remove the 3 screws, disconnect the courtesy light connector and remove the lower No.2 finish panel that is behind the glove box.

#### 2. INSPECT INFLATOR TYPE

a) Inspect the inflator to determine if it has a large nut on the right side as shown.

NO: Proceed to section VIII.

**YES:** The vehicle is **NOT INVOLVED** in the Safety Recall.

Reinstall the glove box and return the vehicle to the customer.

#### VIII. WORK AREA PREPARATION





#### CRITICAL INFORMATION – READ THOROUGHLY



The bracket assembly that was provided at the launch of SSC D0F is a critical added-safety feature that *MUST* be used when replacing the inflator module. Confirm the bracket assembly is installed securely in the vise and confirm the work area being used is appropriate. The anti-static mat set that is an essential SST may be available at your dealership and is optional to use during inflator replacement. If the anti-static kit is not available, before starting work and periodically while working on the vehicle, touch a metallic part of the vehicle to discharge static electricity in the body.

Confirm there are no loose objects or people exposed to the back side of the bracket for safety in the unlikely event of airbag deployment due to improper work procedures (Remember that the inflator *IS NOT* being replaced due to an inadvertent deployment concern).

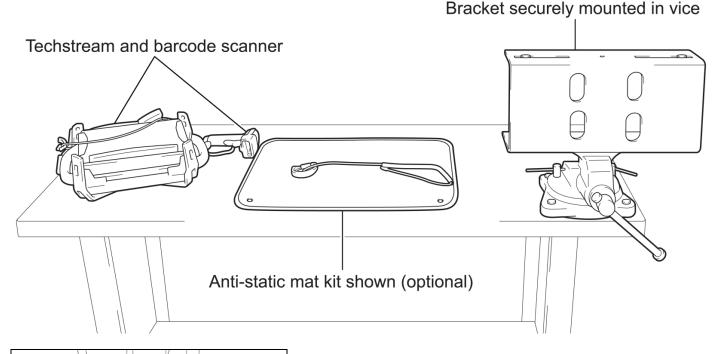

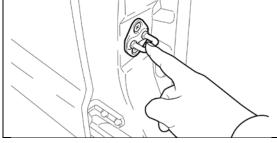

If the anti-static kit is not available, before starting work and periodically while working on the vehicle, touch a metallic part of the vehicle to discharge static electricity in the body.

#### IX. FRONT PASSENGER AIRBAG ASSEMBLY REMOVAL


#### 1. DISCONNECT THE NEGATIVE BATTERY CABLE




- Wait at least 90 seconds after disconnecting the cable from the negative battery terminal to prevent airbag and seat belt pre-tensioner deployment.
- Follow all precautions as outlined on TIS before servicing the SRS system.

#### 2. REMOVE THE PASSENGER AIRBAG ASSEMBLY

- a) Refer to TIS for airbag removal instructions:
- b) <u>2002-2005</u> <u>2006</u> <u>2007</u>

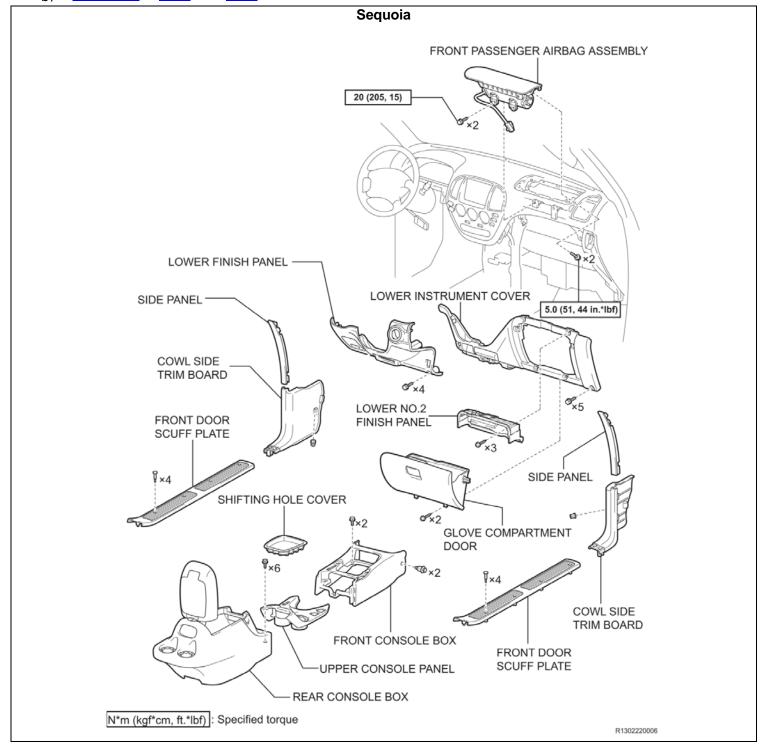

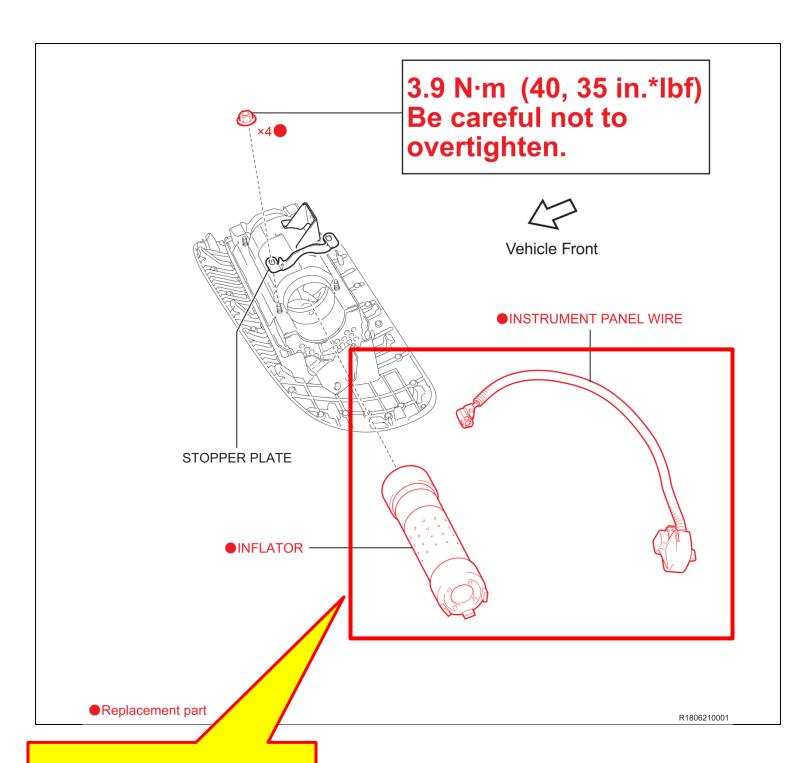

### <Caution!>


The inflator wire harness has been connected to the new inflator.

Don't remove the wire harness from the inflator.

#### 3. LAUNCH THE SERIAL NUMBER RECORDING APPLICATION



- The AIRBAG ASSEMBLY, ORIGNAL INFLATOR, and NEW INFLATOR serial numbers MUST be recorded using the barcode scanner (provided at the launch of SSC D0F).
- The barcode scanner application *MUST* be completed on every vehicle. These numbers *MUST* be included on every warranty claim that is submitted for inflator module replacement or the claim may be subject to debit.
- The technician performing the work *MUST* have valid TIS login credentials and an internet connection to perform the inspection and scanning process.

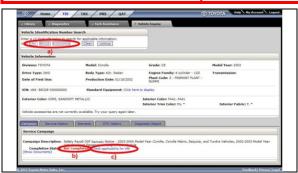

- a) Log in to TIS and input the VIN of the vehicle in the Vehicle Inquiry tab.
- b) Confirm the VIN is applicable and that the campaign has not been completed.
- Click on the link to launch the serial number recording application.
- d) Reenter TIS password in the serial number recording application.

NOTE: The person logged-in to TIS <u>MUST</u> be the person performing the repair.



e) Record the vehicle mileage into the serial number recording application.

#### NOTE:

- A task status screen will populate next and at other intervals during the repair. This screen will indicate if the inflator was replaced or in some limited cases that the entire airbag assembly was replaced. Click 'next' to proceed to the next step. This information will be used for record keeping by TMS.
- If this screen indicates that the campaign has already been completed on this VIN, there is no need to perform campaign again.

#### 4. CONNECT THE BARCODE SCANNER

- Connect the barcode scanner to the USB port on the Techstream.
- The scanner will automatically connect and a beep will be heard when the scanner is ready.

#### NOTE:

- The scanner was provided for SSC D0F.
- The barcode scanner works best in low light conditions.
- Always hold the scanner directly in front of and parallel to the barcode label.

#### 5. SCAN THE AIRBAG SERIAL NUMBER

# ATTENTION: This information is CRITICAL

- a) Scan the **AIRBAG ASSEMBLY** serial number 2 times.
  - 1) Confirm the cursor is in the first serial number box then scan the serial.
  - 2) Position the cursor in the second serial number box then scan the serial.
- b) Click next.

#### NOTE:

- If both serial numbers that are entered do not match, confirm and reenter.
- If the serial number barcode will not scan, it can be entered manually.

#### **AIRBAG SERIAL NUMBER IDENTIFICATION**


- The airbag serial number is *ALWAYS* the 12 *DIGITS* located between the asterisks.
- The 3 digits before the asterisk ARE NOT part of the serial number, and SHOULD NOT be entered or an inaccurate response may be returned.

Airbag Serial Number Label Example



STOP


The AIRBAG ASSEMBLY serial number and the INFLATOR serial number are DIFFERENT. The AIRBAG ASSEMBLY serial number MUST be recorded prior to replacement.

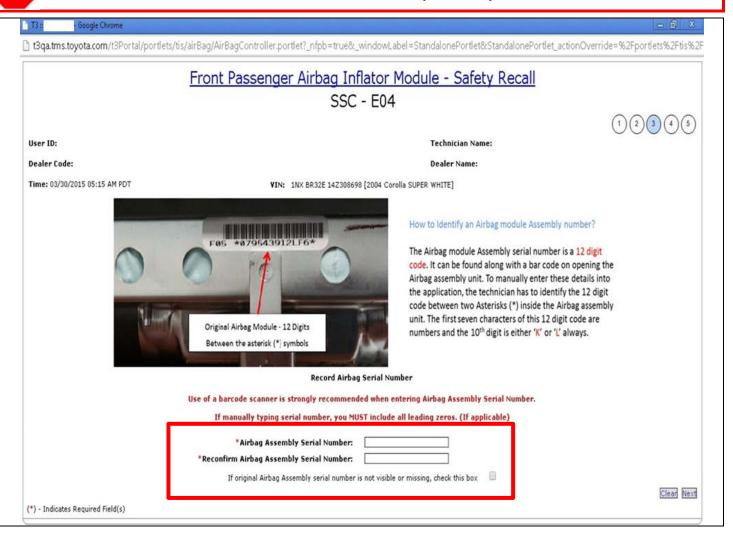

# AIRBAG ASSEMBLY SERIAL NUMBER <u>FOR 2005 MY SEQUOIA</u> (OR IS MISSING OR IS UNREADABLE)



If the airbag serial number and barcode are not legible or are not present, check the box in the application indicating the serial number is not legible and contact your regional representative.

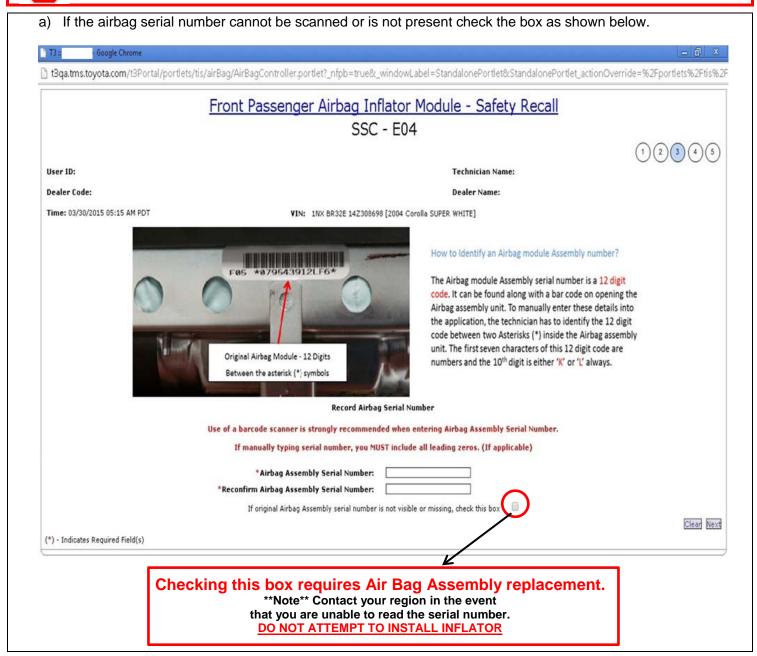

b) After the Region approves the Airbag Assembly replacement and the new part is received, scan the NEW airbag barcode in the Serial Number Recording Application. 🕽 t3qa.tms.toyota.com/t3Portal/portlets/tis/airBag/AirBagController.portlets?\_nfpb=true&\_windowLabel=StandalonePortlet&StandalonePortlet\_actionOverride=%2Fportlets%2Ftis%2 Front Passenger Airbag Inflator Module - Safety Recall SSC - E04 User ID: Technician Name: Dealer Code: Dealer Name: Time: 03/30/2015 05:15 AM PDT VIN: 1NX BR32E 14Z308698 [2004 Corolla SUPER WHITE] How to Identify an Airbag module Assembly number? The Airbag module Assembly serial number is a 12 digit code. It can be found along with a bar code on opening the Airbag assembly unit. To manually enter these details into the application, the technician has to identify the 12 digit code between two Asterisks (\*) inside the Airbag assembly unit. The first seven characters of this 12 digit code are Original Airbag Module - 12 Digits numbers and the 10th digit is either 'K' or 'L' always. Between the asterisk (\*) symbols **Record Airbag Serial Number** Use of a barcode scanner is strongly recommended when entering Airbag Assembly Serial Number. If manually typing serial number, you MUST include all leading zeros. (If applicable) \*New Airbag Assembly Serial Number: \* I agree to complete the safety recall's remaining technical instructions. \* I agree to perform a vehicle Health Check with Techstream upon completion of the safety recall's technical instructions. (\*) - Indicates Required Field(s) Next The new AIRBAG ASSEMBLY serial number MUST be recorded prior to reinstallation to



The new AIRBAG ASSEMBLY serial number MUST be recorded prior to reinstallation to track the airbag assembly to the vehicle.


#### X. INFLATOR REPLACEMENT ONLY FOR 2002 - 2004 MY SEQUOIA





#### **CRITICAL INFORMATION – READ THOROUGHLY**




The connector of the inflator module contains a short circuiting mechanism to eliminate voltage variances when the connector(1) is disconnected. To allow for the replacement of the inflator module, a new short circuit(2) *MUST* be created before cutting the wires(3) and removing the inflator. The following steps *MUST* be followed exactly as described to ensure the work is completed correctly and safely.

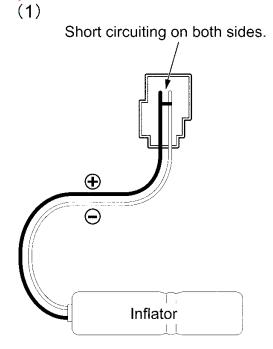


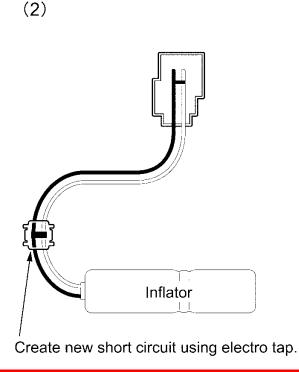

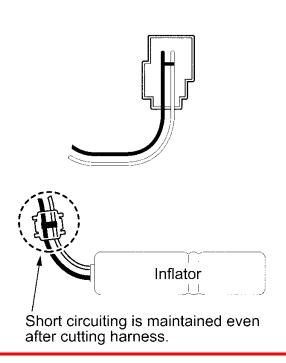

(3)

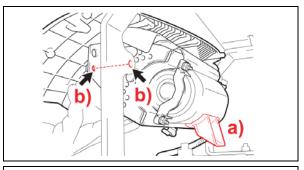

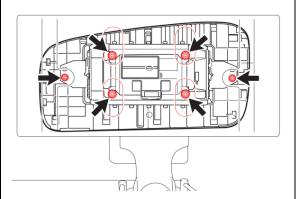


#### MOUNT THE AIRBAG IN THE MOUNTING BRACKET

- a) Position the airbag assembly so that the center mounting bracket is facing towards the ground.
- b) Install the airbag to the support bars with the bolts supplied in the bracket kit.

NOTE: The airbag assembly will only fit on the support brackets one way.


- c) Position the airbag so that all four stopper plate nuts can be removed through the access holes.
- Tighten the bolts holding the support bars to the mounting bracket.
- e) Confirm the following:
  - Mounting bracket is secure in the vise.
  - Airbag is secure in the support bars.
  - The center mounting bracket on the airbag assembly is facing downward.
  - Support bars are secure on the mounting bracket using 1 bolt/nut at the top of each support bar and 2 nuts/bolts at the bottom of each support bar.

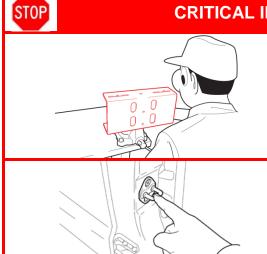


#### CRITICAL INFORMATION – READ THOROUGHLY

ALWAYS keep as much of your body as possible in front of the bracket when working on the airbag assembly.

 Remember to periodically touch a metallic part of the vehicle to discharge static electricity in the body if the anti-static kit is not being used.

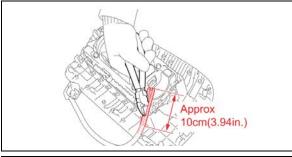



#### 2. PREPARE TO INSTALL THE SHORT CIRCUIT

 a) Cut the yellow corrugated tube on the harness approximately 4 inches (10 cm) using nippers.





- DO NOT damage the wires in the tube.
- DO NOT use a knife or razor blade to cut the tube to avoid damaging the wires.
- This may be performed on either end of the inflator.
- b) Cut off the tab of the electro tap shown in the illustration.

NOTE: The electro tap is included in the inflator parts kit.



This tab MUST be removed to ensure a good short.

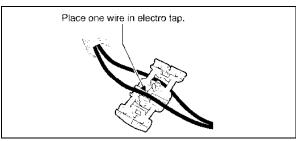

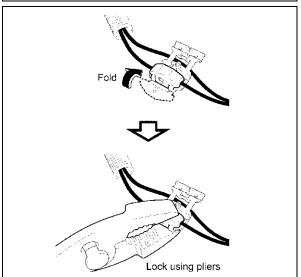


#### 3. CREATE A NEW SHORT CIRCUIT IN THE INFLATOR HARNESS

a) Place one wire in the electro tap as shown in the illustration.

b) Fold and pinch the half of the electro tap with the wire and use pliers to lock the electro tap.

#### NOTE:


- DO NOT work on both wires at the same time to avoid errors.
- Pliers MUST be used to confirm the electro tap is firmly locked in place.

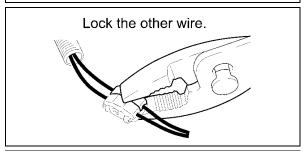

c) Set the other wire in the electro tap and lock it in place using pliers.





**DO NOT** measure resistance of the inflator wires, this may cause accidental activation.

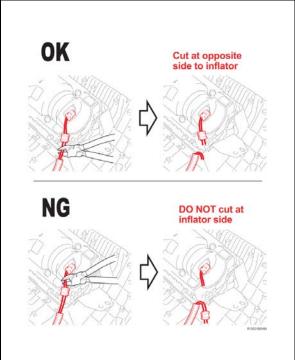

#### 4. CUT THE INFLATOR WIRES

a) Cut the 2 wires at the side of the electro tap that is farthest away from the inflator.

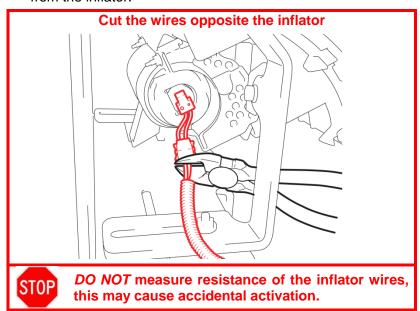

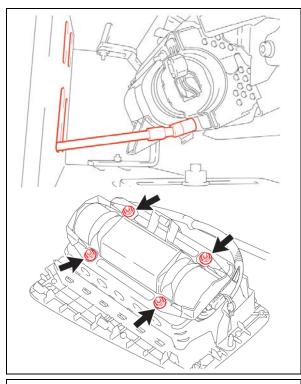


#### 5. REMOVE THE SELF LOCKING NUTS

a) Use the access holes in the bracket to remove the 4 nuts.

#### NOTE:

- DO NOT use power tools.
- The bracket support bars may need to be repositioned to remove the nuts through the access holes.

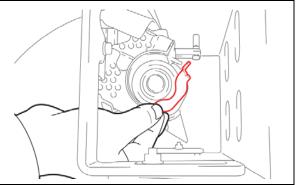


b) Remove the stopper plate and place in a secure location because it will be reused.




DO NOT discard the Stopper Plate, it will be reused.

c) Discard the 4 nuts as they are not to be reused. **NOTE:** *DO NOT* reuse the old nuts, new nuts *MUST* be used.

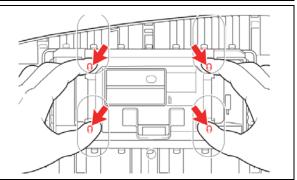

#### 6. REMOVE THE INFLATOR

a) Gently push in the 4 studs to loosen the inflator for removal.

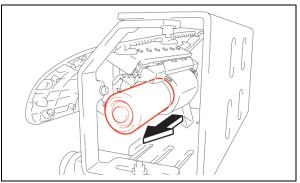

b) Remove the inflator from the airbag assembly and place it on a safe work surface.




# ENSURE YOU ENTER BOTH THE OLD AND NEW INFLATOR SERIAL NUMBERS IN THE APPROPRIATE SPOT OF THE APPLICATION -DO NOT ENTER THE AIRBAG SERIAL NUMBER FOR THIS STEP-



- 7. SCAN THE OLD AND NEW INFLATOR SERIAL NUMBER
  - a) Scan the OLD inflator serial number and mark the old inflator so that it will not be reused.
  - b) Scan the **NEW** inflator serial number.


## ATTENTION: This information is CRITICAL

- It is used to confirm the correct inflator is removed from the vehicle.
- It is recorded by TMS to trace the return parts shipment.
- It is used to track the new inflator that is being installed in the vehicle.

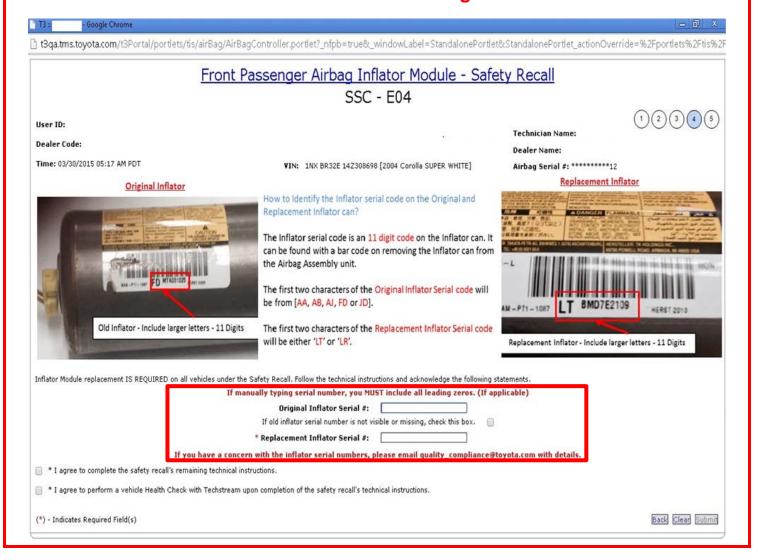




Depending on the serial data scanned during a previous Takata repair, you may NOT be asked to enter an Original Inflator Serial Number

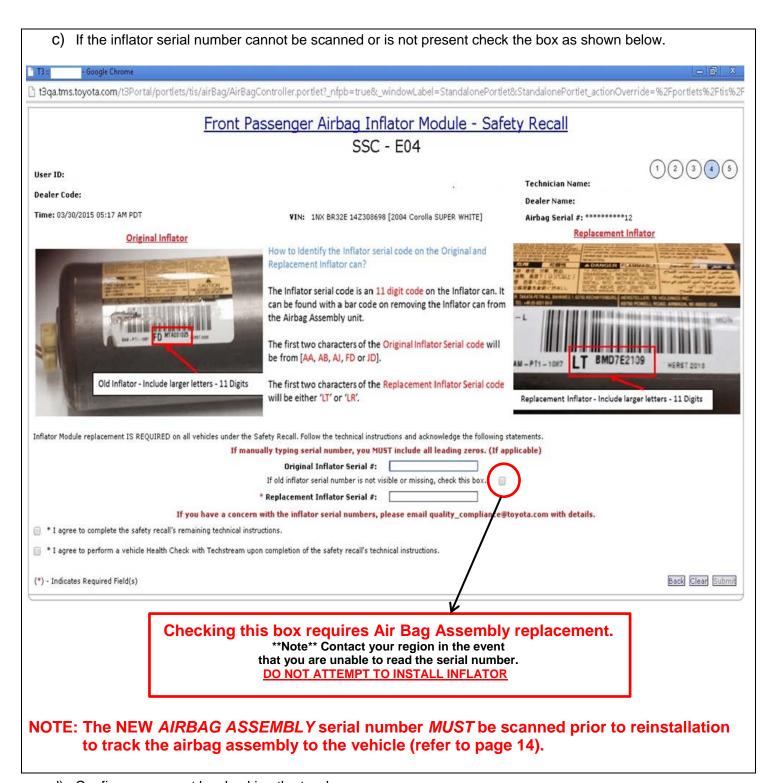


- d) Confirm agreement by checking the two boxes.
- e) Record the Warranty Authorization # to be included in the warranty claim.
- f) Place the old inflator in the parts box and take it immediately to the parts department.

#### NOTE:

- Confirm the cursor is in the correct serial number input box before scanning.
- If the serial number barcode will not scan, it can be entered manually.
- If there are any difficulties or concerns with this process, email quality\_compliance@toyota.com with details.

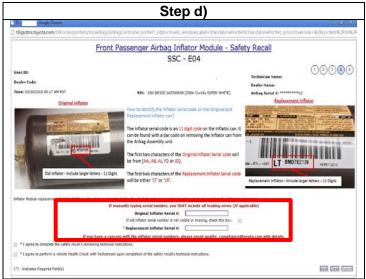




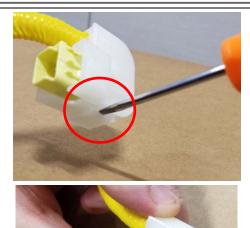


#### 8. REMOVE NEW INFLATOR CONNECTOR COVER

a) Carefully use a pocket screwdriver to disengage the first release tab as shown in the image

b) Carefully use a pocket screwdriver to disengage the second release tab as shown in the image

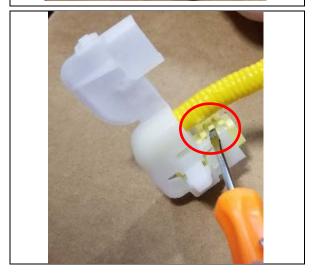


c) Open the connector cover. Once open carefully use a pocket screwdriver to disengage the release tab and remove the connector cover from the connector

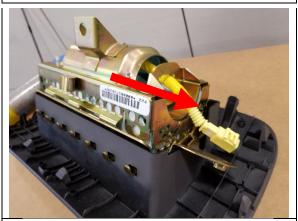



#### 9. INSTALL THE NEW INFLATOR

a) Route the inflator wire harness through the stopper plate

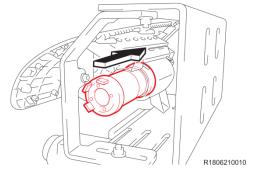

b) Carefully slide the new inflator into the airbag assembly.





c) Confirm the harness is not pinched by the stopper plate





#### 10. REINSTALL THE INFLATOR CONNECTOR COVER

- d) Install the connector into the connector cover. Ensure the release tab on the connector is engaged into the connector cover.
- e) Once the connector is installed into the connector cover, close the connector cover over the connector.
- Wrap electrical tape around the connector to prevent the connector from opening.

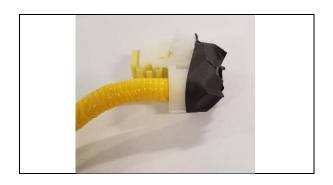

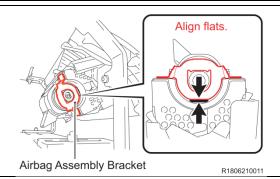

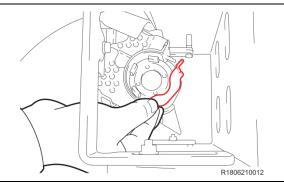

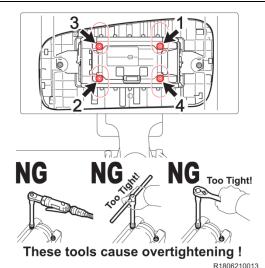

#### 11. CONFIRM THE INFLATOR ALIGNMENT

 Align the flat on the inflator with the flat on the airbag assembly bracket.



Confirm the flats on the airbag assembly and inflator are aligned.

#### 12. REINSTALL THE STOPPER PLATE.

g) Place the stopper plate on the airbag assembly.



The inflator stopper plate is reused at this step; a new one is not included in the inflator kit.

- h) Install stopper plate nuts (**NEW**) by hand. They will be torqued on a later step.
- i) Install the **NEW** nuts on the airbag assembly bracket by hand. They will be torqued on a later step.


#### 13. TORQUE THE PLATE NUTS

a) Tighten the nuts evenly in two increments following the sequence shown in the illustration. Use a socket driver or torque wrench to tighten the nuts.

Torque: 35in. lbf (3.9N·m)



- There will be some resistance when tightening the nuts because they are self-locking, confirm the nuts are tightened correctly.
- DO NOT use a power tool, T-handle, or ratchet when tightening the nuts to avoid over torqueing.

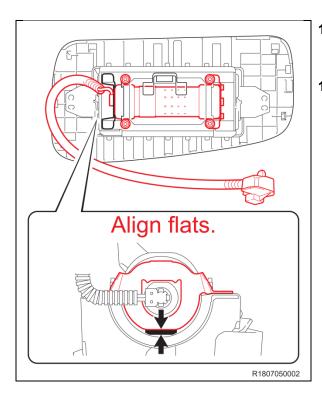

#### 14. REMOVE THE AIRBAG ASSEMBLY FROM THE BRACKET

a) Remove the two bolts and the airbag assembly, then place the assembly on a cloth or the anti-static mat if it being used.

#### 15. INSPECT THE AIRBAG BEFORE INSTALLATION

- a) Confirm that the 4 **NEW** nuts are installed and tight.
- b) Confirm the stopper plate is reinstalled.
- c) Confirm the flats on the airbag assembly bracket and inflator are aligned.
- d) Confirm the inflator harness connector is secure and installed in the correct direction.
- e) Confirm that the harness is engaged in the clamp.

#### XI. FRONT PASSENGER AIRBAG ASSEMBLY INSTALLATION

#### 1. REINSTALL THE AIRBAG ASSEMBLY

Note: During reinstallation of the airbag assembly, ensure the 12mm bolt and two 10mm nuts securing the airbag assembly to the instrument panel are installed and torqued to the required specification identified on TIS.

c) Refer to TIS for installation instructions: 2002-2005 2006 2007

#### 2. RECONNECT THE NEGATIVE BATTERY CABLE

#### 3. PERFORM A HEALTH CHECK AND DIAGNOSTIC REPORT


NOTE: Enter the VIN when performing the health check in order for the data to be recorded by TMS.

#### ■ VERIFY REPAIR QUALITY ▶

- Confirm all precautions are follow to ensure safety during the repair
- Confirm the entire serial number checker application is completed and the warranty authorization # is recorded on EVERY vehicle
- Confirm the old inflator is handled safely and given to the appropriate parts professional for shipment
- Confirm the inflator harness connector is fully engaged and that the stopper plate is installed correctly
   If you have any questions regarding this update, please contact your area representative.

#### XII. APPENDIX

#### A. CAMPAIGN DESIGNATION DECODER

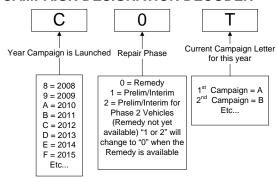

#### **B. CAMPAIGN PARTS DISPOSAL**

**ALL** inflators that are removed from vehicles under this campaign **MUST** be packaged and shipped back to the inflator manufacturer following the manufacturer's instructions. The instructions can be found in the following locations:

Attached to the dealer letter