

L73X-
R.01.18

To: Official after-sales network.
Subject: Replacement of homologation label.
Date: 25/05/2018
Pages: 7



Campaign code.

L73X-R.01.18

Campaign description.

Replacement of homologation label.

Model.

Centenario Coupé And Roadster

Special or Limited Versions.

Centenario Coupé And Roadster

Model year.

2017.

Market.

United States Of America and Europe.

VIN identification

Centenario Coupé

| | | |
|------------|------------|------------|
| ..HLA05843 | ..HLA06040 | ..HLA06209 |
| ..HLA06523 | ..HLA06071 | ..HLA06117 |
| ..HLA05925 | ..HLA06089 | ..HLA06451 |
| ..HLA05976 | .. | .. |

Centenario Roadster

| | | |
|------------|------------|------------|
| ..HLA06260 | ..HLA06559 | ..HLA06664 |
| ..HLA06613 | ..HLA06775 | ..HLA06394 |

Warning: before starting with the repair, log into the Warranty portal and check through VIN Info:

- The vehicle is effectively involved by these bulletin instructions; some cars may not be included even when they are in the VIN range.
- The procedure identified by a letter (e.g. A, B or C....etc. whose differences are explained below in this bulletin), taking care to order and use the parts corresponding to the assigned procedure.

Example



NOTE

Procedure A will be available only when the instructions require to carry out a preliminary control to determine whether or not a vehicle needs to be updated.

Information to the field

Due to continuous product monitoring, Automobili Lamborghini Spa found some vehicles equipped with the Manufacturer Certification Label that lists an incorrect weight limit.

Field solution

The instructions herein detailed describe one procedure which concerns the replacement of the manufacturer label (identified by operations from A to G depending on the required part number)

Spare parts.

Order the part number according to the market of the car and the model

A. Centenario Coupé

a) Adhesive label

| p/n | desc | Q |
|------------|------------------|---|
| 476010525D | Label for Europe | 1 |
| 476010525E | Label for USA | 1 |

b) Owner's manual

| p/n | desc | Q |
|-------------|------------------------------|---|
| 476012723AK | Owner's manual for US market | 1 |
| 476012720AH | Owner's manual In English | 1 |
| 476012701AH | Owner's manual in German | 1 |

c) Temperature strips

| p/n | desc | Q |
|-----------|--------------------|---|
| 47A010003 | Temperature strips | 3 |

B. Centenario Roadster

a) Adhesive label

L73X-
R.01.18

To: Official after-sales network.
Subject: Replacement of homologation label.
Date: 25/05/2018
Pages: 7



| p/n | desc | Q |
|------------|------------------|---|
| 475010525D | Label for Europe | 1 |
| 475010525E | Label for USA | 1 |

b) Owner's manual

| Codice | desc | Q |
|-------------|------------------------------|---|
| 475012720AK | Owner's manual In English | 1 |
| 475012723AL | Owner's manual for US market | 1 |
| 475012701AK | Owner's manual in German | 1 |

c) Etichetta termica

| Codice | desc | Q |
|-----------|--------------------|---|
| 47A010003 | Temperature strips | 3 |

Replaced parts management.

Store properly and label the parts replaced with the bar code form for their identification during Area Manager visits.

Labour time

For Operation B,C;D, E, F time is 0,35 h.


Substituted former Bulletins.

None.

Warranty Claim instructions

To claim the reimbursement log into the warranty system management on the Lamborghini Portal and consults the manual "W.Claim " available on the portal for the download .

Select the desired campaign and go on with the claim insertion, read carefully the windows message content and choose the option button corresponding to the operation performed .

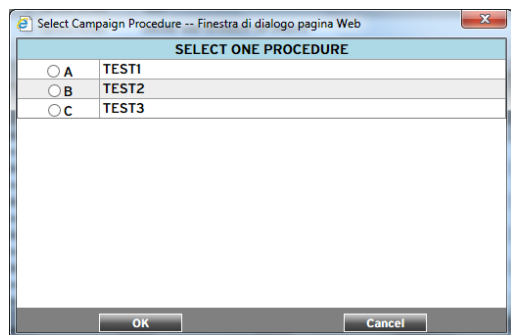

On the base of the chosen option the reimbursement will be:

Coupé:

- OPTION B, label replacement,
Labor: 0.35 h.
p/n: 476010525D, Label for Europe;
p/n : 476012701AH Owner's manual in German
P/n: 47A010003 Temperature strips
 - OPTION C, label replacement,
Labor: 0.35 h;
p/n: 476010525D, Label for Europe;
P/n: 476012720AH Owner's manual in English
P/n: 47A010003 Temperature strips
 - OPTION D, label replacement,
Labor: 0.35 h;
p/n: 476010525E, Label for USA;
P/n: 476012723AK Owner's manual for US market
P/n: 47A010003 Temperature strips
- Roadster:
- OPTION E, label replacement
Labor 0.35 h;
p/n: 475010525D, Label for Europe;
p/n : 475012701AK Owner's manual in German
P/n: 47A010003 Temperature strips
 - OPTION F label replacement,
Labor:0.35 h,
p/n: 475010525E Label for USA;
p/n : 475012723AL Owner's manual for US market
P/n: 47A010003 Temperature strips



ATTENTION!

Attach all documents produced during the vehicle visit that show evidence of the work performed such as repair order, software protocols or acquisitions...etc.; the lack of one or more of those, may deny the reimbursement.

Remember to fill in all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

L73X-
R.01.18

To: **Official after-sales network.**
Subject: **Replacement of homologation label.**
Date: **25/05/2018**
Pages **7**



Automobili Lamborghini S.p.A.
Campagne service assistenza e campagne di richiamo / Service and Recall Campaign
Service et campagne de rappel / Campaña de Servicio y Llamada a Taller

| | | | |
|---------------------------|---------------------------|--------------------------|-------------------------------|
| Service Center Name | Service Center Address | Service Center Phone | Service Center City |
| Service Center Number | Service Center Country | Service Center Region | Service Center Postal Code |
| Service Center Date | Service Center Time | Service Center Fax | Service Center E-mail |
| Service Center Website | Service Center E-mail | Service Center Phone | Service Center City |
| Service Center Number | Service Center Country | Service Center Region | Service Center Postal Code |
| Service Center Date | Service Center Time | Service Center Fax | Service Center E-mail |
| Service Center Website | Service Center E-mail | Service Center Phone | Service Center City |
| Service Center Number | Service Center Country | Service Center Region | Service Center Postal Code |
| Service Center Date | Service Center Time | Service Center Fax | Service Center E-mail |
| Service Center Website | Service Center E-mail | Service Center Phone | Service Center City |

A. Equipment required


- Heat gun.



- Plastic bodywork tool.



- Heat reading stickers (graduated °C/°F, with full scale 116°C/240°F).

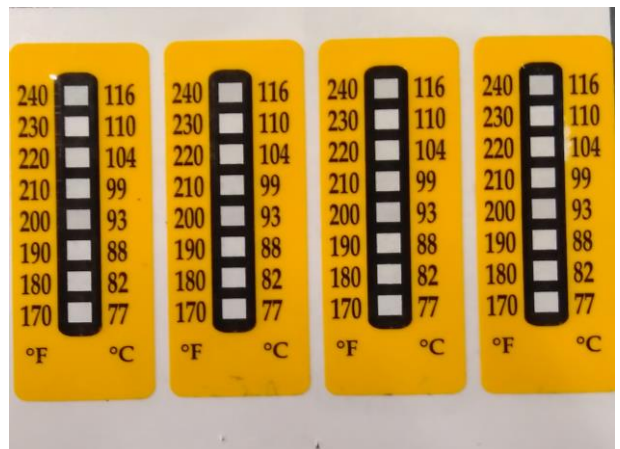



B. Label removal.



1. Identify the label to remove in the lower part of the driver door (see image).



2. Remove the upper seal.



3. Apply three heat reading stickers to monitor the temperature on the entire surface of the label.







- Heat the adhesive label using the heat gun. Stand about 10-15 cm away and perform even circular movements over the entire surface in order to uniformly heat the entire label do not focus on one particular point for more than 2 seconds; otherwise the paint may become damaged. Consequently, by making use of a removing plastic bodywork tool, gently remove the sticker by scratching and continuously applying heat.



NOTE


Removal starting from the bottom makes the job easier.

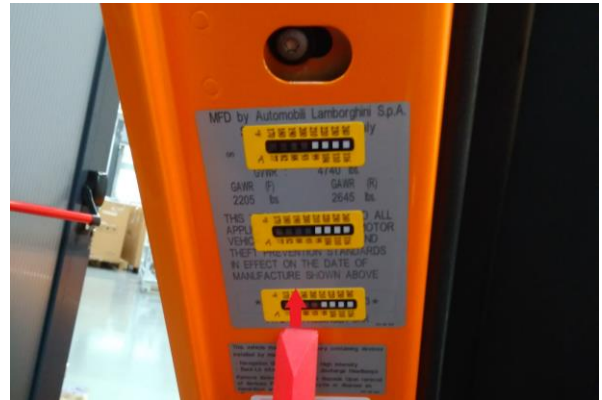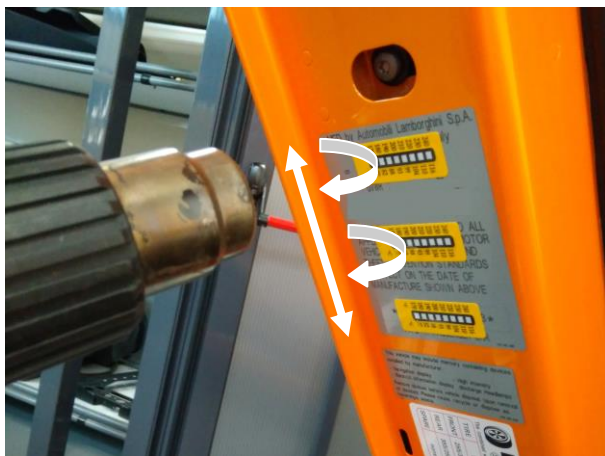

WARNING

Do not cross the temperature of 93°C (210°F) as the paint could come off near and under the identification label.


In case of crossing the limit temperature of 93°C (210°F), stop the operation and let the label's surface cool down for a couple of minutes to guarantee its proper cooling.

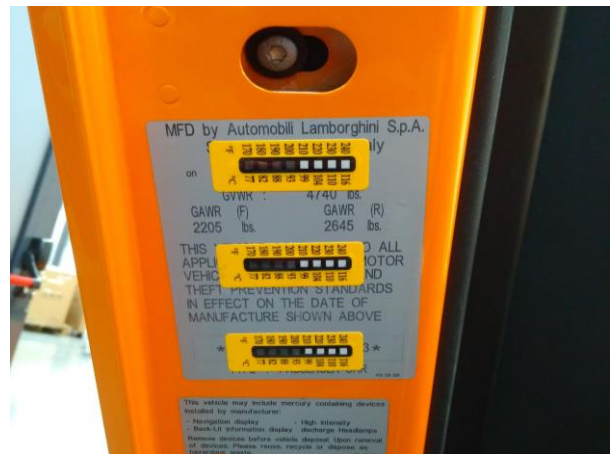



WARNING

It is normal if the homologation label comes off in fragments, as shown in the picture below.

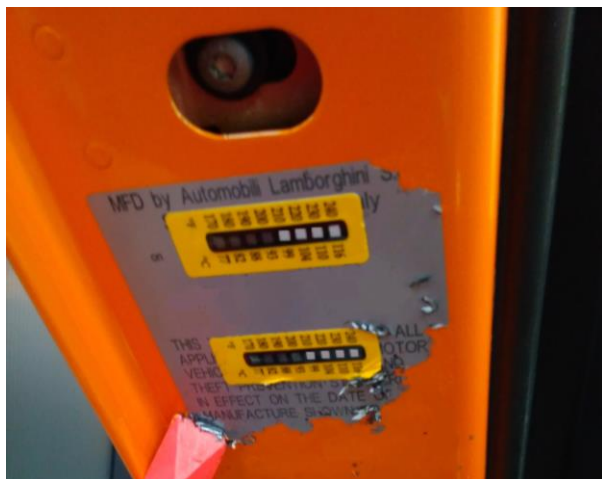

5. Completely remove the label and clean the surface with a soft cloth and a degreaser to eliminate all glue residue.



6. Glue on the new label



NOTE

For an accurate label alignment take as reference the edge of the door. In order to avoid any bubble under the surface of the label, please gently apply pressure from top to bottom with the plastic bodywork tool.



L73X-
R.01.18

To: Official after-sales network.
Subject: Replacement of homologation label.
Date: 25/05/2018
Pages: 7



7. Install the seal.



8. Lastly, substitute the old owner's manual with the new one.

For further information, don't hesitate to contact the Service Area Manager.

Rev.01

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A. pursuant to copyright law. The company reserves the right to make updates and modifications as needed. The reprinting, reproduction, distribution to unauthorized persons and/or to third parties, and the partial or complete translation of the material contained herein are prohibited without the express written consent of Automobili Lamborghini S.p.A.

7/7