

# Safety Recall Code: 20AV

Subject

**Fuel Line** 

Release Date

July 20, 2018

**Affected Vehicles** 

U.S.A. & CANADA: Certain 2013-2015 Model Year Audi A8 and S8 Vehicles

Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.

- ✓ Campaign status must show "open."
- ✓ If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign.

**Problem Description** 

Over time, the fuel supply line for the high pressure fuel pump may become porous, resulting in a fuel smell or a fuel leak. Leaking fuel, in the presence of an ignition source, may result in a fire.

**Corrective Action** 

Replace the fuel line.

**Precautions** 

Customers are advised to contact their authorized Audi dealer without delay if they notice a fuel smell in the vehicle.

**Parts Information** 

Parts will be allocated prior to owner notification. If allocated parts have been used and your dealership is at the weekly Upper Order Limit, please submit the backordered sales document number to <a href="mailto:upperorderlimits@audi.com">upperorderlimits@audi.com</a> to have additional parts released.

**Code Visibility** 

On or about July 20, 2018, affected vehicles will be listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on <a href="www.accessaudi.com">www.accessaudi.com</a> & OMD Web). A list will not be posted for dealers who do not have any affected vehicles.

On or about July 20, 2018, this campaign code will show open on affected vehicles in Elsa.

On or about July 20, 2018, affected vehicles will be identified with this campaign code in the VIN Lookup tool at <a href="https://www.safercar.gov">www.safercar.gov</a>.

**Owner Notification** 

Owner notification will take place July 2018. Owner letter examples are included in this bulletin for your reference.

**Additional Information** 

Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.

#### IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS

<u>New Vehicles in Dealer Inventory:</u> It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.

<u>Pre-Owned Vehicles in Dealer Inventory:</u> Dealers should not deliver any pre-owned vehicles in their inventory which are involved in a safety or compliance recall until the defect has been remedied.

Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before</u> <u>delivery to consumers</u>.

July 2018 20AV Page 1 of 11

#### **Claim Entry Instructions**

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action <u>open on the day of repair</u> to the repair order. If customer refused campaign work:

- ✓ <u>U.S. dealers:</u> Submit the request through Audi Warranty Online under the <u>Campaigns/Update</u> option.
- ✓ Canada dealers: Upload the repair order [signed by customer] to Audi WIN/Operations/Campaign Closure.

Service Number	20AV			
Damage Code	0099			
Parts Vendor Code	002			
Claim Type	Sold vehicle: 7 10			
	Unsold vehicle: 7 90			
Causal Indicator	Mark fuel line as causal part			
Vehicle Wash/Loaner	Do not claim wash/loaner under this action			
Criteria I.D.	FD			
	Replace Fuel Line			
	Labor operation:	2003 55 99	40 T.U.	
	Quantity	Part Number	Description	
	1.00	079133986AF	Fuel Supply Hose (line)	

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2018 Audi of America, Inc. and Audi Canada. All Rights Reserved.

July 2018 20AV Page 2 of 11

#### Customer Letter Example (USA)

<MONTH YEAR>

<CUSTOMER NAME>

<CUSTOMER ADDRESS>

<CUSTOMER CITY STATE ZIPCODE>

This notice applies to your vehicle: <VIN>

NHTSA: 18V430

Subject: Safety Recall 20AV - Fuel line

Certain 2013-2015 Model Year Audi A8 and S8 Vehicles

Dear Audi Owner.

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Audi has decided that a defect, which relates to motor vehicle safety, exists in certain 2013-2015 Model Year Audi A8 and S8 Vehicles. Our records show that you are the owner of a vehicle affected by this action.

What is the issue? Over time, the fuel supply line for the high pressure fuel pump may become porous,

resulting in a fuel smell or a fuel leak. Leaking fuel, in the presence of an ignition source,

may result in a fire.

What will we do? To correct this defect, your authorized Audi dealer will replace the fuel line at no cost to owners.

> This work will take about an hour to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the

repair, as well as to accommodate their daily workshop schedule.

Please contact your authorized Audi dealer without delay to schedule this recall repair. For What should you do?

your convenience, you can also visit www.audiusa.com and click on the "Find a Dealer" link to

locate a dealer near you and schedule this service.

Precautions you should take

If you smell fuel in the vehicle, contact your nearest authorized Audi dealer without delay

to have your vehicle inspected.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of

receipt. If you have changed your address or sold the vehicle, please fill out the enclosed

prepaid Owner Reply card and mail it to us so we can update our records.

Reimbursement of

**Expenses** 

If you have previously paid for repairs relating to the condition described in this letter, the enclosed form explains how to request reimbursement. We would be pleased to review your

reimbursement request.

Can we assist you

further?

If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Audi Customer Experience at 1-800-253-2834 or via our

"Contact Us" page at www.audiusa.com.

for open Recalls and **Service Campaigns** 

Checking your vehicle To check your vehicle's eligibility for repair under this or any other recall/service campaign, please visit the Recall/Service Campaign Lookup tool at www.audiusa.com and enter your

Vehicle Identification Number (VIN).

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <a href="http://www.safercar.gov">http://www.safercar.gov</a>.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

**Audi Customer Protection** 

#### **Customer Letter Example (CANADA)**

<MONTH YEAR>

<CUSTOMER NAME>
<CUSTOMER ADDRESS>
<CUSTOMER CITY STATE ZIPCODE>

This notice applies to your vehicle: <VIN>

Subject: Safety Recall 20AV - Fuel Line

Certain 2013-2015 Model Year Audi A8 and S8 Vehicles

Dear Audi Owner,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Audi has decided that a defect, which relates to motor vehicle safety, exists in certain 2013-2015 Model Year Audi A8 and S8 Vehicles. Our records show that you are the owner of a vehicle affected by this action.

What is the issue? Over time, the fuel supply line for the high pressure fuel pump may become porous,

resulting in a fuel smell or a fuel leak. Leaking fuel, in the presence of an ignition source,

may result in a fire.

What will we do? To correct this defect, your authorized Audi dealer will replace the fuel line at no cost to owners.

This work will take about an hour to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the

repair, as well as to accommodate their daily workshop schedule.

What should you do? Please contact your authorized Audi dealer without delay to schedule this recall repair.

Precautions you should take

If you smell fuel in the vehicle, contact your nearest authorized Audi dealer without delay

to have your vehicle inspected.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.

Reimbursement of Expenses

If you have previously paid for repairs relating to the condition described in this letter, the enclosed form explains how to request reimbursement. We would be pleased to review your reimbursement request.

Can we assist you further?

If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Audi Customer Relations Monday through Friday from 8AM to 8PM EST at 1-800-822-2834 or via our "Contact Audi Canada" page at <a href="https://www.audi.ca">www.audi.ca</a>.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

**Audi Customer Protection** 

20AV Page 4 of 11

#### **A** WARNING

Risk of injury. Refer to "Warning and Safety Precautions", found in Appendix A at the end of this document.

# U NOTE

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.
- When working during extreme temperatures, it is recommended that the vehicle be allowed to acclimate inside the shop to avoid temperature-related component damage/breakage.

#### **Repair Overview**




• Replace underhood fuel supply hose.

### **Required Parts**

<u>Criteria</u>	<u>Quantity</u>	Part Number	Part Description
FD	1	079.133.986.AF	Fuel Supply Hose


# **Required Tools**

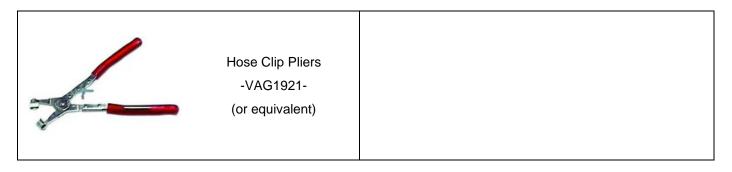

July 2018 20AV Page 6 of 11

# Repair Instruction

#### **Section A - Check for Previous Repair**

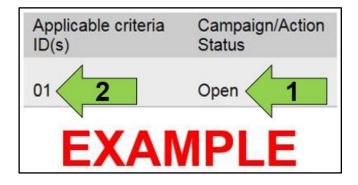

• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

#### i TIP

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>.
   If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

#### Proceed to Section B

#### Section B - Repair Procedure



The fuel system is under pressure. Risk of injury from fuel spraying out.

- · Wear protective eyewear.
- Wear safety gloves.
- Reduce the pressure: place clean cloths around the connection point and carefully open the connection point.



 Remove nut <circle> from wiring harness bracket.

# i TIP


Removal of this nut allows for easier access to the fuel hose clamp.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2018 Audi of America, Inc. and Audi Canada. All Rights Reserved.

July 2018 20AV Page 7 of 11



- Place clean cloths around the fuel hose connections to catch any leaking fuel.
- Compress clamp <circle> and remove fuel hose <1> from metal fuel line.

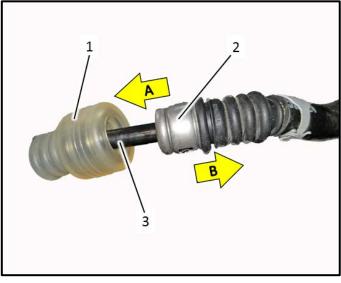

# . NOTE

The orientation of the fuel line in the vehicle may differ from what is shown in the photo.

- Slide cover <1> off fuel line coupling <2>.
- Disconnect fuel line coupling <2> and remove hose:
  - While holding fuel line <3> stationary, push the fuel line coupling <2> in direction of <arrow A> until the coupling stops.
  - Push the release buttons and hold them pressed.
  - Disconnect the connector coupling
     <2> from the fuel line in direction of
     <arrow B>.


# **A** CAUTION

#### **RISK OF NONPAYMENT!**

- The above instructions must be followed, otherwise the fuel line coupling will not disconnect from the fuel line.
- Do not use pliers or other tools on the fuel line <3> or damage to the line may occur.
- Damage to the fuel line connector or fuel line due to improper removal/installation may cause the connector to not fasten securely upon reinstallation, causing a leak.
- A damaged fuel line connector requires replacement of the fuel line. Consequential damage to the fuel line

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2018 Audi of America, Inc. and Audi Canada. All Rights Reserved.

July 2018 20AV Page 8 of 11

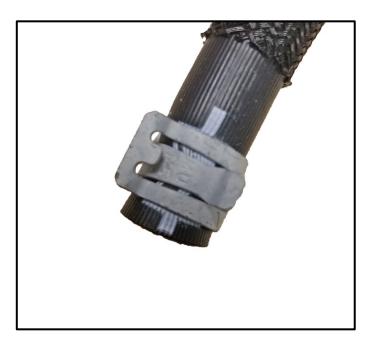


# due to improper removal/installation is not covered under this campaign.

- Install new fuel hose onto fuel line.
- Ensure the fuel hose is not twisted.
- Position clamp (included on new fuel hose) in the correct installed position (as shown between paint markings).

# U NOTE

Hose shown removed for clarity.

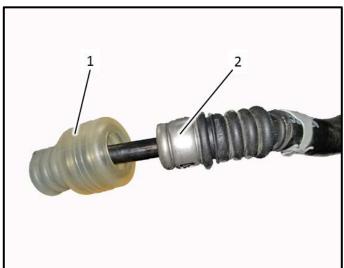

- Remove the protective cap from the new fuel hose and slide it onto the fuel line.
- Connect fuel line coupling <2> until it audibly engages.
- Slide fuel line coupling cover <1> over fuel line coupling.



 When correctly seated, the fuel line coupling cover should appear as shown.

July 2018 20AV Page 9 of 11



- Install nut <circle> and torque to 9 Nm.
- Start the engine and verify no fuel leaks are present.

Proceed to Section C.

#### Section C - Campaign Completion Stamp

I certify that this campaign has been performed in strict accordance with the applicable Audi repair procedure.		
SAGA Code:		
Technician:		
Date:		

Item#: AUD4927ENG

-OR-

Je certifie que cette
campagne de rappel a été
exécutée suivant les strictes
directives de réparation
d'Audi

Code de SAGA:
Technicien:

Date:

Item # AUD4927FRE

- Once the campaign has been completed, the technician should stamp the repair order.
- Stamps are available for ordering through the Compliance Label Ordering Portal.
- Proceed to Section D.

#### Section D - Parts Return/Disposal

Properly store (retain), destroy or dispose of removed parts in accordance with all state/province and local requirements, unless otherwise indicated and/or requested through the Warranty Parts Portal (WPP) for U.S. and the Part Destruction and Core Disposition Report for Canada.

#### **Appendix A – Warning and Safety Precautions**

# **A** WARNING

#### Note the Following When Working on the Fuel System:

- There is a risk of injury because the fuel is under very high pressure.
- Fuel pressure in high pressure pipe can be up to 120 bar (1740 psi)! Always follow the safety precautions when reducing the pressure in the high pressure area.
- Decreasing pressure in the high pressure area.
- The fuel supply line is under pressure. To prevent injuries and skin contact, wear protective goggles and
  protective clothing. Wrap a clean cloth around the connection before loosening hose connections. Remove
  the hose connection carefully to release the pressure.
- Fuel coming into contact with skin poses a health risk.
- Do not let fuel come in contact with bare skin. Wear fuel-resistant gloves.
- Leaking fuel poses a risk of burns.
- For safety reasons, switch off the power supply to the fuel pump or disconnect the battery before opening the fuel system. Otherwise, the fuel pump may activate when the driver door is opened.
- Danger of explosion due to cell phones. Keep cell phones out of reach in the work space area.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2018 Audi of America, Inc. and Audi Canada. All Rights Reserved.

July 2018 20AV Page 11 of 11