



# Thor Motor Coach Recall Repair Instructions

|                           |   |                    |                   |
|---------------------------|---|--------------------|-------------------|
| Recall #                  | 18V-498<br>2018-397                                 |                    |                   |
| Description/Title:        | <b>ACE 27.2 LP Rubber Hose</b>                      |                    |                   |
| Affected Product Line(s): | <b>Certain 2018 ACE 27.2 motorhomes</b>             |                    |                   |
| Service Campaign # :      | <b>RC000158</b>                                     | Released Date:     | <b>08/23/2018</b> |
| Failure Code:             | <b>Inspect: TMCRC80468Y<br/>Repair: TMCRC80468V</b> | Document Date:     | <b>08/23/2018</b> |
| Time Allowed:             | <b>Inspect: 0.2<br/>Repair: 0.4</b>                 | Document Revision: | <b>A</b>          |

**Issue:**

On certain 2018 ACE 27.2 motorhomes, the rubber LP hose may have been incorrectly secured by TMC which could cause the hose to sag and rub on the tire in wheel well.

**Part(s) Required:**

**Shop Supplies**

Additional p-clamps (as needed)

\*NOTE- Please be sure to include cost of shop supplies (i.e. p-clamps) during claim process (not to exceed \$5).

**Instructions:**

Inspect the routing of the rubber LP hose in the right rear wheel well to determine the need for additional p-clamps or relocation of p-clamps for proper securement to eliminate potential for sagging. (Figure 1)



**Figure 1**

## Instructions (cont.):

There should be a minimum of 3 clamps located in the wheel well for proper securement of the LP hose (left, center, right). (Figure 2)



**Figure 2**

If there are less than 3 p-clamps securing LP hose to chassis, install additional p-clamps as needed. Required locations of p-clamps seen below (Figures 3 & 4)



**Figure 3**



**Figure 4**