

October 11, 2019

Version 5

Safety Recall: 2017-18 NSX Fuel Tank

Supersedes 18-053, dated October 11, 2018, to revise the information highlighted in yellow

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2017-18	NSX	ALL	Check the iN VIN status for eligibility.

REVISION SUMMARY

Under REPAIR PROCEDURE, the Vehicle Emissions Recall - Proof of Correction certificate recall number was changed.

BACKGROUND

The welds in the fuel tank for the crossover pipe are improperly sealed. Clients may notice a strong fuel smell.

California residents only: This safety recall also affects emissions. Have the service consultant give the certificate to the client as proof that the recall was completed.

CLIENT NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your used vehicle inventory.

Failure to repair a vehicle subject to a recall or campaign may subject your dealership to claims or lawsuits from the client or anyone else harmed as a result of such failure. To see if a vehicle in inventory is affected by this safety recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Replace the fuel tanks.

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

PARTS INFORMATION

Part Name	Part Number	Quantity
Fuel Tank Assembly Repair Parts Kit	06170-T6N-305	1
Left Fuel Tank	17044-T6N-A01	1
Right Fuel Tank	17044-T6N-A13	1

For dealers experiencing a strong fuel smell from storing a fuel tank replaced under this Service Bulletin, the fuel tank may be disposed of immediately in accordance with local regulations. This only applies to the fuel tank replaced under this Service Bulletin. The published retention policy remains in effect for all other parts. If you have any questions about this exception or other parts retention issues please contact the WPI Administrative Office at 937-642-2737.

REQUIRED MATERIALS

Part Name	Part Number	Quantity
Acura Long-Life Antifreeze/Coolant Type 2	OL999-9011A	4
Acura Gear Oil GO-Type	08200-9018A	2

TOOL INFORMATION

Part Name	Tool Number	Quantity
Tank Removal Adapter	07AAK-T6NA300	1
Arm Holder	07AAB-T6NA400	1
Brake Disc Covers (set of 4)	07AAZ-T6NA800	1
Hose Plug Set	07AAZ-T6NA600	1
Fender Covers	07AAZ-T6NA200	1
Lug Nut Cap Removal Tool	07AAC-T6NA100	1
Fuel Tank Unit Locknut	07AAA-SNAA100	1
Fuel Pump Module Locknut Wrench	070AA-T0AA100	1
Wheel Stud Guide Pins (set of 2)	07AAB-T6NA200	1

WARRANTY CLAIM INFORMATION

Fuel Tank Replacement

To file a warranty claim for fuel reimbursement, you must do the following:

- Select **O1** from the **Sublet Code** drop-down.
- Enter the total MILES driven for refueling (ex. **15MILE**) in the **Work Description** field.
- Enter the fuel receipt, invoice, transaction, or sequence etc. number in the **Invoice No.** field.
- Enter the amount in the **Sublet Amount** field
- Upload a image of the fuel receipt (required).

Sublet Information				
Sublet Code	Work Description	Invoice No.	Rental Days	Sublet Amount
O1	15MILE	764646464		14.00
<< SELECT >>				

Upload files **File Attachments**

Uploaded JPG/PDF Files 0 (Maximum 10)

Fuel Receipt


Alignment shims maybe needed to properly do the alignment, the shims were added under the material reimbursement section in the template.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
3101GP	Replace the right and left side fuel tanks (includes alignment, VSA sensor neutral position procedure, fluid drain/refill and test drive).	10.3 hrs	6TK00	U2900	B18053A	17044-T6N-A01
Only use the templates below if fuel fill-up is required.						
B	Travel 1-10 miles for fuel	0.2 hr	6TK00	U2900	B18053B	17044-T6N-A01
C	Travel 11-20 miles for fuel	0.4 hr	6TK00	U2900	B18053C	17044-T6N-A01
D	Travel 21-30 miles for fuel	0.6 hr	6TK00	U2900	B18053D	17044-T6N-A01


Skill Level: Repair Technician

REPAIR PROCEDURE

1. Set the vehicle on the lift. Refer to the service information.
2. Protect and cover the body panels surrounding the engine compartment.
3. Remove the engine room covers. Refer to the service information.
4. Remove the driver's side air cleaner assembly. Refer to the service information.
5. Drain the fuel from both fuel tanks.
 - 5.1. Remove the PGM-FI main relay 3 (UNDER HOOD).
 - 5.2. Remove the PGM-FI main relay 2 (CABIN).
 - 5.3. In **Maintenance Mode** do the **Forced PI Idling Mode**, then let the engine idle until it stalls.
 - 5.4. Remove the fuel return hose from the fuel pressure regulator, and add an extension tube to an empty fuel container.

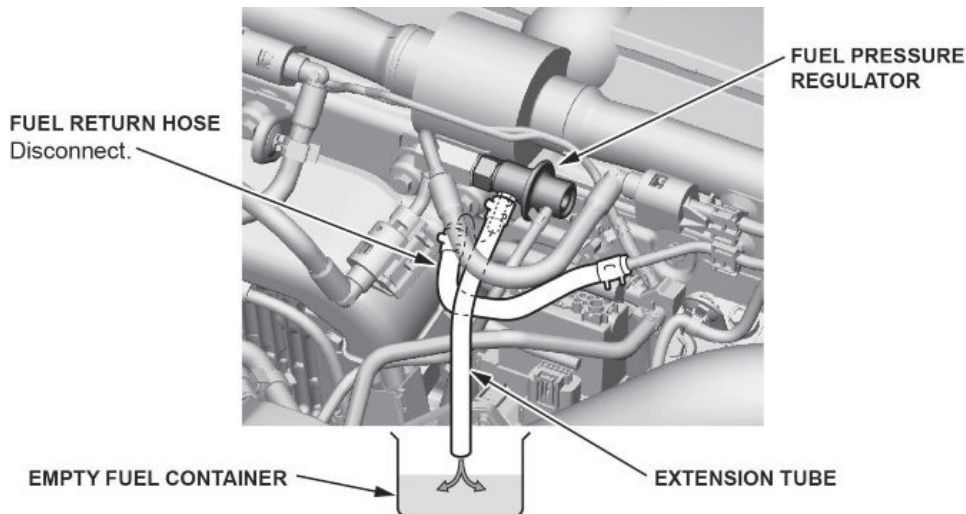


- 5.5. Jump the PGM-FI main relay 3 (UNDER HOOD) 4-pin connector terminal No.1 and No. 2 with a jumper wire, and turn the ignition to ON.

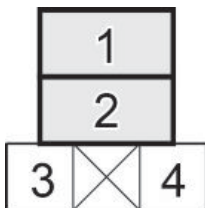

- 5.6. Wait until all the fuel is drained.

6. Disconnect the fuel vapor line (located below the removed driver's air cleaner assembly).

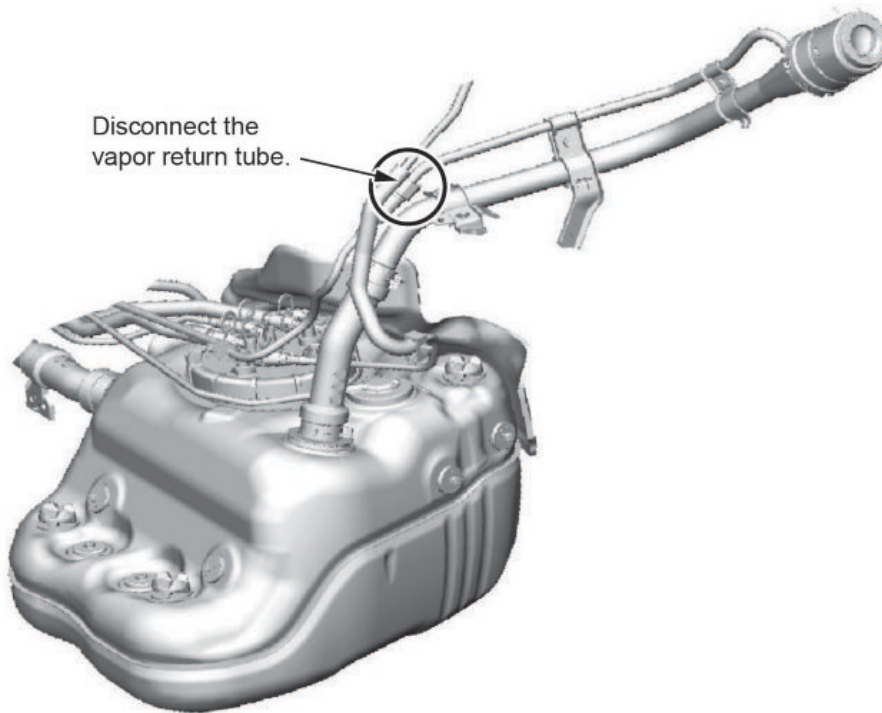

7. Turn off the IMA service plug.
 - 7.1. Move the driver's seat all the way forward.
 - 7.2. Remove the lower portion of driver's door seal. Refer to the service information.


NOTE

Do not completely remove the driver's door seal.

7.3. Remove the driver's C-pillar trim.


NOTE

To avoid damage when removing the C-pillar trim make sure you detach it from the outer edge near the rear glass and not at the seat belt webbing pocket.

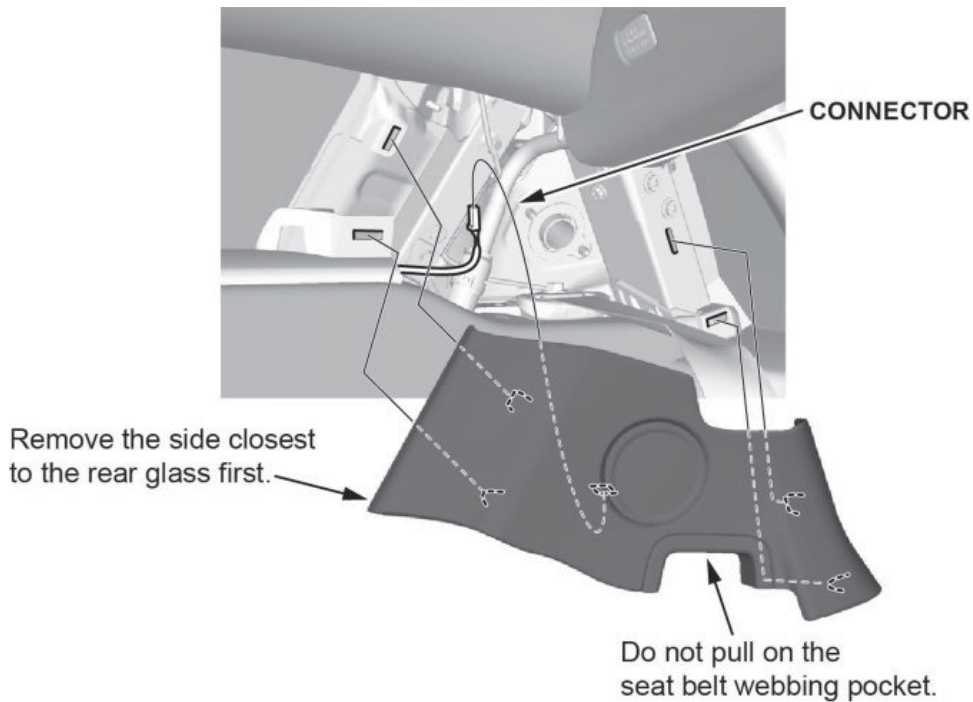

7.4. Remove the driver's rear side trim panel. Refer to the service information.

7.5. Pull the rear bulkhead carpet up to access and remove the service plug cover.

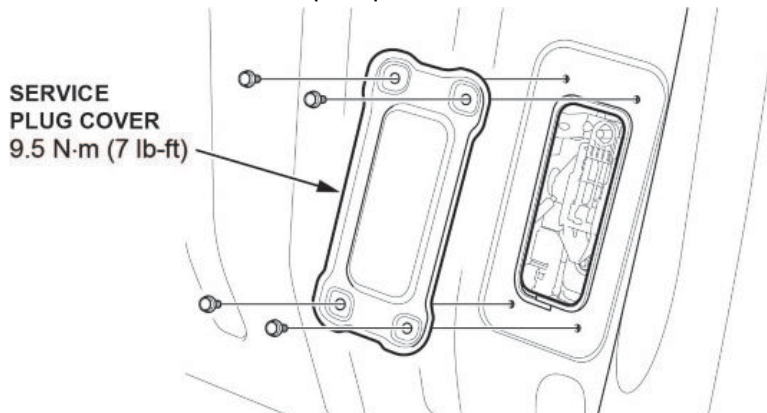

7.6. Remove the service plug. Refer to the service information.

8. Disconnect the 12-volt terminals to the battery. Refer to the service information.

9. Raise the vehicle.


10. Remove the rear wheels.

NOTE


Protect the brake disk from damage and install the brake disk cover.

11. Remove both left and right inner fender liners. Refer to the service information.

12. On the passenger side rear wheel well, disconnect the following:

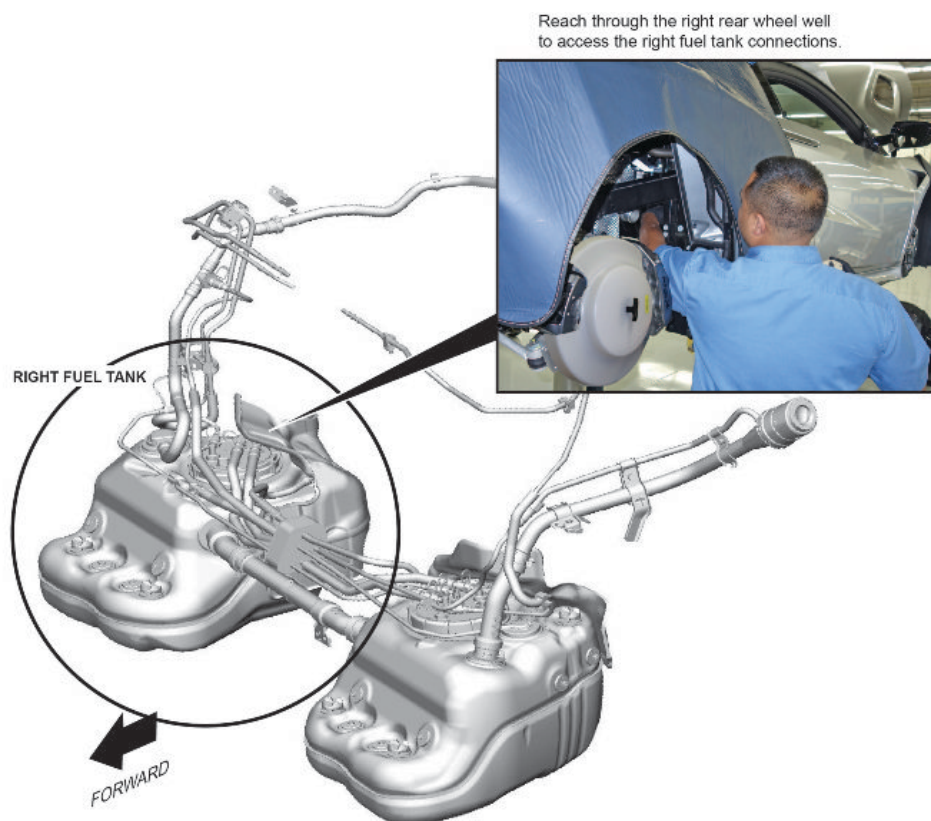


- OVR tube (next to frame beam)
- Lower intercooler hose (Unclamp and move.)
- PI fuel feed pipe
- Fuel tank unit connector
- Clip harness tab for the OVR
- Clip harness tab for the fuel line return

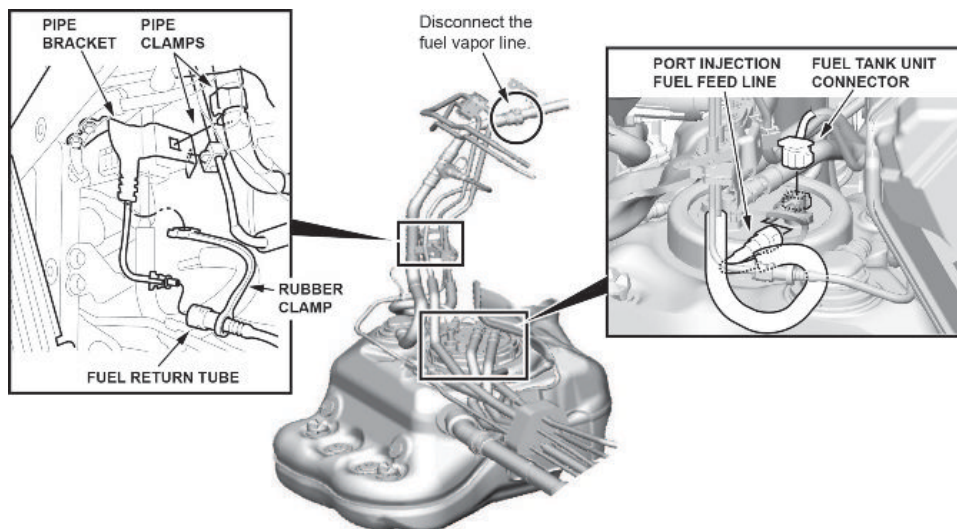


13. On the driver's side rear wheel well, do the following:

Reach through the left rear wheel well and the engine compartment to access the left fuel tank connections.

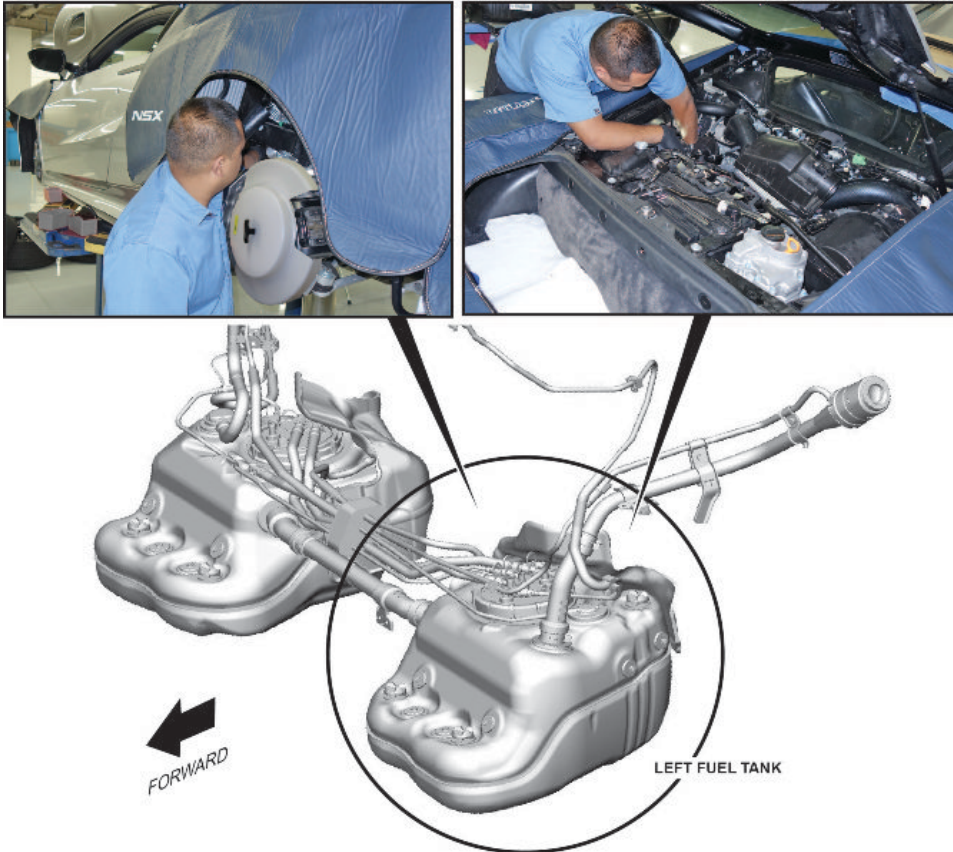

- Unclamp and move the intercooler hose.
- Remove the black bracket holding the fuel tank (top side fasteners).
- Disconnect the two electrical connectors.
- Disconnect the fuel filler neck.
- Disconnect the PI fuel feed pipe to the fuel pump.
- Unhook the tube clamp on the firewall side.

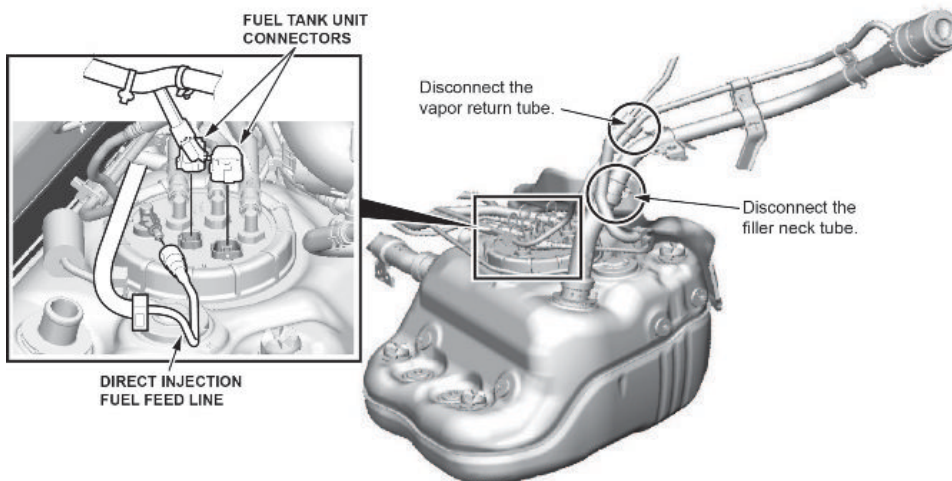

14. Remove the engine undercover. Refer to the service information.

15. Remove the (rear) center tunnel reinforcement. Refer to the service information.

16. Remove the two gear oil thermostat housing fasteners.
17. Remove the (front) rear subframe. Refer to the service information.


NOTE

Pay attention to the bolt length and locations.

18. Drain the engine coolant only from the water pipe underneath the vehicle.


NOTE

After the coolant has drained, reinstall the drain bolts with new washers included in the kit.

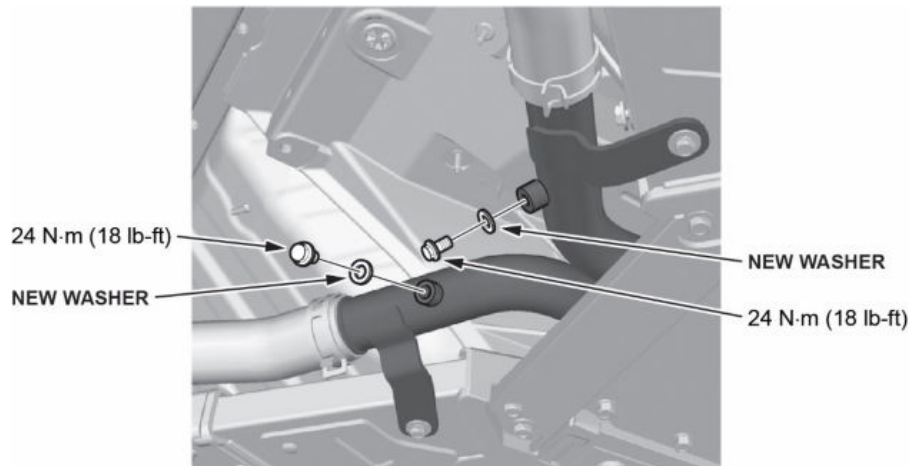

19. Disconnect the water hoses from the center pipes and cap off the ends.
20. Disconnect the two gear oil pipes in the center tunnel. Refer to the service information.
21. Disconnect the coolant heater hose and cap off.
22. Disconnect the rear motor power cable. Refer to the service information.
23. Remove the rear bulkhead upper brace, rear bulkhead lower brace, and fuel pipe separator bracket. Refer to the service information.
24. Remove the crossover pipe bracket bolts. Refer to the service information.
25. Remove the fuel tank separator braces. Refer to the service information.
26. Place the tank removal adapter and the powertrain lift table under the fuel tank assembly. Refer to the service information.
27. Remove the fuel tank strap bolts.
28. Slightly lower the fuel tank assembly, On the passenger side tank, reach over and disconnect the fuel return tube.
29. Completely lower the fuel tank assembly, making sure none of the remaining hardlines and hoses get snagged.

30. Install the fuel tank damper (supplied with the new fuel tanks) as shown.

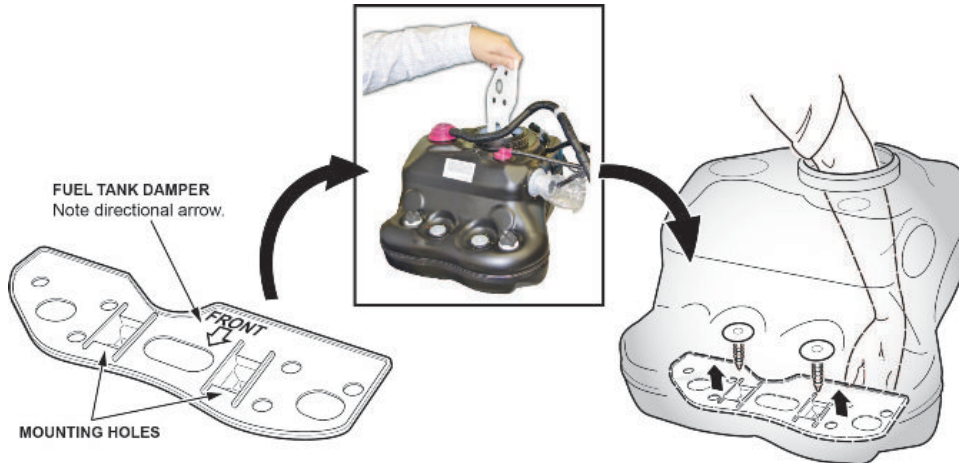


31. Refer to the service information, and transfer the following to the new fuel tank assembly:

- Fuel sending units (left and right)
- Fuel tank protectors
- Fuel transfer tubes
- Vapor transfer tube
- Cross over pipe and tubes

NOTE

Install the supplied tape around the fuel tube spacer as shown.

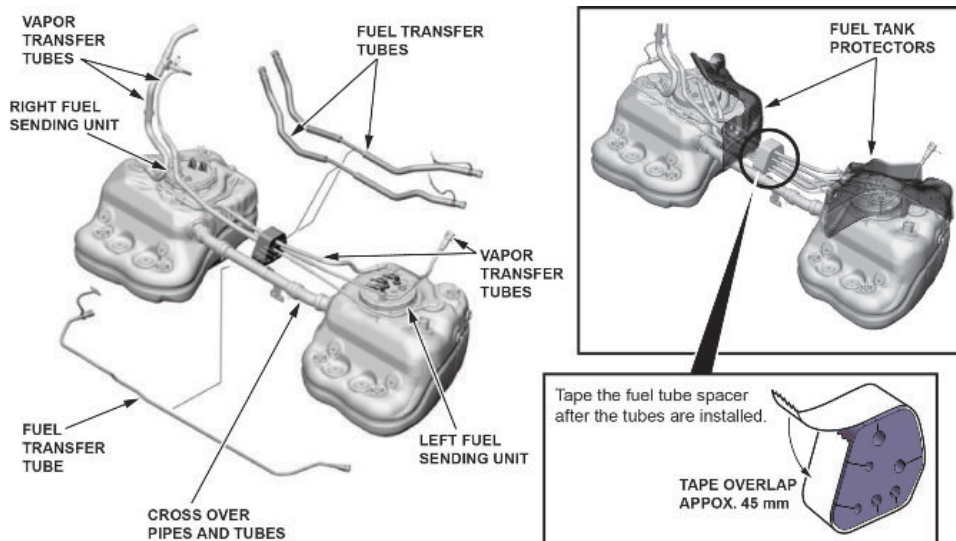

32. Install the new fuel tank assembly in to the vehicle, and install the parts in the reverse order of removal.
33. Top off the transmission fluid. Refer to the service information.
34. Fill the coolant, and air bleed the system. Refer to the service information.
35. Refuel the vehicle.

NOTE

Make sure to note the mileage driven to refuel the vehicle; it is required for warranty reimbursement.

36. Do an alignment check, and make adjustments as needed.

NOTE

The fuel tanks must be fully fueled when doing an alignment. Also, be sure to follow the pre-alignment checks. Refer to the service information.

37. **California residents only:** Fill out a Vehicle Emissions Recall – Proof of Correction certificate, and use **U29** as the recall number. Have the service consultant give the certificate to your client, and advise him or her to keep it as proof that the recall was completed. Your client will need to submit this certificate to the DMV only if the DMV requests it. If you need more certificates, use reorder number **Y0657**.

The image shows a "Vehicle Emission Recall - Proof of Correction" form. At the top, there is a header with the title. Below the header, there are fields for "License Number", "Make", "Year Model", "Body Type", and "Vehicle Identification Number". The "Recall Number" field is circled in black and contains the handwritten text "U29". Below the recall number, there is a statement: "The above described vehicle has been repaired, modified and/or equipped with new emission control devices to meet applicable California Emission Control Laws." Below this statement, there are fields for "Manufacturer", "Dealer's Name", "Address, City, State and Zip", "Date", and "Dealership's Authorized Signature". At the bottom, there is a checkbox with an "X" and the text "Return this certificate to DMV only when required - otherwise retain for your records." The form is labeled "Y0657" in the bottom left corner and "ACL 24832 (0212)" in the bottom right corner.

END