

## Thor Motor Coach Recall Repair Supplemental Instructions

Recall #	18V-741 2018-561		
Description/Title:	Refer LP Hose Routing SUPPLEMENTAL INSTRUCTIONS		
Affected Product Line(s):	Certain MY 2018 & 2019 Chateau, Four Winds, & Freedom Elite motorhomes		
Service Campaign #:	RC000162	Released Date:	1/18/2019

#### Supplemental Repair Code for LP Hose Replacement-

Repair Code- TMCRC80479V (Photo required for claims)

Time Allowed- 1.0

Be sure to use both codes (TMCRC80478V & TMCRC80479V) during claim process if needing to notch metal plate AND replace LP hose. Total repair time for both codes will be 1.8.

#### Part(s) Required:

3/4" Wrench 9/16" Wrench Thread Sealant

*LP Hose (with Grommet) Kit Part #'s (by floor plan):* 

0440895 (22B/22FE/22E/25V)

0440896 (23U/23H)

0440897 (24BL/24FE/24F/24HE)

0440898 (24FS/24HL)

0440899 (24WS)

0440900 (26B/26HE)

0440901 (28E/28FE)

0440902 (28Z)

0440903 (30D/30FE)

Thor Motor Coach 1-877-500-1020 NHTSA Recall # 18V-741 Transport Canada Recall # 2018-561



# Thor Motor Coach Recall Repair Supplemental Instructions

#### **Instructions:**

NOTE: TAKE CARE WHEN COMPLETING RECALL AND ENSURE LP IS

SHUT OFF BEFORE STARTING ANY REPAIRS. PLEASE WEAR

APPROPRIATE SAFETY GEAR

TMC WILL NOT COVER ANY DAMAGES INCURRED DURING THE

**COMPLETION OF THE PROCESS** 

1. IMPORTANT- Only perform the LP Hose replacement once the notch in the bottom metal plate has been made (See pdf named "RC000162 Recall Instructions" for this information).

2. Unhook LP hose from valve in thru access door.



3. Find routing of LP hose under motorhome and unhook other end from propane manifold. P-clamps may need to be removed during process for easier replacement of hose. (NOTE- routing of LP hose will vary based on floor plan on motorhome)





### Thor Motor Coach Recall Repair Supplemental Instructions

- 3. Once original LP hose is removed, replace with new one according to list on page 1.
- 4. Use a thread sealant when connecting LP hose to manifold.



5. While routing the new LP hose, be sure to re-attach p-clamps to secure hose.




# Thor Motor Coach Recall Repair Supplemental Instructions

6. Re-route LP hose up through grommet on refer cabinet floor.



7. Attach hose and tighten onto valve. A second wrench will be needed to hold valve in place as to not turn or kink the replacement LP hose.

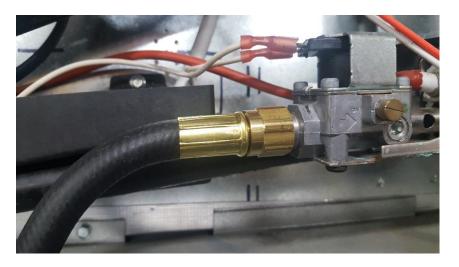

8. Perform an LP pressure test.