



Thor Motor Coach Recall Repair Instructions

Recall #	18V-812 2018-630		
Description/Title:	Irvine Windshield Motor Shade		
Affected Product Line(s):	Certain MY 2017-2019 Challenger, Miramar, & Outlaw Motorhomes		
Service Campaign # :	RC000165	Released Date:	MM/DD/YYYY
Repair Code:	TMCRC80477V	Document Date:	MM/DD/YYYY
Time Allowed:	0.3	Document Revision:	A

Issue:

It has been discovered that on certain MY 2017-2019 Challenger, Miramar, and Outlaw Motorhomes, the Irvine Windshield Motor Shade can have a sudden and unexpected lowering, which can block the vision of the motorhome driver. The cause has been identified as a slipping of the motor head inside the motor tube. If the Windshield Motor Shade were to lower during travel, this could block the vision of the motorhome driver. This could lead to a crash, which could result in property damage and/or serious injury or death.

Part(s) Required:

Shop Supplies-

Electric Drill
3/16" Drill Bit
Countersink
#4 x 1/2" Flat Head Screw*


**NOTE- cost of supplies (i.e. flat head screw) is included in repair code flat rate.*



Thor Motor Coach Recall Repair Instructions

Instructions:

1. Put motor shade into program mode by depressing push button switch for approximately 2 seconds until audible beep is heard. Roll shade down using switch until the aluminum roller tube is exposed.
2. Measure 11" from the end of the motor shade bracket.

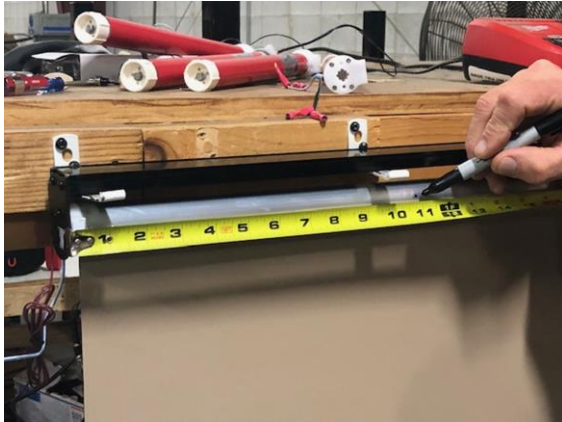

3. Pre-drill 3/16" hole with countersink.





Thor Motor Coach Recall Repair Instructions

3. Attach #4 x 1/2" flat head screw through roller tube and into concealed motor head.



4. Re-set motor shade upper and lower stop limits.