



**RECALL #** Starcraft18V-362 2018-352      **Date of Release : July 2018**  
 Jayco 18V-364 2018-351

**Job Code** 9902385 Starcraft 9901385 Jayco

**Series/Flat Rate** .3 hr Total time for Repair 1 and 2 straps

**ACTION REQUIRED**

Replace the defective strap that secures each liquid propane (LP) tank.

**AFFECTED UNITS**

Starcraft certain 2019 Telluride Fifth Wheels - **All have 2 LP tanks**

K2FA5063-5084 K2FB5069-5092 K2FC5066-5073 K2FE5078-583

JAYCO certain 2018 Eagle, Eagle HT, North Point Fifth Wheels

North Point J1LC0234-0278 – **1 LP tank**

Eagle HT J1PG0141-0148, 0151, 0159,0160, 0165, 0166 – **1 LP tank**

Eagle J1WD0545-0554 J1WH0171-0184 – **2 LP tanks**

JAYCO certain 2019 North Point, Pinnacle, Eagle, Eagle HT, Talon

North Point K1LD0051-0110 LL0051-0140 LP0051-0080 LR051-0092 – **1 LP tank**

Pinnacle K1RL0051-0110 RP0051-0054 RU0050 – **1 LP tank**

Eagle K1WA0051-0100 WC0051-0080 WK0051-0104 WL0051-0074 WM0051-0080 – **2 LP tanks**

Eagle HT K1P60057-0062, 0064, 0069 – **1LP tank**

K1P90057, 0064-0066, 0069, 0071 – **1 LP tank**

K1PA0054, 0062, 0069-0072, 0083,0084 0087-0089, 099-0100 – **1 LP tank**

K1PB0057-0058, 0067-0070, 0077-0078, 0082 – **1 LP tank**

K1PG0050-0051 - **1 LP tank**

K1PN0060-0062, 0070 – **1 LP tank**

K1PP0058, 0062-0063, 0068, 0071-0072, 0086 - **1 LP tank**

K1PR0061-0062, 0103-0107 – **1 LP tank**

Talon K18A0051-0062 – **2 LP tanks**

K18B0051-0062 – **2 LP tanks**

K18D0051-0062 – **2 LP tanks**

K18E0051-0062 – **2 LP tanks**

## Parts Kits

- One strap per LP tank.

**STARCRAFT 18V-362 - 2 LP straps, 6 pop rivets** Envelope to return end of each defective straps to Dexter/Ventline  
**JAYCO 18V-364A – 1 LP strap, 3 pop rivets** & Envelope to return end of each defective strap to Dexter/Ventline  
**JAYCO 18V-364B – 2 LP straps, 6 pop rivets** - & Envelope to return end of each defective straps to Dexter/Ventline


- LP tank strap/s
- 3 Pop Rivets per strap
- 1 postage paid envelope addressed to Dexter



## Misc. Tools and Supplies

Screw gun with #2 square bit, drill with 13/64" drill bit, pop rivet gun, safety glasses

***PLEASE CUT OFF 2" FROM THE BUCKEL END OF EACH DEFECTIVE STRAP AND RETURN TO DEXTER IN THE ENVELOPE PROVIDED IN THE PARTS KIT.***

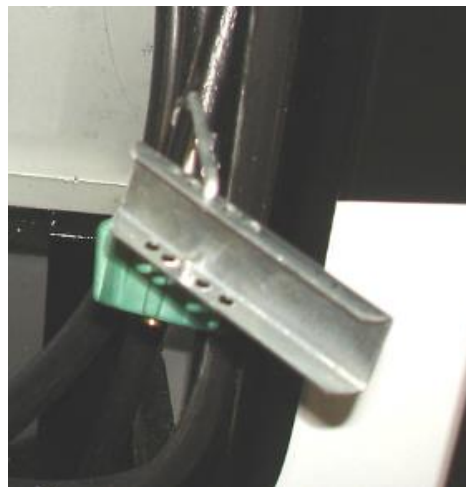

## INSTRUCTIONS

Please note the model of fifth wheels that have a LP tank on either side in a separate compartment. The repair is exactly the same for a single tank or double tanks.



**Fig 1:** Turn off LP at tank. Disconnect the LP hose from the tank.  
Unfasten the tank strap/s, and remove the tank from the compartment.  
**Fig 2:** Replace each strap with a new one from the Recall Parts Kit.

**NOTE:** A 2" section that includes the buckle of the defective strap must be returned to Dexter.



**Fig 3:** Remove 3 bolts securing the strap with the screw gun and square bit.  
Pull on the strap to keep tension on the bolts as you loosen them.  
The nuts will fall off the back side.

**DO NOT DISCARD DEFECTIVE STRAP/S BEFORE YOU CUT OFF THE 2" LENGTH TO RETURN**

**Fig 4:** Use the 13/64 drill bit and drill the 3 screw holes larger for pop rivets.



**Fig 5:** Install each new strap from the kit, with pop rivet gun and 3 rivets from the kit.

**Fig 6:** Replace the tank, attach the hose, and secure the strap around each tank.