

# Part 573 Safety Recall Report

# 19E-007

**Manufacturer Name :** Indian Motorcycle Company

**Submission Date :** FEB 05, 2019

**NHTSA Recall No. :** 19E-007

**Manufacturer Recall No. :** I-19-01



## Manufacturer Information :

## Population :

**Manufacturer Name :** Indian Motorcycle Company

**Number of potentially involved :** 60

**Address :** 2100 Highway 55

**Estimated percentage with defect :** NR

Medina MN 55340

**Company phone :** 999

## Equipment Information :

**Brand / Trade 1 :** Polaris

**Model :** SCOUT / SCOUT BOBBER

**Part No. :** 2883795-658

**Size :** NR

**Function :** NR

**Descriptive Information :** 2883795-658 is the affected part for this recall. It only applies to this accessory part.

**Production Dates :** DEC 01, 2018 - JAN 29, 2019

## Description of Defect :

**Description of the Defect :** Accessory brake lever adjustment screw set incorrectly from supplier.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** Unintentional front brake pressure.

**Description of the Cause :** Accessory brake lever adjustment screw set incorrectly from supplier.

**Identification of Any Warning that can Occur :** Front brake lever stiffness increases with part install and continues to increase with use. More throttle application required to overcome front brake resistance.

## Supplier Identification :

### Component Manufacturer

**Name :** JJuan

Address : 08172 Sant Cugat del Vallès  
Barcelona FOREIGN STATES  
Country : Spain

## Chronology :

In December, 2018, Polaris was notified of a potential incident of front wheel lock up due to unintentional brake pressure.

Polaris inspected parts of concern and determined that root cause was that the set screw was adjusted improperly from the supplier. On 1/29, Indian determined that a field campaign was warranted.

## Description of Remedy :

Description of Remedy Program : Replacement parts will be available the week of February 11th. Consumers also have the ability to return to the factory stock brake lever.

If you have had this procedure performed before you received this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy of the problem associated with this recall. For more information regarding obtaining reimbursement please contact the Polaris Consumer Service Department using the contact information above.

How Remedy Component Differs from Recalled Component : The replacement brake levers have the adjustment screw set properly which eliminates the potential for unintentional brake pressure.

Identify How/When Recall Condition was Corrected in Production : All potentially affected parts within Polaris control and supplier inventory were immediately placed on hold and finally scrapped.

New parts were manufactured with the adjustment screw set properly that eliminates the potential for unintentional brake pressure.

## Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : FEB 07, 2019 - FEB 08, 2019

Planned Owner Notification Date : FEB 12, 2019 - FEB 19, 2019

## Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR  
Address : NR  
NR  
Country : NR  
Company Phone : NR

\* NR - Not Reported