OMB Control No.: 2127-0004

Part 573 Safety Recall Report

19E-036

Manufacturer Name: Meritor, Inc.

Submission Date: MAY 23, 2019

NHTSA Recall No.: 19E-036



Manufacturer Information:

Manufacturer Name: Meritor, Inc.

Manufacturer Recall No.: NR

Address: 2135 West Maple Road

Troy MI 48084

Company phone: 248-435-1725

Population:

Number of potentially involved: 1,249 Estimated percentage with defect: NR

Equipment Information:

Brand / Trade 1: Meritor

Model: MX10-120EVO, MX12-120EVO, MX14-120EVO

Part No.: MX120 EVO

Size: NR Function: Axle

Descriptive Information: Meritor received (2) reports from the field regarding wheel-separation incidents

that occurred at low mileage, both on MX14-120 EVO axles. The affected

assemblies were built between 12/13/2018 and 5/13/2019 at the Laurinburg,

NC manufacturing site.

Production Dates: DEC 13, 2018 - MAY 13, 2019

Description of Defect:

Description of the Defect: Meritor MX 120 EVO axles were inadvertently missed during production.

Assembling the axle without oil in the wheel end can result in over-heating of the wheel end bearings which can lead to damage and/or seizing of bearings, plastic deformation of components, and eventually wheel end separation from

the axle.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Loss of vehicle control or property damage could result due to insufficient

lubrication of the bearings in the wheel end system.

Description of the Cause: Wheel end oil fill was inadvertently missed during production.

Identification of Any Warning Wheel end over-heating can be an indication of problems with lubrication or

that can Occur: with internal component damage. As bearing damage progresses, the driver

may detect an issue during vehicle operation by hearing unusual noise or by feeling unusual vibration and/or pull on the steering wheel while driving.

Supplier Identification:

Component Manufacturer

Name: NR Address: NR

NR

Country: NR

Chronology:

5/13/2019: Meritor was notified by Navistar of MX 120 EVO axles with wheel seperation.

5/14/2019: Meritor was notified by Navistar of second MX 120 EVO axle with wheel separation.

5/14/2019: Meritor engineering begins investigation.

5/16/2019: Meritor determines issue to be safety related.

Description of Remedy:

Description of Remedy Program: Meritor MX 120EVO axles were inadvertently assembled without oil in the

wheel end system. Customers will be reimbursed for wheel end inspection. Inspect per Meritor Maintenance Manual MM0170, page 58. If no oil is found in wheel end during inspection, Meritor will replace wheel end

components from spindle out.

How Remedy Component Differs The remedied Meritor MX 120EVO axles' wheel end systems will have

from Recalled Component: sufficient lubricant in the wheel end system.

Identify How/When Recall Condition Containment established on May 14, 2019 through the introduction of an

was Corrected in Production: additional visual inspection and implementation of photographically

capturing the presence of lubrication in the wheel end system.

Recall Schedule:

Description of Recall Schedule: Notification of OEM through 577 Planned Dealer Notification Date: MAY 23, 2019 - MAY 31, 2019

Planned Owner Notification Date: NR - NR

Purchaser Information:

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name: Daimler Trucks North America

Address: Compliance & Regulatory Affairs TEC -1A

4747 North Channel Avenue Portland OR 97217

Country: US

Company Phone: 5037458789

Name: Navistar, Inc.

Address: 2701 Navistar Drive

Lisle IL 60532

Country: US

Company Phone: 331-332-1590

^{*} NR - Not Reported