

Part 573 Safety Recall Report

19E-037

Manufacturer Name : Seats Incorporated

Submission Date : MAY 29, 2019

NHTSA Recall No. : 19E-037

Manufacturer Recall No. : NR



Manufacturer Information :

Manufacturer Name : Seats Incorporated

Address : 1515 Industrial Street

Reedsburg WI 53959

Company phone : 800-767-3287

Population :

Number of potentially involved : 40

Estimated percentage with defect : 100 %

Equipment Information :

Brand / Trade 1 : Seats Incorporated

Model : ABTS 6-way

Part No. : 314313

Size : NR

Function : Vehicle Seat

Descriptive Information :

- The 6-way electric riser became suspect after a pull test that indicated non-compliance with FMVSS 207.
- Only products containing the 6-way electric riser manufactured by Seats Incorporated since August 22, 2018 is included in this recall. Prior 6-way electric risers were not manufactured by Seats Incorporated.
- Final affected units are still to be determined, but it is suspected to be less than 40 units.

Production Dates : AUG 22, 2018 - MAY 16, 2019

Description of Noncompliance :

Description of the Noncompliance : Poor weld penetration is causing a motor mount for a front vertical adjustment to separate during an FMVSS 207 s4.2(c) pull test. The riser is able to come out of the adjusted position.

FMVSS 1 : 207 - Seating systems

FMVSS 2 : NR

Description of the Safety Risk : In the event of a forward impact, it may be possible that the front vertical adjustment could inadvertently adjust.

Description of the Cause : The root cause is poor weld penetration on the motor mounting bracket.

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : Seats Incorporated
Address : 1515 Industrial St
Reedsburg WISCONSIN 53959
Country : United States

Chronology :

-On May 17, 2019 an unreleased product was tested which resulted in a separation of the front vertical adjust motor bracket. This product is not in the market yet, but it caused us to question whether other products are affected.
-On May 21, 2019 a similar test was performed on existing product to determine if the problem existed with product that is in the field. Testing indicated that the same issue existed on this product as well.

Description of Remedy :

Description of Remedy Program : NR
How Remedy Component Differs from Recalled Component : NR
Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : NR - NR
Planned Owner Notification Date : NR - NR

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR
Address : NR
NR
Country : NR
Company Phone : NR

* NR - Not Reported