

# Part 573 Safety Recall Report

# 19V-036

**Manufacturer Name :** KYMCO USA**Submission Date :** FEB 06, 2019**NHTSA Recall No. :** 19V-036**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : KYMCO USA

Address : 5 Stan Perkins Road  
Spartanburg SC 29307

Company phone : 999

**Population :**

Number of potentially involved : 323

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2018-2018 KYMCO Like 200i

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

**Descriptive Information :** The basis for the recall population was determined to include all model year 2018 production.

The recalled products differ from the non recalled products by which production line the products were produced.

The number of units affected by this recall is 594 units of the KYMCO, Like 200i, model year 2018

Production Dates : JUN 29, 2017 - JUL 20, 2018

VIN Range 1 : Begin : LC2D2H128JC100371 End : LC2D2812Xjc100694

 Not sequential

VIN Range 2 : Begin : LC2D2H128JC100371 End : LC2D2812XJC100694

 Not sequential

VIN Range 3 : Begin : LC2D2H128JC100371 End : LC2D2812XJC100694

 Not sequential**Description of Defect :**

**Description of the Defect :** KYMCO has determined that the part number 19504-LBA2-C00 may leak fuel at the clamping point of the fuel pump.

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** Fuel leakage may occur due to loosening of the fuel line clamp after extensive operation resulting in a fire hazard.

**Description of the Cause :** These units have a potential for leakage from the high-pressure fuel line due to loosening of the fuel line clamp after extensive operation resulting in a potential fire hazard.

**Identification of Any Warning that can Occur :** When the vehicle is switched on, fuel leakage may occur due to the fuel supply line clamp being loose.  
The rider might smell the odor of gasoline or find fuel stains under the vehicle when the vehicle stopped or parked.

## Supplier Identification :

### Component Manufacturer

Name : CHANGZHOU TOYO JIANN TSANG ELECTRIC CO.,  
Address : NO.19 Hengshan Road, Xinbei District Cha  
Chang Zhou City FOREIGN STATES 213022  
Country : Taiwan, Province of China

## Chronology :

1. Two Leakage events happened in the market.
  - a. Claim Date: 2018/11/14  
VIN NO: LC2D2H124JC100626  
Produced Date: 2018/07/16  
Mileage: 0 miles  
Action: Clamp tightened by the dealer
  - b. Claim Date: 2018/11/26  
VIN NO: LC2D2H123HC100577  
Produced Date: 2017/01/24  
Mileage: 3051  
Action: New fuel hose sent to dealer.
2. Report issue to Kwang Yang on 2018/12/05
3. On date 2018/12/26: Investigated the tightening condition of 5 2018 units of remaining inventory, produced during the production period. (tightened torque 5.75 kg-cm~20.13 kg-cm) Only one of the five units inspected complied with the torque specification.
4. Stopped sales to dealers on 2019/01/10
5. Report issue to NHTSA on 2019/01/16: Kwang Yang Motor CO. discovered the leakage is resulting from an unfit rubber plug within the fuel pump.

**Description of Remedy :**

Description of Remedy Program : KYMCO USA, Inc. will provide the recall repair kits free of charge and pay pre-established KYMCO dealer labor rates for each repair performed. If any required equipment/instrument is needed, that is not in the dealers' possession, we will provide it to them free of charge. Kwang Yang Motor Co., Ltd. has assigned a flat rate code for this recall:

- The repair kit (Part Number: Like200-2019-Recall-Adj) contains the following items:
  - o Torque Wrench (if needed)
  - o Repair Instructions
  - o Warranty/Reimbursement Instructions
- Flat rate code: Like200-2019-Recall-Adj
- Flat rate time allotted: Thirty (30) minutes

How Remedy Component Differs from Recalled Component : There is no component change. The action required is to tighten the clamp on the existing component.

Identify How/When Recall Condition was Corrected in Production : Now the clamp tightening process is part of the QA/QC procedure.

**Recall Schedule :**

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported