

Part 573 Safety Recall Report

19V-042

Manufacturer Name : Winnebago Industries, Inc**Submission Date :** MAY 06, 2019**NHTSA Recall No. :** 19V-042**Manufacturer Recall No. :** 156**Manufacturer Information :****Population :**

Manufacturer Name : Winnebago Industries, Inc

Number of potentially involved : 3,351

 Address : PO BOX 152
 605 W. Crystal Lake Rd. Forest City IA
 50436

Estimated percentage with defect : 100 %

Company phone : 1-641-585-3535

Vehicle Information :

Vehicle 1 : 2012-2018 Winnebago ERA

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Cabinets shelves did not have the required number of fasteners to hold the shelf to the cabinet face. Affected the entire population up thru hold notice 876

Production Dates : NOV 11, 2010 - JAN 16, 2019

VIN Range 1 : Begin :

NR

End : NR

☐ Not sequential**Description of Defect :**

Description of the Defect : Overhead cabinet shelf may detach from the cabinet face and fall down in the cab area.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the shelf would fall while in transit the driver and passenger may be injured from the shelf and the contents of the cabinet falling them and/or could become a distraction to the driver, which could lead to a crash causing to death or injury

Description of the Cause : Cabinets shelves did not have the required number of fasteners to hold the shelf to the cabinet face

Identification of Any Warning that can Occur : One or more cabinet screws coming loose.

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

1-3-19 S/N 15X14469 ORMU opened identifying OVHD shelf fell down on customer
1-4-19 Investigating found a Change Request opened June/July 2018 due to a shelf failure
1-7-19 Found ORMU on S/N 15W12962 was opened on 9-18-18 for shelf failure
1-7-19 Found S/N 15W12408 & 15W12615 on "Face Book" with a stated shelf failure
1-11-19 Safety Committee determined this issue is recallable
1-15-19 Submitted to NHTSA portal

Description of Remedy :

Description of Remedy Program :	Adding two support brackets and 18 screws along with a Warning label with MAX capacity of this storage space.
How Remedy Component Differs from Recalled Component :	The door opening will have a label installed stating the MAX capacity of the storage space.
Identify How/When Recall Condition was Corrected in Production :	Adding two support brackets and 18 screws along with a label stating the MAX capacity of the storage space.

Recall Schedule :

Description of Recall Schedule :	Schedule is shown on the right. Jeff & Michell thank you ... your the greatest!
Planned Dealer Notification Date :	FEB 27, 2019 - FEB 27, 2019
Planned Owner Notification Date :	MAR 08, 2019 - MAR 08, 2019

* NR - Not Reported