

Part 573 Safety Recall Report

19V-101

Manufacturer Name : Kia Motors America**Submission Date :** FEB 15, 2019**NHTSA Recall No. :** 19V-101**Manufacturer Recall No. :** SC174**Manufacturer Information :**

Manufacturer Name : Kia Motors America

Address : 111 Peters Canyon Road
Irvine CA 92606

Company phone : 800-333-4542

Population :

Number of potentially involved : 32,296

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2011-2012 Kia Sportage

Vehicle Type : LIGHT VEHICLES

Body Style : ALL

Power Train : GAS

Descriptive Information : Certain 2011-2012 MY Sportage vehicles equipped with 2.4L engines supplied by Hyundai Motor Company (HMC) Ulsan plant. Based on information received from Hyundai Motor Company (HMC), this recall is being conducted to address potential stalling due to engine oil pan leaking. The recall population was determined by a review of vehicle production records. The vehicles subject to this recall were not produced in VIN order. Customers seeking information about their specific vehicle will be referred to Kia's Consumer Assistance Center or their Kia dealer.

Production Dates : JUN 11, 2010 - FEB 13, 2012

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The oil pan may have been improperly sealed during engine production. As a result, engine oil may leak from the oil pan. If the vehicle is continued to be driven with an unrepaired oil leak, damage to the engine can occur, and the vehicle could stall while in motion. In limited cases, a fire can occur.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An engine stall at higher speeds can increase the risk of a crash. A vehicle fire increases the risk of injury.

Description of the Cause : Improperly sealed oil pan

Identification of Any Warning (a) Existence of oil on ground surfaces after vehicle is parked; (b) Existence of

that can Occur : oil on underbody surfaces; (c) Illumination of the "Check Engine" and/or oil pressure warning lamps; (d) Smell and/or smoke associated with oil on hot surfaces; and/or (e) Reduced power and/or hesitation.

Supplier Identification :

Component Manufacturer

Name : Hyundai Motor Company, Ulsan Plant
Address : 700, Yeompo-ro, Buk-gu
Ulsan FOREIGN STATES 44259
Country : Korea, Republic of

Chronology :

See attached document titled "Engine Oil Pan Leak Chronology"

Description of Remedy :

Description of Remedy Program : Kia is currently waiting for HMC's analysis and identification of the applicable remedy for this issue.

How Remedy Component Differs from Recalled Component : TBD

Identify How/When Recall Condition was Corrected in Production : The application process of the oil pan sealant was improved at HMC Ulsan engine plant in July 2012. No Kia Sportage vehicles equipped with engines supplied by the Ulsan plant were manufactured from February 14, 2012 thru end of July 2012.

Recall Schedule :

Description of Recall Schedule : The dealer notification is planned for April 5, 2019 and the owner notification is planned for April 10, 2019.

Planned Dealer Notification Date : APR 05, 2019 - APR 05, 2019

Planned Owner Notification Date : APR 10, 2019 - APR 10, 2019

* NR - Not Reported