#### The information contained in this report was submitted pursuant to 49 CFR §573

### OMB Control No.: 2127-0004 19V-153

# Part 573 Safety Recall Report

Manufacturer Name :Eldorado National-KansasSubmission Date :MAR 01, 2019NHTSA Recall No. :19V-153Manufacturer Recall No. :NR

#### Manufacturer Information :

Manufacturer Name : Eldorado National-Kansas Address : 1655 Wall Street Salina KS 67401 Company phone : 7858271033

### Vehicle Information :

Vehicle 1:	2015-2016 Ford Goshen Impulse	
Vehicle Type :	BUSES, MEDIUM & HEAVY VEHICLES	
Body Style :	OTHER	
Power Train :	NR	
Descriptive Information :	16 Goshen completed vehicles are equipped with the Freedman Seating Company GO- ES Foldaway Seat, P/Ns 43705, 75719, 48923, 45467. The Goshen recall population was determined by Freedman GO-ES Foldaway shipments for specified vehicle installation.	
Production Dates :	APR 01, 2015 - OCT 26, 2015	
VIN Range 1:	Begin : NR End : NR Not sequential	

**Population :** 

### **Description of Defect :**

FMVSS 1 : NR FMVSS 2 : NR		Description of the Defect :	Freedman Seating Company states that seats may have been manufactured with a back frame weldment that is too narrow resulting in deformation of the seat back cushion dump mechanism which may cause it to malfunction. If this mechanism does malfunction the seat cushion may not support the appropriate loading.
FMVSS 2 : NR		FMVSS 1 :	NR
		FMVSS 2 :	NR
Description of the Safety Risk : If this mechanism does malfunction the seat back cushion may not support the appropriate loading in the event of a front or rear vehicle collision.			the appropriate loading in the event of a front or rear vehicle collision.
Description of the Cause : NR		Description of the Cause :	NR
Identification of Any Warning that can Occur :Freedman Seating Company states there needs to be an audible click of the mechanism locking into position and the mechanism handle will rotate downwards when the back cushion is rotated from the stowed to the upright, design use position.			mechanism locking into position and the mechanism handle will rotate downwards when the back cushion is rotated from the stowed to the upright,
	_		



16

Number of potentially involved :

Estimated percentage with defect : 100 %

#### **Supplier Identification :**

#### **Component Manufacturer**

Name : Freedman Seating Company

Address : 4545 W Augusta Blvd Chicago ILLINOIS 60651

Country: United States

#### Chronology :

February 25, 2019: ElDorado/Goshen an inquiry from Kristin Lepper, NHTSA Recall Management Division, stating that Freedman Seating Company had identified Goshen Coach as purchasing the GO-ES Foldaway Seat affected by Freedman Recall 18E-076.

February 27, 2019: REV Bus Group – Salina submitted a request to Freedman Seating Company regarding GO-ES Seats contained within Recall 18E-076 that were delivered to Goshen Coach.

February 27, 2019: Freedman Seating Company provided an affected population list that had been delivered to Goshen Coach.

March 1, 2019: REV Bus Group – Salina provided an update to Kristin Lepper, NHTSA Recall Management Division, regarding the findings as a result of the inquiry of February 25, 2019.

March 1, 2019: REV Bus Group – Salina decided to file a 573 Report.

#### **Description of Remedy :**

Description of Remedy Program :	Freedman Seating Company states to correct this condition, FSC will facilitate an inspection and any necessary repairs. An Inspection & Repair Procedure may be obtained via https://www.freedmanseating.com/ instructions/go-es-foldaway. After seat inspection and a determination of the seat defect is confirmed, the customer shall contact FSC Customer Service (partsdept@freedmanseating.com), Subject: GO-ES Foldaway Seat Recall. FSC states that they will reimburse the cost of repairs related to this recall including parts and labor.
	Freedman Seating Company states there is no visual indication that would differentiate the recalled GO-ES Foldaway Seat (P/N 43705, 45467, 48923, 75719) from a remedy seat.
	Freedman Seating Company states there was a design change to add a gusset to seat back index pin on May 31, 2018. Welding fixture for the back frame weldment was modified the week of June 18, 2018 and returned to production.

#### **Recall Schedule :**

The information contained in this report was submitted pursuant to 49 CFR §573

## Part 573 Safety Recall Report

**19V-153** 

Description of Recall Schedule :	NR
Planned Dealer Notification Date :	APR 19, 2019 - APR 19, 2019
Planned Owner Notification Date :	APR 26, 2019 <sup>-</sup> APR 26, 2019

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573