#### OMB Control No.: 2127-0004

Not sequential

## Part 573 Safety Recall Report

### 19V-187

Manufacturer Name: Suzuki Motor USA, LLC

**Submission Date:** SEP 17, 2021 **NHTSA Recall No.:** 19V-187 **Manufacturer Recall No.:** 4011, 4012



#### **Manufacturer Information:**

Manufacturer Name: Suzuki Motor USA, LLC

Address: 3251 East Imperial Highway

Brea CA 92821-6795

Company phone: 714-996-7040

#### **Population:**

Number of potentially involved: 31,302 Estimated percentage with defect: 100 %

#### **Vehicle Information:**

Vehicle 1: 2010-2010 Suzuki Kizashi

Vehicle Type: LIGHT VEHICLES

Body Style : 4-DOOR Power Train : GAS

Descriptive Information: There are 1,339 affected vehicles. The recall population was determined based on

production records for vehicles equipped with leather seats.

Production Dates: OCT 13, 2009 - MAY 31, 2010

VIN Range 1 : Begin : NR End : NR

Vehicle 2: 2011-2011 Suzuki Kizashi

Vehicle Type: LIGHT VEHICLES

Body Style: 4-DOOR Power Train: GAS

Descriptive Information: There are 1,877 affected vehicles. The recall population was determined based on

production records for vehicles equipped with leather seats.

Production Dates: JUN 02, 2010 - JUN 08, 2011

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 3: 2012-2012 Suzuki Kizashi

Vehicle Type: LIGHT VEHICLES

Body Style : 4-DOOR Power Train : GAS

Descriptive Information: There are 1,890 affected vehicles. The recall population was determined based on

production records for vehicles equipped with leather seats.

Production Dates: JUN 08, 2011 - MAY 31, 2012

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 4:	2013-2013 Suzi	ıki Kizashi					
	LIGHT VEHICLES						
Body Style :							
Power Train :							
		ffeeted vehicles	The recall population was determ	minod based on			
Descriptive information.	There are 635 affected vehicles. The recall population was determined based on production records for vehicles equipped with leather seats.						
Production Dates :	JUL 02, 2012 - OCT 31, 2012						
VIN Range 1:	Begin:	NR	End: NR	■ Not sequential			
Vehicle 5:	2006-2006 Suzuki Grand Vitara						
Vehicle Type :	LIGHT VEHICLE	S					
Body Style :	SUV						
Power Train :							
Descriptive Information :	There are 10,192 affected vehicles. The recall population was determined based on production records for vehicles equipped with leather seats.						
•							
Production Dates :	MAY 24, 2005 -	MAY 31, 2006					
VIN Range 1:	Begin:	NR	End: NR	■ Not sequential			
Vehicle 6:	2013-2013 Suzuki Grand Vitara						
Vehicle Type :	LIGHT VEHICLES						
Body Style :	SUV						
Power Train :	GAS						
Descriptive Information :	There are 616 a	ffected vehicles	. the recall population was detern	nined based on			
	production records for vehicles equipped with leather seats.						
Production Dates:	AUG 01, 2012 - I	NOV 02, 2012					
VIN Range 1:	Begin:	NR	End: NR	■ Not sequential			
Vehicle 7 :	2008-2008 Suzuki Grand Vitara						
			L				
· -	LIGHT VEHICLE		·				
Body Style :	LIGHT VEHICLE SUV		•				
· -	LIGHT VEHICLE SUV						
Body Style : Power Train :	LIGHT VEHICLE SUV GAS There are 3,494	S affected vehicle	es. The recall population was dete	ermined based on			
Body Style : Power Train :	LIGHT VEHICLE SUV GAS There are 3,494	S affected vehicle		ermined based on			
Body Style : Power Train : Descriptive Information : Production Dates :	LIGHT VEHICLE SUV GAS There are 3,494 production reco	affected vehicles	es. The recall population was dete	ermined based on			
Body Style : Power Train : Descriptive Information :	LIGHT VEHICLE SUV GAS There are 3,494 production reco	affected vehicles	es. The recall population was dete	ermined based on			

Vehicle 8:	2009-2009 Suzuki Grand Vitara							
Vehicle Type :	LIGHT VEHICLE	S						
Body Style :								
Power Train :								
Descriptive Information :	There are 1.384	affected vehicle	es. The	recall population was dete	rmined based on			
<b>P</b>	production records for vehicles equipped with leather seats.							
Production Dates :	JUN 02, 2008 - JAN 30, 2009							
VIN Range 1:	Begin:	NR	End:	NR	■ Not sequential			
	U				_ '			
Vehicle 9:	2010-2010 Suzuki Grand Vitara							
Vehicle Type :	LIGHT VEHICLE	S						
Body Style :	SUV							
Power Train :	GAS							
<b>Descriptive Information:</b>	There are 1,233	affected vehicle	es. The	recall population was dete	rmined based on			
	production records for vehicles equipped with leather seats.							
Production Dates:	JUL 01, 2009 - M	AY 28, 2010						
VIN Range 1:	Begin:	NR	End:	NR	■ Not sequential			
** 1.1.40								
	2011-2011 Suzuki Grand Vitara							
V -	LIGHT VEHICLES							
Body Style :								
Power Train:								
Descriptive Information :	There are 1,438 affected vehicles. The recall population was determined based on							
n 1 n .	production records for vehicles equipped with leather seats.							
Production Dates :	,		г 1	ND				
VIN Range 1:	Begin:	NR	End:	NR	☐ Not sequential			
Vohicle 11:	2012 2012 Suzu	ıki Crand Vitara						
	1: 2012-2012 Suzuki Grand Vitara be: LIGHT VEHICLES							
Body Style:								
Power Train:								
		affacted wabials	a The	recall nanulation was data	rminad based on			
Descriptive Information: There are 1,912 affected vehicles. The recall population was determined based on production records for vehicles equipped with leather seats.								
Production Dates: JUN 07, 2011 - JUN 29, 2012								
VIN Range 1:		NR	End:	NR.	☐ Not sequential			
viiv ivalige 1.	208111.	1110	Liiu .	1110	not sequential			

Vehicle 12: 2007-2007 Suzuki Grand Vitara

Vehicle Type: LIGHT VEHICLES

Body Style: SUV Power Train: GAS

Descriptive Information: There are 5,292 affected vehicles. The recall population was determined based on

production records for vehicles equipped with leather seats.

Production Dates: JUN 01, 2006 - JUN 01, 2007

VIN Range 1 : Begin : End: NR Not sequential

#### **Description of Defect:**

Description of the Defect: The natural leather seating surface of the front passenger seat can shrink. This

condition can impose modest pressure on the occupant classification system (OCS) sensor mat. This can cause the OCS to judge that there is a child in the seat when the seat is vacant. It can also cause the OCS to judge that there is an

adult in the seat when the seat is occupied by a child.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: In a frontal impact of sufficient magnitude, the front air bag can deploy even if

there is a child in the front passenger seat.

Description of the Cause: Shrinkage of the original passenger seat cushion cover is caused by conditions

of variable high humidity and high temperature.

Identification of Any Warning If the OCS judges that there is a child in the front passenger seat when the seat

that can Occur: is vacant, the PASS AIR BAG OFF indicator and passenger seat belt reminder light will be illuminated, and the seat belt reminder chime will sound. If the OCS judges that there is an adult in the front passenger seat when the seat is occupied by a child, the PASS AIR BAG OFF indicator will not be illuminated.

#### **Involved Components:**

Component Name 1: NR Component Description: NR

Component Part Number: NR

#### **Supplier Identification:**

#### **Component Manufacturer**

Name: SNIC Co., Ltd.

Address: 1403 Higashi-Hiramatsu, Iwata City

Shizuoka Prefecture, 438-0211 Foreign States

Country: Japan

#### **Chronology:**

The chronology is attached as a separate document.

#### **Description of Remedy:**

Description of Remedy Program: Suzuki Service providers will replace the seat bottom cushion of affected

vehicles with a seat bottom cushion that has an insert of synthetic leather

on the seating surface. Suzuki Motor of America, Inc.'s plan for

reimbursing owners who have paid for repairs to remedy the reported condition in advance of recall notification is attached as a separate

document.

from Recalled Component:

How Remedy Component Differs The remedy components are seat bottom cushions that have an insert of

synthetic leather on the seating surface. The name, description, and part number of the recalled components are provided below.

Kizashi part numbers for "Cushion Assy, FR R": 85101-59L80,

85101-59L81, 85101-59L90, 85101-59L91

Grand Vitara part numbers for "Cushion Assy, FR R": 85101-65JRO, 85101-65JR1, 85101-65JR2, 85101-65JR3, 85101-65JR4, 85101-65JR5, 85101-65JS0, 85101-65JS1, 85101-65JS2, 85101-65JS3, 85101-65JU0, 85101-65JU1, 85101-65JU2, 85101-65JU3, 85101-65JU4, 85101-65JU5,

85101-65JU6, 85101-76KR0, 85101-76KS0

Identify How/When Recall Condition NR

was Corrected in Production:

#### **Recall Schedule:**

Description of Recall Schedule: Service Provider notification of campaign commencement for Grand Vitara vehicles is planned for 1/3/2020. Service Provider notification of campaign commencement for Kizashi vehicles is planned for April 3, 2020. Recall notification for owners of Grand Vitara vehicles is planned for 1/10/2020. Recall notification for owners of Kizashi vehicles is scheduled for 4/10/2020. The Service Provider and owner notification dates for Grand Vitara vehicles were adjusted to accommodate end-ofyear shipping delays.

# **Part 573 Safety Recall Report**

19V-187

Page 6

Planned Dealer Notification Date : FEB 14, 2020 - APR 03, 2020 Planned Owner Notification Date : FEB 21, 2020 - APR 10, 2020

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573