

Part 573 Safety Recall Report

19V-246

Manufacturer Name : Chrysler (FCA US LLC)**Submission Date :** MAR 28, 2019**NHTSA Recall No. :** 19V-246**Manufacturer Recall No. :** V35**Manufacturer Information :**

Manufacturer Name : Chrysler (FCA US LLC)

Address : 800 Chrysler Drive
CIMS 482-00-91 Auburn Hills MI
48326-2757

Company phone : 1-800-853-1403

Population :

Number of potentially involved : 1,097

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2019-2019 Dodge Charger

Vehicle Type :

Body Style : 4-DOOR

Power Train : NR

Descriptive Information : The sun visor assemblies in some 2019 MY Dodge Charger vehicles may not comply to the airbag warning label requirements of FMVSS 208 Section 4.5.1 (b) (3). The driver sun visor may contain no airbag warning label and the passenger sun visor may contain airbag warning labels intended for non-US markets.

The suspect period was determined using assembly plant records and tracing headliner assembly part numbers, of which the sun visors are a subassembly. The suspect headliner assemblies, which contained no driver sun visor warning labels and passenger sun visor airbag warning labels intended for non-US markets, were assembled into US market vehicles from May 26, 2018, through February 8, 2019, when vehicles were assembled with the correct headliner assembly part numbers that contained correct US sun visor airbag warning labels on each front outboard visor.

Similar vehicles not included in the recall were built with FMVSS 208 compliant sun visor airbag warning labels.

Production Dates : MAY 26, 2018 - FEB 08, 2019

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Description of Noncompliance :

Description of the Noncompliance : FMVSS 208 S4.5.1 (b) (3) requires vehicles to have a label, conforming in content as specified in the standard, permanently affixed to either side of the sun visor at each front outboard seating position that is equipped with an inflatable restraint. Vehicles in the recall population may not provide the required airbag warning information.

FMVSS 1 : 208 - Occupant crash protection

FMVSS 2 : NR

Description of the Safety Risk : Failure to provide the required FMVSS 208 airbag warning information to the driver and/or passenger could increase the risk of injury in the event of a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : Daimay North America Automotive, Inc.

Address : 24400 Plymouth Rd
Redford 48239

Country : NR

Chronology :

- On February 1, 2019, a 2019 MY Dodge Charger built for the US market, but containing non-US sun visor airbag warning labels, was observed in the Brampton Assembly Plant ("BRAP") Customer Protection Audit.
- On February 6, 2019, FCA Engineering was notified that non-US sun visor airbag warning labels had been built into some US market vehicles.
- On February 6, 2019, the content and location of the non-US sun visor airbag warning labels were compared against the requirements as identified in FMVSS 208. Differences between the FMVSS 208 requirements and the non-US labels were identified.
- On March 21, 2019, FCA US determined, through the Vehicle Regulations Committee, to conduct a voluntary safety recall of the affected vehicles.

Description of Remedy :

Description of Remedy Program : FCA US will conduct a Voluntary Safety Recall on all affected vehicles to replace the driver and passenger sun visors.

FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.

How Remedy Component Differs from Recalled Component : Part Name: Visor Assembly – Illuminated with Mirror Left Hand/Right Hand

Part Description: Visor Assembly – Left Hand/Right Hand, Sunroof/Standard

Part Number: 5PJ79DX9AC, 5PJ80DX9AC, 5PJ82DX9AC, 5PJ81DX9AC

Comment: The remedy parts are driver and passenger sun visors containing airbag warning labels compliant to FMVSS 208, which replace the non-compliant sun visors intended for non-US markets.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : ** 03/28/2019: FCA US will notify dealers and begin notifying owners on or about 05/17/2019.

Planned Dealer Notification Date : MAY 17, 2019 - MAY 17, 2019

Planned Owner Notification Date : MAY 17, 2019 - MAY 17, 2019

* NR - Not Reported