

Part 573 Safety Recall Report

19V-350

Manufacturer Name : Jaguar Land Rover North America, LLC**Submission Date :** JUN 14, 2019**NHTSA Recall No. :** 19V-350**Manufacturer Recall No. :** N333**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 16,186

Address : 100 Jaguar Land Rover Way

Estimated percentage with defect : 100 %

Mahwah NJ 07495

Company phone : 8188500

Vehicle Information :

Vehicle 1 : 2016-2017 Land Rover Range Rover Sport

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : NR

Descriptive Information : Certain 2016 and 2017 Model Year Range Rover Sport vehicles where the Emergency Locking Retractor (ELR) in the safety belt assembly of the vehicle's driver's seat is not to specification. Due to a supplier manufacturing issue, the car-sensitive sensor mechanism does not lock as designed when subjected to the requirements in FMVSS 209 Section S4.3 (j) (2). Additionally, this also constitutes a non-compliance with FMVSS 208 S7.1.1.3.

Production Dates : MAY 03, 2016 - OCT 14, 2016VIN Range 1 : Begin : SALWS2PF6GA100000 End : SALWR2EF9GA121745 Not sequentialVIN Range 2 : Begin : SALWR2FK3HA660486 End : SALWR2FK9HA664297 Not sequentialVIN Range 3 : Begin : SALWS2PF1GA594637 End : SALWG2KF0GA666355 Not sequential

Vehicle 2 : 2016-2017 Land Rover Range Rover

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : NR

Descriptive Information : Certain 2016 and 2017 Model Year Range Rover vehicles where the Emergency Locking Retractor (ELR) in the safety belt assembly of the vehicle's driver's seat is not to specification. Due to a supplier manufacturing issue, the car-sensitive sensor mechanism does not lock as designed when subjected to the requirements in FMVSS 209 Section S4.3 (j) (2). Additionally, this also constitutes a non-compliance with FMVSS 208 S7.1.1.3.

Production Dates : MAY 03, 2016 - OCT 14, 2016VIN Range 1 : Begin : SALGS3EF0GA293645 End : SALGS2PF0GA318616 Not sequentialVIN Range 2 : Begin : SALGS2FV9HA308452 End : SALGS2FV2HA308454 Not sequential

Description of Noncompliance :

Description of the Noncompliance : A concern has been identified on certain 2016 and 2017 Model Year Range Rover and Range Rover Sport vehicles where the Emergency Locking Retractor (ELR) in the safety belt assembly of the vehicle's driver's seat is not to specification. Due to a supplier manufacturing issue, the car-sensitive sensor mechanism does not lock as designed when subjected to the requirements in FMVSS 209 Section S4.3 (j) (2). Additionally, this also constitutes a non-compliance with FMVSS 208 S7.1.1.3.

The ELR is equipped with a vehicle-sensitive locking mechanism and a webbing-sensitive locking mechanism. The non-compliance specifically involves the vehicle-sensitive mechanism.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : In the event of a pre-crash brake event prior to a crash, the ELR would not lock off at the correct design specification g-force level. This could impact the operation of the seat belt assembly negatively affect vehicle safety.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : Autoliv Kft.

Address : NR

Iskola u. 38-50. Sopronkövesd FOREIGN STATES H-9483

Country : Hungary

Chronology :

See file "N333 Recall Noncompliance Determination"

Description of Remedy :

Description of Remedy Program : Owners will be notified and instructed to take their vehicle to an approved Land Rover repairer. The technician will inspect the driver's side front seat belt assembly for identification of the production date. If the seat belt production date is from the specified production dates at risk, it will be replaced. If the seat belt production date is not from the specified production dates at risk, no further action is required. There will be no charge to owners for this repair.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Distribution of owner notification letters will occur on or before July 1, 2019. Notifications to dealers will occur on May 23, 2019.

Planned Dealer Notification Date : MAY 23, 2019 - MAY 23, 2019

Planned Owner Notification Date : JUL 01, 2019 - JUL 01, 2019

* NR - Not Reported