

Part 573 Safety Recall Report

19V-377

Manufacturer Name : Suzuki Motor of America, Inc.**Submission Date :** MAY 16, 2019**NHTSA Recall No. :** 19V-377**Manufacturer Recall No. :** 2A89**Manufacturer Information :**

Manufacturer Name : Suzuki Motor of America, Inc.

Address : 3251 East Imperial Highway
Brea CA 92821-6795

Company phone : 714-996-7040

Population :

Number of potentially involved : 300

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2018-2018 Suzuki UH200

Vehicle Type : MOTORCYCLES

Body Style :

Power Train : GAS

Descriptive Information : There are 180 affected motorcycles. All 2018 model year UH200 motorcycles are included in the recall population. Recalled vehicles were produced with a CVT movable driven face with holes for the fastening rivets that have an improper shape.

Production Dates : SEP 05, 2017 - JAN 23, 2018

VIN Range 1 : Begin : NR End : NR

 Not sequential

Vehicle 2 : 2019-2019 Suzuki UH200

Vehicle Type : MOTORCYCLES

Body Style :

Power Train : GAS

Descriptive Information : There are 120 affected motorcycles. All 2019 model year UH200 motorcycles are included in the recall population. Recalled vehicles were produced with a CVT movable driven face with holes for the fastening rivets that have an improper shape.

Production Dates : AUG 17, 2018 - NOV 06, 2018

VIN Range 1 : Begin : NR End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The movable driven face of the Continuously Variable Transmission (CVT) may break while riding.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the movable driven face of the CVT breaks while riding, the motorcycle will become disabled, increasing the risk of a crash.

Description of the Cause : The holes for the rivets that fasten the component parts of the movable driven face have a shape that may cause the rivet connections to be insufficient. Continued use of the motorcycle with this condition may allow excessive stress to be applied to the rivet connections when accelerating. Attached is an illustration showing the components involved.

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : Jinan Hongzheng Science and Technology
Address : Industrial Park, Qinlong Road
Pingyin County 250400 Jinan, Shandong FOREIGN STATES
Country : China

Chronology :

The chronology is attached as a separate document.

Description of Remedy :

Description of Remedy Program : Suzuki dealers will replace the movable driven face of affected vehicles with an improved part. Attached is a copy of Suzuki Motor of America, Inc.'s plan for reimbursing owners who incurred costs for remedies of the reported defect in advance of recall notification.

How Remedy Component Differs from Recalled Component : The recalled component is the driven face assembly, part number 21200-03H50. The remedy component has a blue paint mark between the company logo and the cast impression.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : The recall will be conducted by Suzuki Motor of America, Inc.

Planned Dealer Notification Date : MAY 31, 2019 - MAY 31, 2019

Planned Owner Notification Date : JUN 05, 2019 - JUN 05, 2019

* NR - Not Reported