

# Part 573 Safety Recall Report

# 19V-418

**Manufacturer Name :** Suzuki Motor of America, Inc.**Submission Date :** JUN 05, 2019**NHTSA Recall No. :** 19V-418**Manufacturer Recall No. :** 2A90**Manufacturer Information :**

Manufacturer Name : Suzuki Motor of America, Inc.

Address : 3251 East Imperial Highway

Brea CA 92821-6795

Company phone : 714-996-7040

**Population :**

Number of potentially involved : 2,640

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2018-2018 Suzuki GSX250R

Vehicle Type : MOTORCYCLES

Body Style :

Power Train : GAS

**Descriptive Information :** The recall population was determined based on production records. All 2018 model year GSX250R motorcycles are included in the recall population. There are 2,100 affected motorcycles.

Production Dates : MAR 25, 2017 - MAR 05, 2018

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2019-2019 Suzuki GSX250R

Vehicle Type : MOTORCYCLES

Body Style :

Power Train : GAS

**Descriptive Information :** The recall population was determined based on production records. All 2019 model year GSX250R motorcycles produced within the specified date range are included in the recall population. There are 540 affected motorcycles.

Production Dates : JUL 10, 2018 - NOV 29, 2018

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

**Description of the Defect :** Water intrusion into the rear brake stop lamp switch can cause corrosion of internal parts, which can lead to the stop lamp failing to illuminate when only the rear brake is applied or remaining illuminated continuously when the ignition is on.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Failure of the stop lamp to illuminate when braking or continuous illumination of the stop lamp when the brakes are not being used increase the risk of a crash.

Description of the Cause : Internal component parts of the stop lamp switch are made of inappropriate material which can corrode if water gets inside the switch.

Identification of Any Warning  
that can Occur : NR

## Supplier Identification :

### Component Manufacturer

Name : Yueqing Huayao Electric Co., Ltd.

Address : No. 20 South Zhongfang Rd.  
North Baixiang, Yueqing FOREIGN STATES

Country : China

## Chronology :

The chronology is attached as a separate document.

## Description of Remedy :

Description of Remedy Program : Suzuki dealers will replace the rear brake stop lamp switch with an improved part. Attached is Suzuki Motor of America, Inc.'s plan for reimbursing owners who incurred costs for remedies of the reported defect in advance of recall notification.

How Remedy Component Differs  
from Recalled Component : The recalled component is the stop lamp switch assembly, part number 33740-45D00. The remedy component can be distinguished from the recalled component because, for the remedy component, the wiring cover is not crimped and it does not have a cap on the bottom tip.

Identify How/When Recall Condition  
was Corrected in Production : The recall condition was corrected in production for 2019 model year vehicles produced on December 28 and December 29, 2018. A rear brake stop lamp switch produced by a Japanese supplier was used.

## Recall Schedule :

Description of Recall Schedule : The recall will be conducted by Suzuki Motor of America, Inc. (mainland U.S.), and by Suzuki del Caribe (Puerto Rico).

Planned Dealer Notification Date : JUN 14, 2019 - JUN 14, 2019

Planned Owner Notification Date : JUN 28, 2019 - JUN 28, 2019

\* NR - Not Reported