OMB Control No.: 2127-0004

Part 573 Safety Recall Report

Manufacturer Name :Chrysler (FCA US LLC)Submission Date :JUN 13, 2019NHTSA Recall No. :19V-448Manufacturer Recall No. :V67

Manufacturer Information :

Manufacturer Name : Chrysler (FCA US LLC) Address : 800 Chrysler Drive

CIMS 482-00-91 Auburn Hills MI 48326-2757 Company phone : 1-800-853-1403

Vehicle Information :

Vehicle 1:	2019-2019 Ra	am 1500			
Vehicle Type :					
Body Style :	PICKUP TRUC	СК			
Power Train :	NR				
Descriptive Information :	Some 2019 MY Ram 1500 pickup trucks may be equipped with a spare tire different than the spare tire size and cold inflation pressure designated on the tire placard label which does not meet the placard requirements of Federal Motor Vehicle Safety Standard ("FMVSS") 110.				
	on March 19, tire.	2019 at Ster	ling Heights Assembly	y the suspect period and vehicles built Plant with an incorrect size spare	
	Similar vehicles not included in the recall were built outside of the suspect period, or with the correct size spare tire as indicated on the tire placard label.				
Production Dates :	MAR 19, 2019) - MAR 19, 2	019		
VIN Range 1: Begin:		NR	End: NR	☐ Not sequential	
0	0				



19V-448

Population :

Number of potentially involved : 27 Estimated percentage with defect : 100 %

The information contained in this report was submitted pursuant to 49 CFR \$573

Part 573 Safety Recall Report

19V-448

Description of Noncompliance :

-	FMVSS 110 S4.3 requires that, "Each vehicle shall show the information specified in S4.3 (a) through (g) on a placard permanently affixed to the driver's side B-pillar. (c) recommended cold tire inflation pressure for front, rear and spare tires, For full size spare tires, the statement see above may, at the manufacturer's option replace manufacturer's recommended cold tire inflation pressure (d) Tire size designation, indicated by the headings and spare tire or spare, for the tires installed at the time of the first purchase for purposes other than resale. For full size spare tires, the statement see above may, at the manufacturer's option replace the tire size designation." Vehicles built with the incorrect size spare tire do not meet the applicable placard requirements.
FMVSS 1 :	110 - Tire selection and rims
FMVSS 2 :	NR
Description of the Safety Risk :	A driver may rely on the incorrect spare tire inflation pressure on the tire placard label and inflate the spare tire to an incorrect pressure resulting in potentially degraded vehicle performance, which can cause vehicle crash without prior warning.
Description of the Cause :	NR
Identification of Any Warning that can Occur :	NR

Supplier Identification :

Component Manufacturer				
Name :	NR			
Addross	NP			

Address: NR NR Country: NR

Chronology:

• On or about May 9, 2019, an initial review of plant production records indicated that some vehicles received a spare tire which may not match the size listed on the vehicle tire placard.

• On or about May 15, 2019, FCA US LLC ("FCA US") Engineering completed a detailed review of plant production records and identified the vehicles built with a spare tire that does not match the vehicle tire placard.

• On June 06, 2019, FCA US determined, through the Vehicle Regulations Committee, to conduct a voluntary

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

afety recall of the affected vehicles.	
scription of Remedy :	
Description of Remedy Program :	FCA US will conduct a Voluntary Safety Recall to replace the incorrect size spare tire with the correct size spare tire.
	FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.
How Remedy Component Differs from Recalled Component :	Part Name: All Terrain Spare Tire / Purpose Built Spare Tire
	Part Description: Spare tire / Spare tire
	Part Number: 04726654AB / 04726681AA
	Part Comment: This recall is not related to a tire defect but rather an assembly issue where the vehicle was built with the incorrect spare tire.
entify How/When Recall Condition was Corrected in Production :	NR

Description of Recall Schedule :>>06/13/2019: FCA US will notify dealers and begin notifying owners of
or about 08/02/2019.Planned Dealer Notification Date :AUG 02, 2019 - AUG 02, 2019Planned Owner Notification Date :AUG 02, 2019 - AUG 02, 2019

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573