Part 573 Safety Recall Report

Manufacturer Name :Mazda North American OperationsSubmission Date :JUL 29, 2019NHTSA Recall No. :19V-558Manufacturer Recall No. :3919G



Manufacturer Name :Mazda North American OperationsAddress :1025 Connecticut Avenue, NWSuite 910 Washington DC 20036Company phone :800-222-5500

Population :

Number of potentially involved : 22,571 Estimated percentage with defect : 1 %

云 🔨 🕰

NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION

19V-558

Vehicle Information :

Vehicle 1:	2019-2019 Mazda Mazda3
Vehicle Type :	LIGHT VEHICLES
Body Style :	ALL
Power Train :	GAS
Descriptive Information :	 Recall population determined by the production record of vehicles which may have had the subject interior rearview mirror installed. Vehicles not included in the recall have an improved interior rearview mirror unit installed. The following is the affected number of vehicles by MY/Make/Model: MY2019 Mazda Mazda3 built at Mazda de Mexico Vehicle Operation: 10,349 units MY2019 Mazda Mazda3 built at Mazda Motor Corporation in Japan: 12,222 units.
Production Dates :	SEP 25, 2018 - JUN 24, 2019
VIN Range 1:	Begin: 3MZBPAEM7KM100048 End: 3MZBPAAL8KM114618 Image: Not sequential
VIN Range 2:	Begin : JM1BPACM2K1100042 End : JM1BPBMM5K1130348 Not sequential

Description of Defect :

Description of the Defect :	The interior rearview mirror glass may suddenly detach from the mirror glass backing plate.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	If the interior rearview mirror glass falls off the mirror glass backing plate, the driver may have reduced rearward visibility, which may increase the risk of a crash. No accidents, injuries or deaths have been reported to date as a result of the defect.
Description of the Cause :	The mirror glass adhesive was not adequately bonded to the mirror glass backing plate during manufacture of the interior rearview mirror unit. As a

The information contained in this report was submitted pursuant to 49 CFR \$573

Part 573 Safety Recall Report

result, the interior mirror glass on some units may not have full adhesion
strength.Identification of Any Warning
that can Occur :There is no warning prior to occurrence of interior rearview mirror glass
detaching.

Supplier Identification :

Component Manufacturer

Name: ISHIZAKI HONTEN CO.,LTD.

Address : 1-2-15, Yanoshinmachi, Aki-ku, Hiroshima FOREIGN STATES 736-8670

Country: Japan

Chronology :

February 20, 2019: Mazda received a first field report "Rearview mirror fell off holder" from Mexico market. February 21, 2019: Part supplier conducted a temporary countermeasure of manually applying pressure to the mirror glass and mirror glass backing plate to improve the adhesion during the manufacturing process. March 9, 2019: Mazda and part supplier investigated the returned parts from field and determined this failure was caused by an improper mirror glass and mirror glass backing plate assembly process. March 20, 2019: Mazda considered further countermeasures as permanent action and implemented them at the vehicle assembly plant in Japan.

April, 2019 through June, 2019: Mazda has received multiple field reports from the U.S, which were the same as in Mexico. There were also several reports the failure occurred on vehicles in which the temporary countermeasure part was installed. No failure occurred on vehicles in which the permanent counter measure part was installed.

June 24, 2019: Mazda implemented the permanent countermeasures on the Mazda3 vehicles built at vehicle assembly plant in Mexico.

July 23, 2019: Mazda held a Quality Audit Committee meeting to review all available information to date and determined to conduct a proactive field action on certain MY 2019 Mazda3 vehicles.

Description of Remedy :

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Page 3

	The remedy components have proper adhesive force between the mirror glass and mirror glass backing plate. Recalled Parts name: Rearview Mirror Part number: BCJH-69220.
5	The improved interior rearview mirror unit was implemented on March 20, 2019 at the vehicle assembly plant in Japan and on June 24, 2019 at the vehicle assembly plant in Mexico.

Recall Schedule :

Description of Recall Schedule :	Notification to dealers is expected to occur on or before August 1, 2019. Mailing of owner notification letters is expected to be completed on or before August 30, 2019.
Planned Dealer Notification Date : Planned Owner Notification Date :	AUG 01, 2019 - AUG 01, 2019

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573