OMB Control No.: 2127-0004

Part 573 Safety Recall Report

19V-780

Manufacturer Name: Ducati North America

Submission Date: OCT 30, 2019 **NHTSA Recall No.:** 19V-780

Manufacturer Recall No.: SRV-RCL-19-003



Manufacturer Information:

Manufacturer Name: Ducati North America

Address: 448 E. Middlefield Rd

Mountain View CA 94043

Company phone: 719 209 4609

Population:

Number of potentially involved: 793 Estimated percentage with defect: 1 %

Vehicle Information:

Vehicle 1: 2019-2020 Ducati Hypermotard 950, Hypermotard 950 SP

Vehicle Type: MOTORCYCLES

Body Style : OTHER Power Train : GAS

 $\label{lem:decomposition} \textbf{Descriptive Information:} \ \ \textbf{On road sport motorcycle}$

Production Dates: DEC 22, 2018 - SEP 10, 2019

VIN Range 1: Begin: ZDMBAJDT6KB000337 End: ZDMBAJDT5LB004591 Not sequential

Description of Defect:

Description of the Defect: In some circumstances, the negative cable terminal might fail resulting in a

sudden interruption of the connection to the battery pole.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: If the terminal failure would happen, a sudden loss of battery power can

result in an engine stalling, increasing the risk of a crash or injury.

Description of the Cause: The negative cable terminal to the battery might break as a result of the cable

terminal being too tight, combined with vibration of the battery.

Identification of Any Warning There are no fault codes or warning.

that can Occur:

Supplier Identification:

Component Manufacturer

Name: NR

Address: NR

NR

Country: NR

Chronology:

Field requests were notified by dealers to DMH between July and October 2019.

DMH investigated the root cause, identifying some improvements to be implemented in the installation process (cable length and battery installation).

A remedy was implemented in order improve the reliability of the terminal connection, ensuring the proper installation to the battery.

On October 29, 2019 the DMH Safety committee decided to launch a voluntary recall.

To date, no accidents, no injuries, no fatalities have been reported.

Description of Remedy:

Description of Remedy Program: Official Ducati dealers will review the existing routing of the negative

cable. Additionally, the battery will be better secured to reduce the presence of the vibration. This rework will be carried out free of charge. A Ducati North America Recall Bulletin is scheduled to be published to the

Ducati Dealer Network using the established communication process. Owner notification letters are expected to mail within 60 days from

submission of this report.

How Remedy Component Differs The routing will be better located, in order to reduce tension when

from Recalled Component : connected to the battery terminal. In addition, two insulation pads will be

installed in order to reduce the impact of the vibrations to the battery.

Identify How/When Recall Condition The same remedy has been introduced in production line.

was Corrected in Production :

Recall Schedule:

Description of Recall Schedule: A Ducati North America Recall Bulletin will be published to the network

of dealers through an established communication process. We estimate that we will initiate the Recall contact process for affected motorcycle customers by the last week of November 2019, immediately upon parts becoming available. Owner notification letters will be mailed within 60

days from submission of this report.

Planned Dealer Notification Date: NOV 21, 2019 - NOV 28, 2019

Planned Owner Notification Date: DEC 12, 2010 - DEC 10, 2010

Planned Owner Notification Date: DEC 12, 2019 - DEC 19, 2019

^{*} NR - Not Reported