OMB Control No.: 2127-0004

Part 573 Safety Recall Report

19V-838

Manufacturer Name: Navistar, Inc.
Submission Date: NOV 21, 2019
NHTSA Recall No.: 19V-838
Manufacturer Recall No.: 19519



Manufacturer Information:

Manufacturer Name: Navistar, Inc.

Address: 2701 Navistar Drive

Lisle IL 60532

Company phone: 331-332-1590

Population:

Number of potentially involved: 3 Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2020-2020 International HV

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style: OTHER Power Train: DIESEL

Descriptive Information: The suspect population is identified by models built as 6X4 vehicle configurations

with 6 channel ABS and vehicle wheelbase greater than 252 inches.

The vehicles in the suspect population were built with a 6X4 vehicle configuration with 6 channel ABS and a wheelbase greater than 252 inches. Similar 6x4 vehicles not included either did not have 6 channel ABS, or their wheelbase was less than 252

inches.

The inclusive dates of manufacture were determined when the 6 channel ABS went into production on a 6X4 vehicle configuration until the issue was contained in

manufacturing.

There are three (3) HV series trucks in the suspect population

Production Dates: MAY 02, 2019 - JUL 18, 2019

Description of Noncompliance:

Description of the The drive axle brake modulator valves may not meet the requirements for

Noncompliance: FMVSS 121 S5.3.4 Brake release time. Each service brake system shall meet the

requirements of S5.3.4.1 (a) and (b).

FMVSS 1: 121 - Air brake systems

FMVSS 2: NR

Description of the Safety Risk: This condition has no impact on normal brake operation. There is no

additional risk to motor vehicle safety. On vehicles with a wheelbase greater

than 252 inches, the incorrect valve only affects release timing as specified in FMVSS 121 S5.3.4(a) and (b).

Description of the Cause: A non-Quick Release Modulator Valve (NQRMV) may have been installed when

design specifications require a Quick Release Modulator Valve (QRMV).

Identification of Any Warning None

that can Occur:

Supplier Identification:

Component Manufacturer

Name: NR Address: NR

NR

Country: NR

Chronology:

- •11/06/2019 Navistar manufacturing discovers the issue and quarantines suspect vehicles at the plant.
- •11/07/2019 Navistar Compliance is notified of the vehicle ship hold and initiates investigation.
- •11/11/19 Navistar Compliance confirms that the wrong modulator valve part number was installed at the assembly plant, which does not include the quick release valve.
- •11/14/2019 Engineering determines that only vehicles with wheelbase greater than 252 inches would fail to meet the release timing required by FMVSS 121 S5.3.4(a) and (b). A vehicle search was conducted for 6x4 vehicles, with 6 channel ABS, and wheelbase greater than 252 inches to finalize the suspect population.
- •11/14/2019 Navistar declares a non-compliance recall.

Description of Remedy:

- Description of Remedy Program: •All four rear axle brake modulator valves will have the NQRMV replaced with QRMV.
 - •Navistar's plan for reimbursement of pre-notification remedies, on file with NHTSA and dated 10/03/2018, applies and reimbursement instructions will be included in the customer notification.

How Remedy Component Differs The remedy brake modulator valves are QRMV and the recalled brake

from Recalled Component: modulator valves are NQRMV.

Identify How/When Recall Condition 11/07/2019 – Navistar Manufacturing updates the manufacturing process

was Corrected in Production: for 6x4 vehicles, with 6 channel ABS, and wheelbase greater than 252

inches.

Recall Schedule:

Description of Recall Schedule: It is estimated that the Customer and Dealer notification letters will be

mailed by 01/20/2020.

Planned Dealer Notification Date: JAN 20, 2020 - JAN 20, 2020 Planned Owner Notification Date: JAN 20, 2020 - JAN 20, 2020

^{*} NR - Not Reported