#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

Manufacturer Name :Forest River, Inc.Submission Date :AUG 20, 2020NHTSA Recall No. :19V-919Manufacturer Recall No. :51-1121

### Manufacturer Information :

Manufacturer Name : Forest River, Inc.

Address : 55470 CR 1

P.O. Box 3030 Elkhart IN 46515-3030 Company phone : 1-800-348-7440

### **Population :**

Number of potentially involved :11Estimated percentage with defect :100 %

#### Vehicle Information :

The information contained in this report was submitted pursuant to 49 CFR §573



# 19V-919

# Part 573 Safety Recall Report

19V-919

Page 2

	BUSES, MEDIUM & HEA OTHER		B, RVC24CB & ORION ORP24RB
Descriptive Information :	with 3.0L Diesel or 3.6L have been built with a co- fan circuit protection de overheating during a co- to electrical overloading The suspect period bega cooling fans for which w motors, and concluded of warranty claims sharply manufacturing records of ProMaster vehicles not if suspect period, or were protection design. RVC24TB – 2 RVC24RB – 5 Orion ORP24RB – 2	boling fan which may be susc sign that may not be sufficien oling fan seize condition in hi of the fan motor potentially in on April 30, 2015, the man varranty claims began to incre on November 1, 2017, when H declined. Warranty claim re were used to identify the susp ncluded in this recall were m not equipped with the suspe	with air conditioning ("A/C") may eptible to seizure and a cooling int to protect the fan from gh speed mode, which could lead resulting in thermal degradation ufacturing date related to the ease for seized or rattling fan Ram ProMaster cooling fan cords and cooling fan pect population. Similar Ram lanufactured before or after the
Production Dates : VIN Range 1 : 1	APR 30, 2015 - NOV 01, Begin : NR	2017 End : NR	□ Not sequential
escription of Defect : Description of the Defect : A cooling fan stall / seizure event could lead to electrical overloading of the fan motor potentially resulting in the thermal degradation of the brush housing, which may lead to a vehicle fire.			
FMVSS FMVSS			

# Part 573 Safety Recall Report

**19V-919** 

Page 3

Description of the Safety Risk :	A vehicle fire may increase the risk of injury to occupants and persons outside of the vehicle, as well as property damage.
Description of the Cause :	Not Reported
, i i i i i i i i i i i i i i i i i i i	In some circumstances, the Check Engine and/or the Engine Temperature Malfunction Indicator Lights may illuminate

#### **Involved Components :**

Component Name 1:	NR
Component Description :	NR

Component Part Number: NR

#### **Supplier Identification :**

#### **Component Manufacturer**

Name :FCA US LLCAddress :PO BOX 218008<br/>Auburn Hills MICHIGAN 48321Country :United States

#### **Chronology** :

On 12/18/2019 Forest River's Office of Corporate Compliance received an interim notification from FCA. Per Chrysler (FCA US LLC) is recalling certain 2015-2018 Ram ProMaster vehicles equipped with 3.0L diesel or 3.6L gasoline engines and air conditioning (A/C). The engine cooling fan may seize which can cause the cooling fan motor to overheat.

Production Dates specified by FCA as April 30, 2015 – November 1, 2017

On 12/23/2019 Forest River filed a pass thru recall

On 8/20/2020 Forest River received final notice of recall with remedy. Amended US vehicles only bring the affected population to 11, original was 9. Final Notice Letters will be mailed to all current owners with instructions on how to have the remedy performed.

The information contained in this report was submitted pursuant to 49 CFR §573

# **19V-919**

## **Description of Remedy :**

Description of Remedy Program :	The remedy for this recall is still under development. FCA US LLC issued owners an interim notification on December 10, 2019. Owners will receive a second notice when the remedy becomes available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is VB2. On 8/20/2020 adding remedy from FCA FCA US will repair your vehicle [2] free of charge (parts and labor). To do this, your dealer will replace the engine cooling fan module. The estimated repair time is two hours. In addition, your dealer will require your vehicle for proper check-in, preparation, and check-out during your visit, which may require more time. Your time is important to us, so we recommend that you schedule a service appointment to minimize your inconvenience. Please bring this letter with you to your dealership. TO SCHEDULE YOUR FREE REPAIR, CALL YOUR FCA BUSINESSLINK DEALER TODAY CALIFORNIA RESIDENTS The State of California requires the completion of emission recall repairs prior to vehicle registration renewal. Your dealer will provide you with a Vehicle Emission Recall Proof of Correction Form after the Emission Recall service is performed. Be sure to save this form since the California Department of Motor Vehicles may require that you supply it as proof that the Emission Recall has been performed. In order to ensure your full protection under the emissions warranty provisions, it is recommended that you have your (vehicle or engine) serviced as soon as possible. Failure to do so could be determined as lack of proper maintenance of your (vehicle or engine).
How Remedy Component Differs from Recalled Component :	Not reported
Identify How/When Recall Condition was Corrected in Production :	Not reported

## **Recall Schedule :**

Description of Recall Schedule :	Forest River has the utmost urgency in our recalls. Forest River will send suspected VIN numbers to our third party vendor that is licensed to pull data on the current owner of the vehicles (as needed) once a formal NHTSA I.D. is provided. Forest River intends on pushing the mailing out as soon as NHTSA provides any correction(s) and an Acknowledgement Letter.
Planned Dealer Notification Date :	SEP 29, 2020 - SEP 29, 2020
Planned Owner Notification Date :	SEP 29, 2020 - SEP 29, 2020

## \* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573