Safety Recall Code: 69Y5



Subject	Driver Frontal Airbag Inflator (Takata)
Release Date	February, 26 2019
Affected Vehicles	U.S.A.: Certain 2015-2016 MY Volkswagen Eos, 2015-2017 MY Volkswagen CC & 2015 MY Volkswagen Passat equipped with a Takata driver frontal airbag
	CANADA: Certain 2015 MY Volkswagen Eos, 2015-2017 MY Volkswagen CC & 2015 MY Volkswagen Passat equipped with a Takata driver frontal airbag
	Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.
	 ✓ Campaign status must show "open." ✓ If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign.
Problem Description	The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death.
Corrective Action	Replace the driver frontal airbag inflator with a newly manufactured version.
Parts Information	Parts will be allocated weekly. Please email <u>VWoAPartsSpecialists@vw.com</u> with VIN if you do not have the proper part(s) in stock.
Code Visibility	On or about February 26, 2019, affected vehicles will be listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on <u>www.vwhub.com</u> & OMD Web). A list will not be posted for dealers who do not have any affected vehicles.
	On or about February 26, 2019, this campaign code will show open on affected vehicles in Elsa.
	On or about February 26, 2019, affected vehicles will be identified with this campaign code in the VIN Lookup tool at <u>www.vw.com</u> and on the NHTSA VIN lookup tool at <u>www.safercar.gov</u> .
Owner Notification	Owner notification will take place in March 2019. Owner letter examples are included in this bulletin for your reference.
Additional Information	Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.
	IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS
	<u>New Vehicles in Dealer Inventory:</u> It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.
	<u>Pre-Owned Vehicles in Dealer Inventory</u> : Dealers should not deliver any pre-owned vehicles in their inventory which are involved in a safety or compliance recall until the defect has been remedied.
	Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before</u> <u>delivery to consumers</u> .
	Fill out and affix Campaign Completion Label (CAMP 010 000) after work is complete. Labels can be ordered at no cost via the Compliance Label Ordering portal at <u>www.vwhub.com</u> .

Claim Entry Instructions

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action <u>open on the day of repair</u> to the repair order.

If customer refused campaign work:

- ✓ U.S. dealers: Submit request via WISE under the Campaigns/Update/Recall Closure option.
- ✓ Canada dealers: Fax repair order to Warranty at (905) 428-4811.

Service Number	69Y5				
Damage Code	0099				
Parts Vendor Code	WWO	WWO			
Claim Type	Sold vehicle: 7	10			
	Unsold vehicle	Unsold vehicle: 7 90			
Causal Indicator	Mark airbag in	flator kit* as causal p	art		
Vehicle Wash/Loaner	Do not claim w	/ash/loaner under thi	s action		
	loaner/rental min the Volksv	Do not claim wash/loaner under this action <u>U.S.A.:</u> Loaner/rental coverage cannot be claimed under this action. However, loaner/rental may be covered under the mobility program. Please refer to section 3.30 in the Volkswagen Warranty Policy and Procedures Manual for loaner claims information and reimbursement details.			
			not be claimed under this action. Please refer to the to determine loaner eligibility.		
Criteria I.D.	T2				
	Install new airbag inflator kit. Labor operation: 6958 56 99 105 T.U.				
	Quantity	Quantity Part Number Description			
	1.00 3C8898201C Airbag Inflator Kit With Vibration Damper*				
Criteria I.D.	Т3				
	Install new driv	ver airbag			
		Labor operation: 6958 55 99 65 T.U.			
	Quantity	Quantity Part Number Description			
	1.00 561880201AA81U Driver Airbag*				
Criteria I.D.	N2				
	Install new airt	bag inflator kit.			
	Labor operatio	n: 6958 56 99	105 T.U.		
	Quantity	Part Number	Description		
	1.00	3C8898201B	Airbag Inflator Kit Without Vibration Damper*		
		•			

Customer Letter Example (USA)

This notice applies to your vehicle: <VIN>

NHTSA: 19V014

Subject: Safety Recall 69Y5 – Driver Frontal Airbag Inflator (Takata) Certain 2015-2016 Model Year Volkswagen Eos, 2015-2017 Model Year Volkswagen CC & 2015 Model Year Volkswagen Passat equipped with a Takata Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2015-2017 model year Volkswagen vehicles equipped with a Takata driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

DANGER! The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death. Schedule this recall repair immediately. Please contact your authorized Volkswagen dealer What should you do? without delay to schedule this recall repair. For your convenience, you can also visit www.vw.com/find-a-dealer to locate a dealer near you and schedule this service online. What will we do? To correct this defect, your authorized Volkswagen dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the repair. as well as to accommodate their daily workshop schedule. Lease vehicles and If you are the lessor and registered owner of the vehicle identified in this action, the law address changes requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records. Can we assist you If your authorized Volkswagen dealer fails or is unable to complete this work free of further? charge within a reasonable time, or if you should have any questions about this communication, please don't hesitate to contact Customer CARE, Monday through Friday by phone at 800-893-5298. You are also welcome to e-mail or chat through the "Contact Us" page http://www.vw.com/contact/. Checking your vehicle To check your vehicle's eligibility for repair under this or any other recall/service campaign, for open Recalls and please click on the Look Up Recalls link at www.vw.com and enter your Vehicle Identification Service Campaigns Number (VIN) into the Recall/Service Campaign Lookup tool.

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153): or go to http://www.safercar.gov.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

This notice applies to your vehicle: <VIN>

Subject: Safety Recall 69Y5 – Driver Frontal Airbag Inflator (Takata) Certain 2015 Model Year Volkswagen Eos, 2015-2017 Model Year Volkswagen CC & 2015 Model Year Volkswagen Passat equipped with a Takata Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2015-2017 model year Volkswagen vehicles equipped with a Takata driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

DANGER!				
	driver airbag may explode in a crash with airbag deployment.			
Sharp m	etal fragments can hit people and cause serious injury or death.			
What should you do?	Schedule this recall repair immediately. Please contact your authorized Volkswagen dealer without delay to schedule this recall repair.			
What will we do?	To correct this defect, your authorized Volkswagen dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge.			
	Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.			
Lease vehicles and address changes	If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.			
Can we assist you further?	If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Customer Relations, Monday through Friday from 8AM to 8PM EST by phone at 1-800-822-8987 or via our "Contact Us" page at <u>www.vw.ca</u> .			

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

Campaign Work Procedure

- The driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after longterm exposure to absolute high humidity and temperature cycling). In the event of an inflator rupture, in very rare cases metal fragments could pass through the airbag cushion material, which may result in serious injury or death.
- This Recall should be performed before any other work is performed on the vehicle.

A WARNING

Risk of injury. Refer to "Warning and Safety Precautions", found in Appendix A at the end of this document.

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.

Required Parts

N2	1	Eos (1F)	3C8898201B	Airbag Inflator Kit Without Vibration Damper
T2	1	CC (35)	3C8898201C	Airbag Inflator Kit With Vibration Damper
Т3	1	Passat (A3)	561880201AA 81U	Driver Airbag

()NOTE

All inflator kits include inflator, inflator nuts, horn ring bolts, one replacement horn ring spring and return instructions.

Required Safety Equipment




•

Ear Protection (locally sourced) ٠

Face Shield (locally sourced)

Required Tools

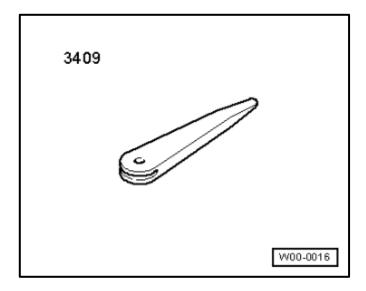



• Trim Removal Wedge - 3409 (or equivalent)

• ESD Worksurface - VAS 6613







Bar Code Scanner – VAS6161/1

• Airbag Support - T10568

• Lever - T10571



VAS6150D - Diagnostic Tester (or equivalent)



VAG1410 – Torque Wrench (or equivalent)

Required Work Environment

Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.

NOTE

The work area must be in the vicinity of the scan tool and the vehicle in order to properly complete this procedure.



- Workbench that will support a vice.
- Work surface free of unnecessary tools, equipment and debris.

Repair Instruction

Section A - Check for Previous Repair

i TIP

If Campaign Completion label is present, no further work is required.



• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>. If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

Proceed to Section B

Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at 0 least 10 minutes before handling.




Prior to beginning repairs, verify the horn is operational.

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.



https://vwcup.track360.com/?p=vwiqCertification&id=11288

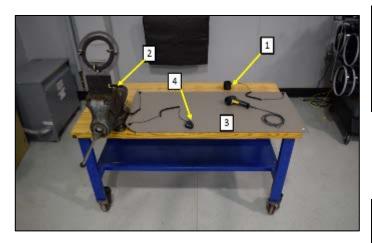


- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.
- Assemble ESD workplace -VAS 6613- <1, 2, 3, • and 4>.
- Plug ESD workplace into a wall socket using plug • <1>.

NOTE

The wall socket or extension cord must have a sufficient ground.

- Clamp Airbag Support T10568 <2> into the vice. •
- Connect crocodile clip <1> to airbag support <2> • and ESD workplace -VAS 6613-.

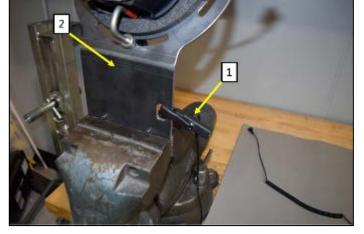

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2019 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. February 2019

Use the QR code or the link to view a video • detailing the repair process prior to performing the repair.



- Ensure ODIS is updated to the latest version. •
- Connect vehicle diagnostic tester to the diagnostic • head using the USB cable.
- Select Start Diagnosis function and identify • vehicle.
- After identification of control units, Guided Fault • Finding is started automatically.
- Follow the instructions on screen. •

porter: saler:):	444 03999 	VIN: Engine:	CCTA 2.0 L Motronic/147kW	🧀 🛃 🏷 0	
httpom loran	es Orders DISS TSB Test plan Ope	eration Special Functions			080
sts for the e	entre vehicle				- R Part
Status	Tests				Measurement
-	Showroom mode				
	Special actions				into 🦉
-	Adapt Mechatronics software				Admin 😧
-				E)	
-	Adapt SW for pwr. supply sys.	ctrl, mod. (BCM)			Log
-	Adapt airbag software				Data
-	Adapt software steering wheel	electronics		1	
-	Adapt software, diesel, exhaus	t EA189 action 23Q3			Extras
-	Production status documentati	on part number on the replacement	airbag module/gas generator		Help
-	Reset the assembly sate test/	OTC memory			🕑 Online Help
	Software version management				🍪 Support
				1 T	
erform test.	Display documents			A Vour devic	e is ready to use
6					


In operating mode Special Functions, Select "Production status documentation part number on the • replacement airbag module/gas generator" <arrow>.

importer: Dealer: RO:	444 03999	VIN: Engine:	CCTA 2.01. Motron	ic/147kW	🤮 🛃 🌘		non carrier
nowofmodalies) Ou	DISS TSB	Operation Science Functions				Operating modes *	A. 3
Airbag ABD	- dan da				Complete/Continue	Clagnosis	
NOTE: This program assist	is you with the back documen	tation of the part number of the new	gas generator/airbag module for the	*		C Flash	
airbag system.						A Measurement	
	nned value with the value r or between the asterisks					linfo	
module. Should t as follows:	here be a discrepancy in t	hese values, proceed				(9) Admin	
- configure the so	e manually in the input field anner after the completion code from the description	n of the program with				Log	e
						Data *	k
						Current View	
						D Print	
						Diagnostic Session	
				-		C. Nat	1
	12	< > >	Helo Cano	alter		>	A 10

- Scanning the data matrix code during this test plan step calibrates the scanner to avoid error messages.
- Scanning the calibrating data matrix code may not have to be done every time (only when the scanner requires calibration). You will know if the scanner needs calibrating if the scanner does not scan the inflator's data matrix code.
- If the inflator data matrix code cannot be scanned, then print out this matrix shown below and scan the printout.




After calibrating the scanner, select "Complete/Continue"

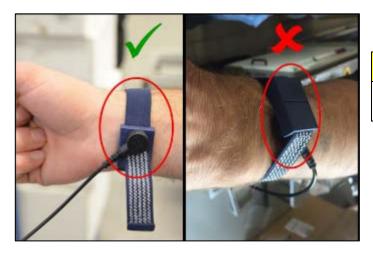

Put the wrist strap from the ESD workplace on your wrist.

The white dots on the wrist strap must be against the skin.

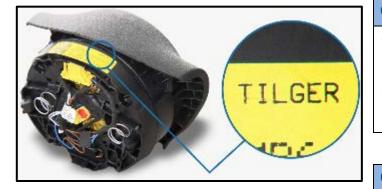

\bigcirc NOTE

- There are two types of inflator. One version is • "with vibration absorption" and one is "without vibration absorption".
- Airbags with vibration absorption may be • identified by the word "TILGER" on the label found on the airbag.

INOTE


In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption" instructions.



Vehicles with Criteria T2 or N2:

- Place the new inflator on the ESD mat. •
- Scan the data matrix code of the new inflator at a distance of about 15 cm.

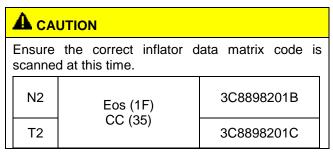

INOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.



INOTE

The data matrix code includes the values as shown.



Vehicles with Critiera T3:

- Place the new airbag on the ESD mat. •
- Scan the data matrix code <circle> of the new • airbag at a distance of about 15 cm.



Scanning the bar code on the new airbag will result in an "implausible barcode" message.

Continued for all vehicles:

nporter:	444	VIN:			00
ealer:	03999	Engine:	CCTA 2.0 L Motronic/147kV	V	recommences in August
0:					
	DISS TSB Test per	Operation Special Functions			Operating modes *
Varbag ABD				RXL	Diagnosis
nput				Accept	() COD
Scan the barcode			*		- Ann
D NOTE					Ca Weasurement
Note that no nu active.	meric values are displayed v	while Caps Lock is			info
					(Britania)
					Log ¥
					Data *
					Current View
					Print
					Diagnostic Session
					(B) have
	K	< > >	Help Canceltest		> 🛛 🔿
Эе	<mark>o 🐨 🚞</mark> 🖉		The second	- 5	🥫 🖲 ங 🗥 🗑 寻 🕕 🕺 250 PM
Once th	e new inflator or a	iirbag has been succes	ssfully scanned, press "A	ccept"	
D NOTE	(Vehicles with C	riteria T3)			
	fter scanning the utomatically.	data matrix code, the	airbag control module w	vill be recoded	and reparameterize
	(All vehicles)				
			chave pear the data ma	triv and an the	
	•		shown near the data ma		
● If th	nere is a discrepa	ncy, manually enter the	e value from the new infla	ator in the input	field.

• If no value appears, recalibrate the scanner.

C Officiard Diagnostic Int	formation System Service - 31.3				- 0 -
Importer: Dealer: IRO:	444 03999	VIN: Engine:	CCTA 2.0 L Motronic/147kW	🔮 🔩 📎	аналита у Сараната аналита ба се
Como nodules 0	DISS TSB	Operation			Operating modes * *
Airbag ABD				1	O Diagnosis
Driver/front passer	ngerside			+1+	2010
On which side was	s the gas generator replaced?			-2-	C Tuist
1. Driver side				+ 3 +	Measurement :
2. Front passenge 3. Back	r side			4	linto
4. Cancel					Q Adam
					Log ¥
					Data A
					Current View
					D Print
					Diagnostic Session
			-		
	K	< > >	Help Cancel test		> 🖾 📀
	<mark>~ </mark> [[[]] [¹⁴⁴] []]		-		5 M 1 4 4 250 PM
• Sel	ect option 1 indica	ting that the Driver sid	de inflator was replaced.		
	(Vehicles with C	iteria T3)			
This step w	ill not be populate	d for vehicles requirin	g an airbag assembly.		
	er selecting option ntification.	n 1, a valid GeKo ID) will need to be entered in (order to upload	the new inflator
Continue to	Section C				



Battery in Engine Compartment:

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched ON.

INOTE

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.


- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.


A CAUTION

Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.

- Open the battery protective covering <1>.
- Loosen the nut <1>.
- Remove and isolate the battery ground cable terminal from the battery terminal.

Continue to Section D

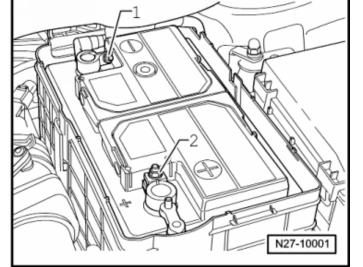

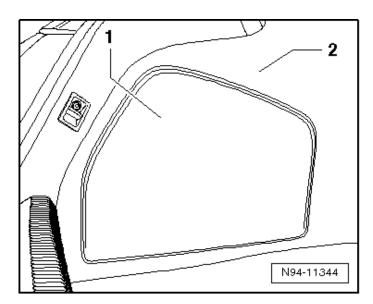

Battery in Luggage Compartment:

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched **ON**.

INOTE

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.

- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.


Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.

Unclip the service cover <1> off the side trim panel <2>.


The battery is installed in the left side of the luggage compartment in vehicles with the 3.6L V6 gasoline engine.


- Loosen the nut <1>.
- Remove and isolate the battery ground cable • terminal from the battery terminal.

Continue to Section D

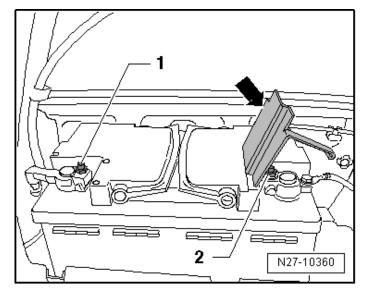

Section D – Airbag Removal

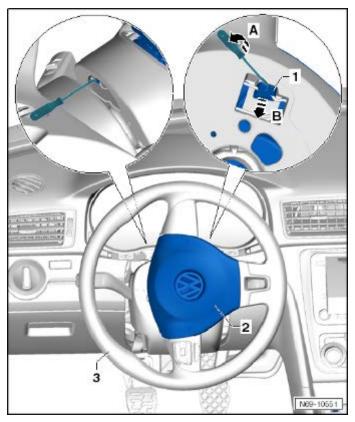

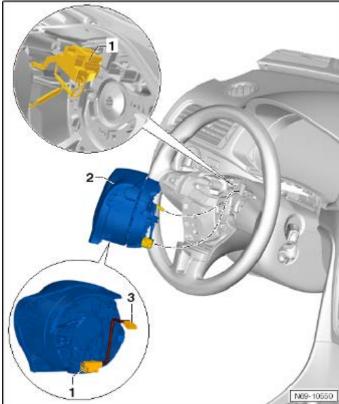

- Lower the steering wheel <3> as far as possible.
- Adjust steering wheel depth (reach) <3> so it is in the fully extended position.
- Turn the steering wheel <3> to the position illustrated.
- Insert a screwdriver all the way into the hole on the back of the steering wheel (approximately 8 mm).
- Turn the screwdriver toward the driver door <arrow A>. This will unlock the airbag unit <2> locking mechanism <1> in direction of <arrow>, on the right side of the steering wheel.
- Turn the steering wheel 180° and repeat the procedure on the opposite side.

The screwdriver previously mentioned should be about 175 mm long and have a blade width of 7 mm.

Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.

- Turn the steering wheel back to its center position.
- Remove the airbag unit <2> from the steering wheel.
- Release the connector lock on the airbag connector <1> and remove it.
- Disconnect the connector <3> (if equipped).

Set the airbag down so the logo on the impact cushion faces upward.

Vehicles with Criteria T2 or N2: Continue to Section E.

Vehicles with Criteria T3: Continue to Section F.

Section E – Inflator Replacement

Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at 0 least 10 minutes before handling.


Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.




\bigcirc NOTE

- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.

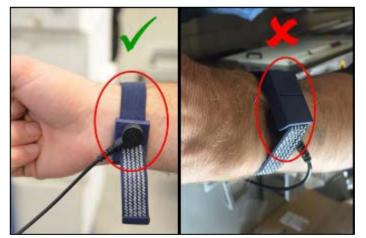


Put the wrist strap from the ESD workplace on your wrist.


The white dots on the wrist strap must be against the skin.

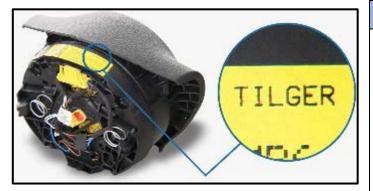

- There are two types of inflator. One version is • "with vibration absorption" and one is "without vibration absorption".
- If the version "with vibration absorption" is . installed, this can be identified by "TILGER" (vibration damper) on the label of the airbag module.
- If the version "without vibration absorption" is • installed, there is NO lettering on the label of the airbag module
- Identify inflator version by criteria and proceed to • the proper subsection.
 - 0 Criteria N2: Inflator, three spoke steering wheel, without vibration absorption: Proceed to Subsection 1.
 - o Criteria T2: Inflator, three spoke steering wheel, with vibration absorption: Proceed to Subsection 2.

Subsection 1 – Inflator, three spoke steering wheel, without vibration absorption

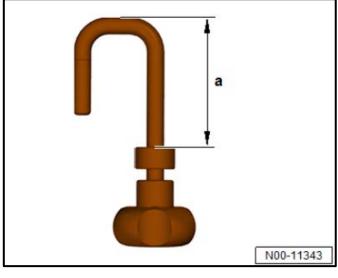

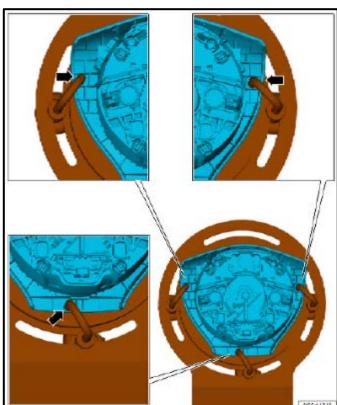


Removal Procedure:


- The three spoke steering wheel has three • mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

Clamp airbag centrally in airbag support. There are securing points on the sides <arrows>, parallel, opposite each other, and below.

INOTE

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

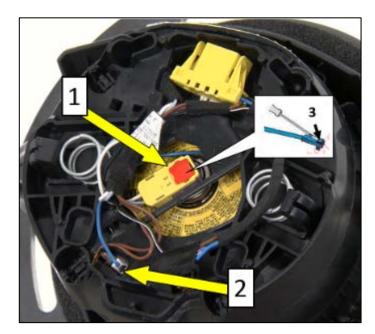

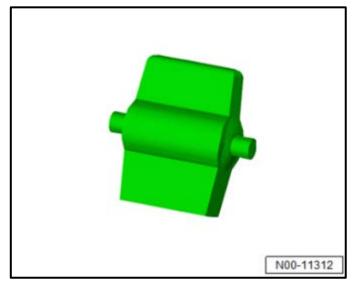


- Disengage connector lock <3> using a small flat bladed screwdriver.
- Remove connector <1> using needle nose pliers. •


- Do not use a screwdriver to pry off connector • <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.

INOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

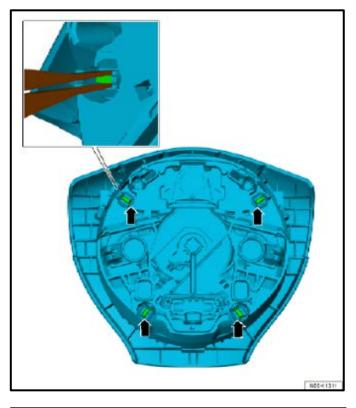

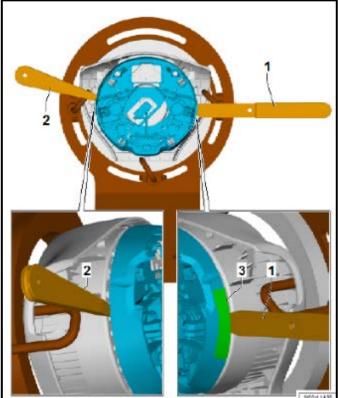



Remove locking pins <arrows> for horn ring with aid of longnose pliers.


- Apply lever -T10571- <1> in shaded area <3>. At • the same time, apply removal wedge -3409- on the other side <2> and lever off horn ring.
- Repeat work steps on other side.

ACAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during removal, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

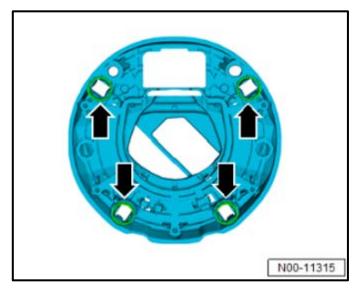

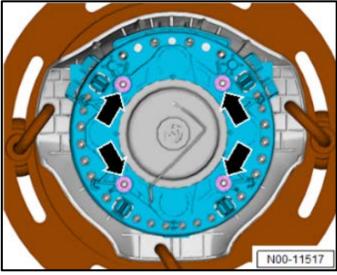

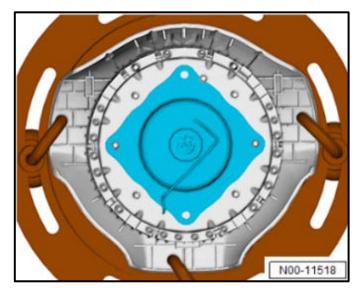

Remove horn ring with springs <arrows>.

A CAUTION

- When removing the horn ring, take care that the springs are not lost as they are not available sepereately.
- **ONE** replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>.
- Remove cover for inflator.

Remove the inflator and place in the original packaging.

Inflator return instructions are included with the new inflator.



Installation Procedure:

Insert the new inflator as shown. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
N2	3C8898201B


In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:


- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator, three spoke steering wheel, with vibration absorption" instructions.

Original Inflator Part #	Updated Inflator Part #
3C8898201B	3C8898201C

I NOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

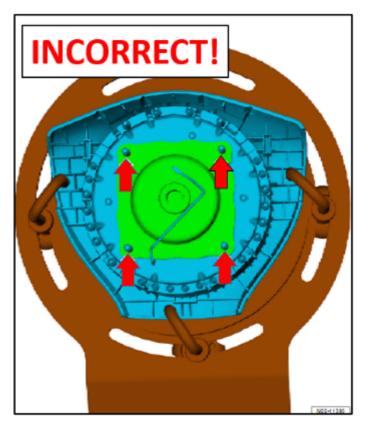


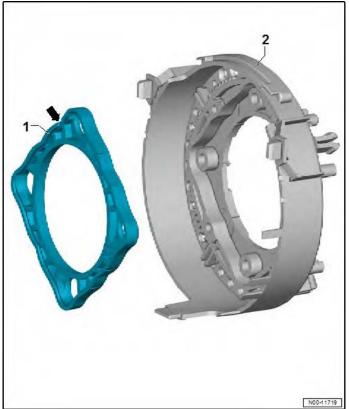

Note installation position:

The inflator must NOT be placed on the studs <arrows>.


Included in the replacement parts kit is an insert ٠ ring <1>. This must be used when installing a new inflator and placed in the horn ring <2>.

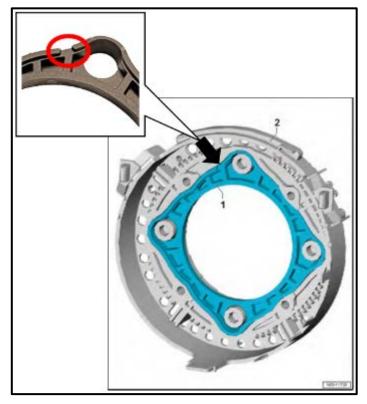

Fit insert ring <1> into horn ring <2>. The notch • (circle) in the insert ring must be at top <arrow> when doing this.


NOTE

- It should be possible to fit the insert ring from the • replacement parts kit with ease.
- It is essential to adhere to the installation position.
- The notch must be at the top <arrow>.

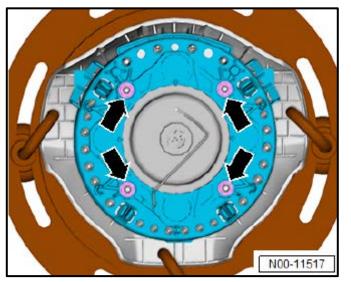


The nuts are self-locking and must be replaced


Fit cover for inflator and tighten 4 nuts <arrows> • to 5 Nm ± 0.4 Nm.

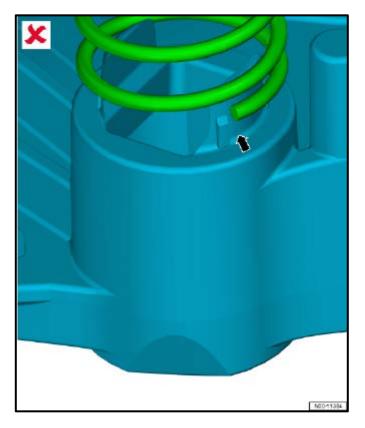


- If one of the springs is damaged or has been lost, • it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>. •

Spring seated correctly <arrow>.

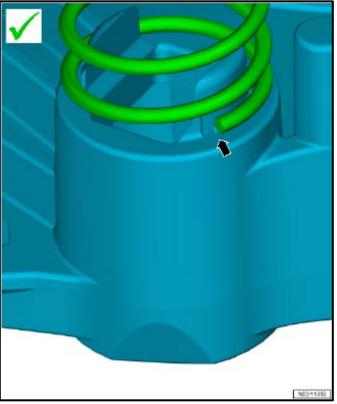


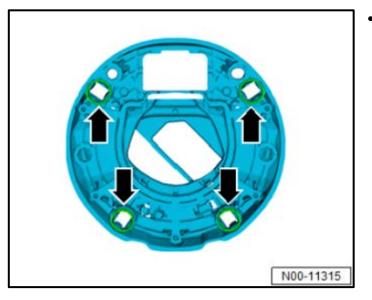

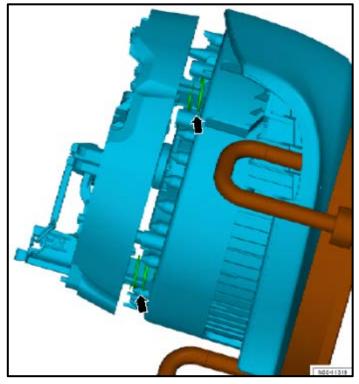


Fit springs <arrows> for horn ring again and allow to engage audibly.

Position horn ring <arrows> with springs on • securing clips and press firmly in place. Ensure that springs are seated correctly on both sides.

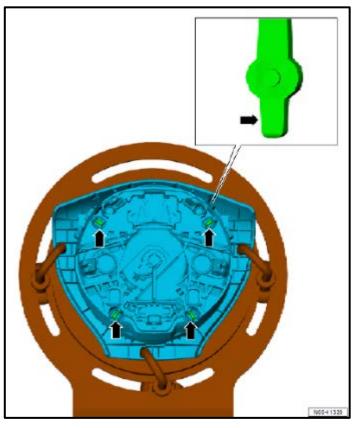

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

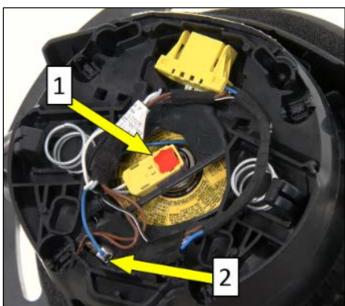

Connect central connector <1> on inflator.


INOTE

Ensure the connector locks are fully open when installing the connectors.

- Press central connector lock in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

Subsection 2 - Inflator, three spoke steering wheel, with vibration absorption

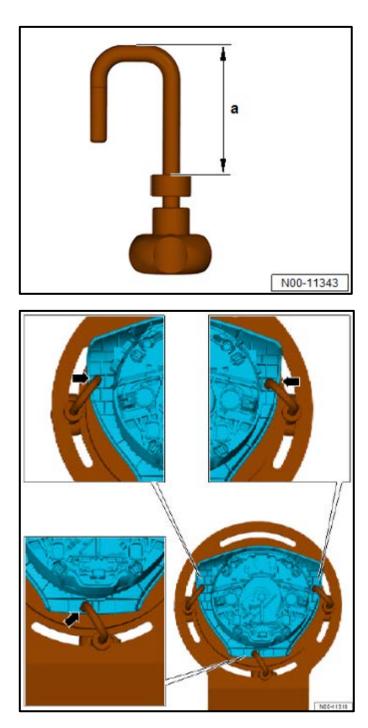


Removal Procedure:


INOTE

- The three spoke steering wheel has three mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

• Clamp airbag centrally in airbag support. There are securing points on the sides <arrows>, parallel, opposite each other, and below.

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

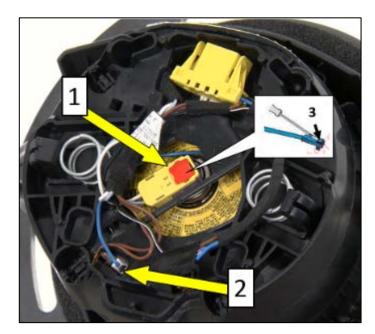

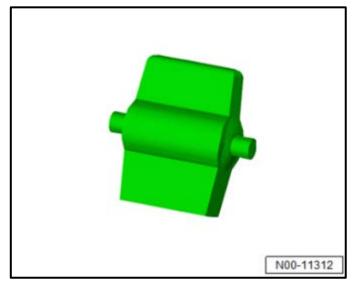


- Disengage connector lock <3> using a small flat bladed screwdriver.
- Remove connector <1> using needle nose pliers. •


- Do not use a screwdriver to pry off connector • <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.

INOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

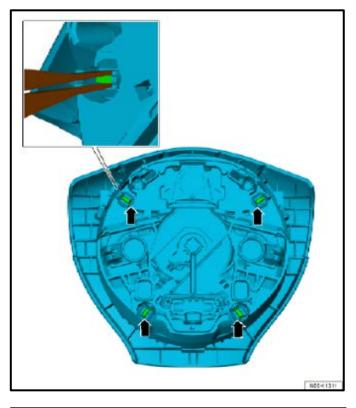

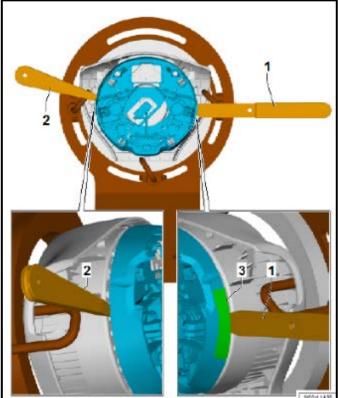



Remove locking pins <arrows> for horn ring with aid of longnose pliers.


- Apply lever -T10571- <1> in shaded area <3>. At • the same time, apply removal wedge -3409- on the other side <2> and lever off horn ring.
- Repeat work steps on other side.

ACAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

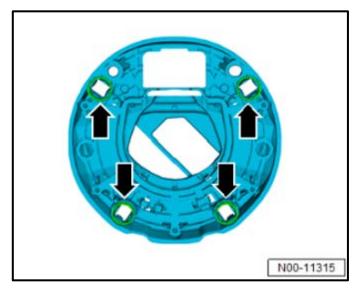

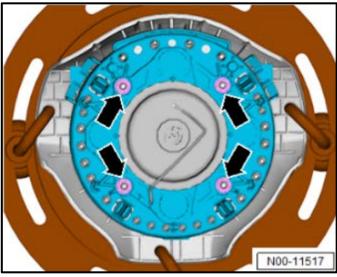

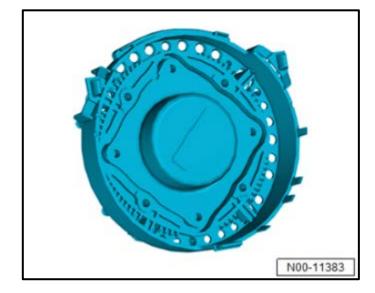


Remove horn ring with springs <arrows>.


A CAUTION

- When removing the horn ring, take care that the • springs are not lost as they are not available sepereately.
- **ONE** replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>.

Remove the inflator and place in the original packaging.

Inflator return instructions are included with the new inflator.

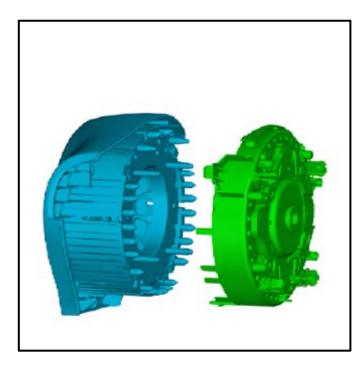

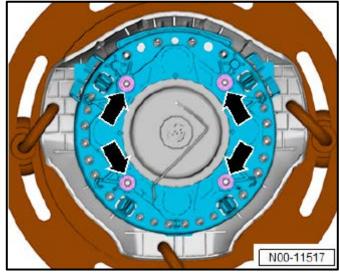


Installation Procedure:

Set new inflator in installation position.

Criteria	Inflator Kit Part Number
T2	3C8898201C


The nuts are self-locking and must be replaced


Install new nuts <arrows> and torque to 5 Nm ± • 0.4 Nm.

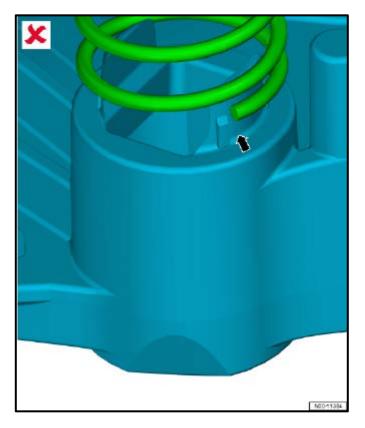


- If one of the springs is damaged or has been lost, • it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>. •

Spring seated correctly <arrow>.

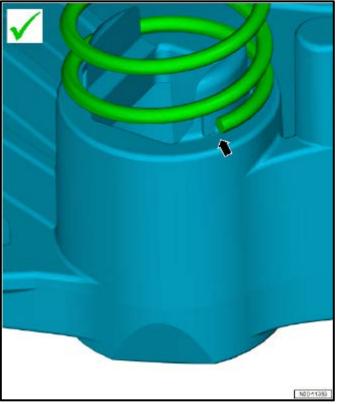


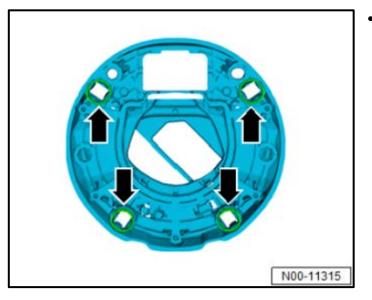

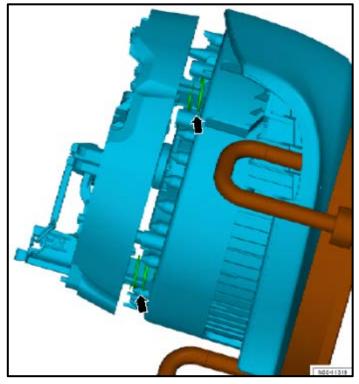


Fit springs <arrows> for horn ring again and allow to engage audibly.

Position horn ring <arrows> with springs on • securing clips and press firmly in place. Ensure that springs are seated correctly on both sides.

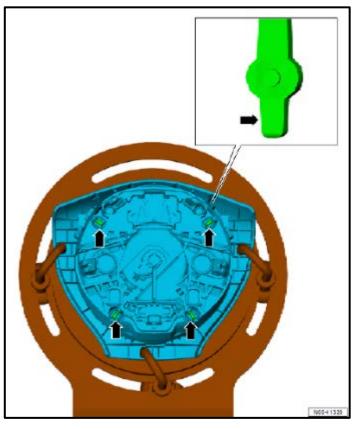

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

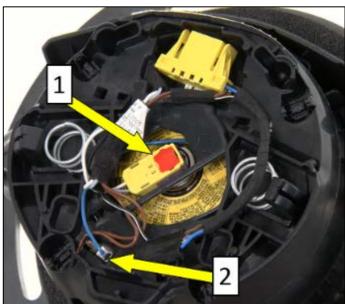

Connect central connector <1> on inflator.

INOTE

Ensure the connector locks are fully open when installing the connectors.


- Press central connector lock in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

Section F – Airbag Installation


Vehicles with Critiera T3: Install a new driver airbag.

Criteria	Driver Airbag Part Number
Т3	561880201AA 81U

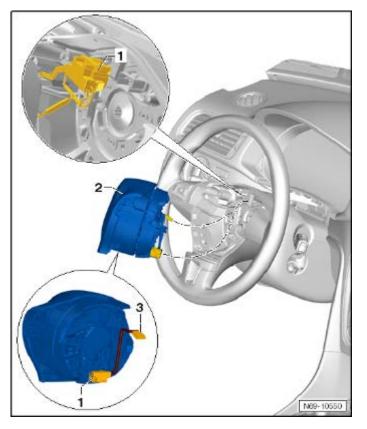

- The battery must be disconnected before • installing the airbag back into the vehicle.
- Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.
- Connect the connector <1>. The connector must click into place during this.
- Press the connector lock on the connector <1>. •
- Connect the connector <3> (if equipped).
- Insert the airbag unit <2> into the steering wheel but do not press on it.


The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2019 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. February 2019

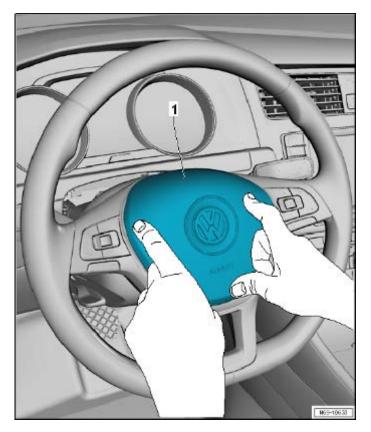

- Press on the edge of the airbag unit <1> with both • hands until it locks into place.
- Gently pull on the airbag unit to make sure the • airbag unit is secured correctly at all three attachment points in the steering wheel.

Continue to Section G.

Section G – Battery Reconnect

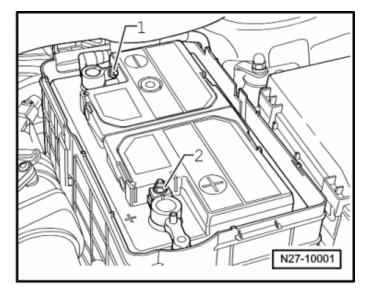



i TIP

For KESSY vehicles, the engine may not start after reconnecting battery. This condition should be resolved by following these steps:

- 1. Remove the key from the vehicle.
- 2. Open and close the driver's door.
- 3. Lock then unlock the vehicle using the remote.
- 4. Insert the key and the vehicle should now start.

Battery In Engine Compartment:

Ignition must be **ON** when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.


After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 10 to 15 mph. This activates Steering Angle Sensor -G85-.


- Close the cover <1>.
- Cycle the ignition off and back on.
- Bring driver seat to an upright position.
- Store previously recorded radio presets (if necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2019 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

Proceed to Section H.

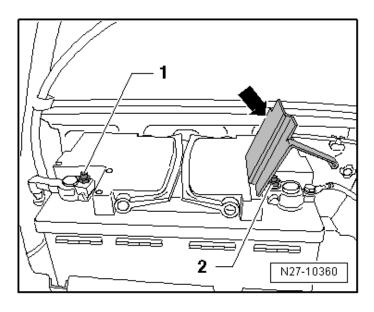

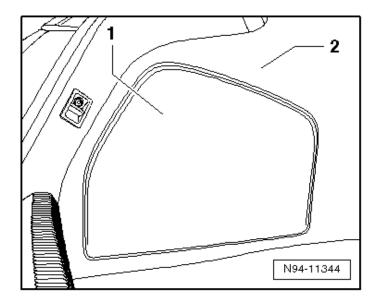

Battery In Luggage Compartment:

Ignition must be ON when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.

After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 10 to 15 mph. This activates Steering Angle Sensor -G85-.

- Install the service cover <1> on the side trim panel <2>.
- Cycle the ignition off and back on. •
- Bring driver seat to an upright position. •
- Store previously recorded radio presets (if . necessary).
- Set clock to local time. •
- Activate the power window regulator one-touch • up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.

I NOTE

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

Proceed to Section H.

Install Campaign Completion Label

• Fill out and affix Campaign Completion Label, part number CAMP 010 000, next to the vehicle emission control information label.

i TIP


Ensure Campaign Completion Label does not cover any existing label(s).

Repair is Complete, Proceed to Appendix B (Mandatory Takata Part Return Process).

Appendix A – Warning and Safety Precautions

General Safety Precautions when Working with Pyrotechnic Components:

- Pyrotechnic components always contain propellant that generates a gas during combustion. In some components, there is also a supply of pressurized gas to ensure this gas is generated
- This pressurized gas is stored under high pressure in a compressed gas container. Pyrotechnic components are triggered by electrical/mechanical igniters.
- Only trained personnel should perform testing, assembly and servicing work. Airbags do not have a replacement interval.
- Never check with test lamps, voltmeter or ohmmeters.
- Only check pyrotechnic components when they are installed in the vehicle using vehicle diagnosis, testing and information systems approved by the manufacturer.
- When working on pyrotechnic components and the airbag control module, disconnect the battery ground strap while the ignition is switched on. Then cover the negative terminal.
- Wait 10 seconds after disconnecting the battery.
- The ignition must be SWITCHED ON when connecting the battery. There should not be anyone inside the vehicle when doing this.
- Exception: vehicles with batteries in the passenger compartment. In this case, stay outside the range of the airbags and seat belts.
- Wash your hands after touching ignited pyrotechnic components from the restraint system.
- Do not open or repair pyrotechnic components. Use only new components to reduce the risk of injury.
- Do not install pyrotechnic components that have fallen onto a hard surface or show signs of damage.
- Discharge static electricity before handling pyrotechnic components, for example before disconnecting the electrical connector. This can be done by touching grounded metal objects such as the door striker pin.
- Install pyrotechnic components immediately after removing them from their transport packaging. If you must stop working, store the pyrotechnic component in its original transport packaging.
- Do not leave pyrotechnic components lying in the open unattended.
- Do not treat pyrotechnic components with grease, cleaning solutions or similar products.
- Do not expose pyrotechnic components to temperatures above 100 °C, even for brief periods of time.
- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

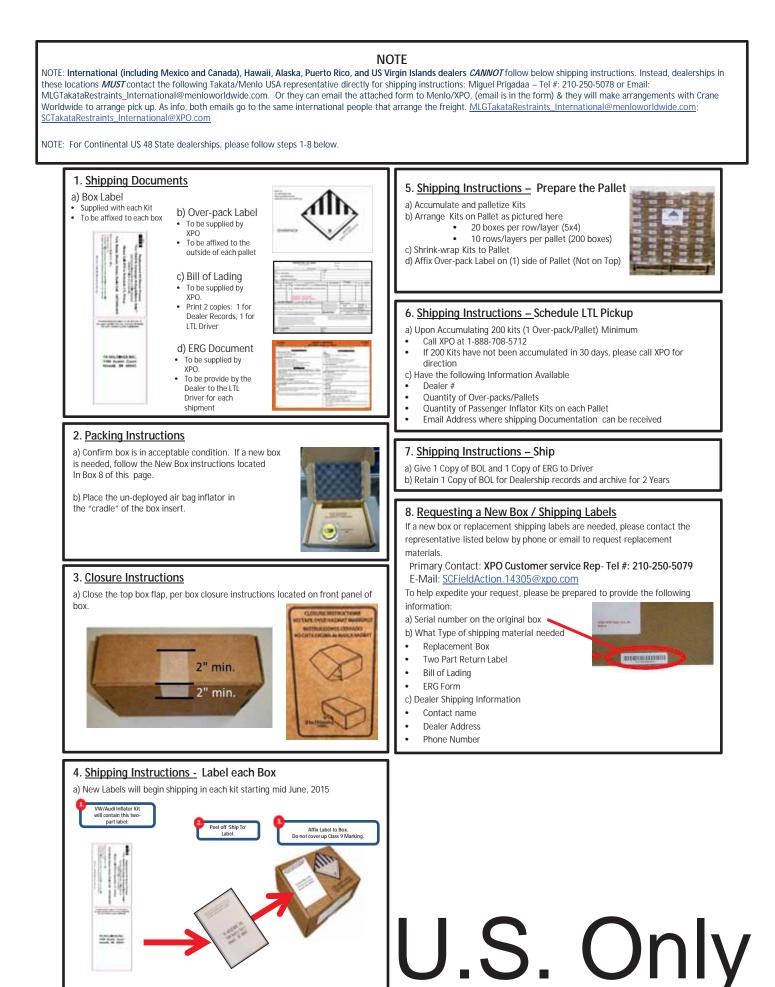

Crane Worldwide Logistics will arrange pick-up of all return Takata product. Dealers MUST follow directions on attached sign up form and pick-up request instructions. If you have any issues, questions or require additional information regarding Canadian Dealers - Do Not Contact XPO shipping, contact the following Takata/Menlo USA representative directly: Doreen Daigle, Campaign Specialist Tel number: (905) 428-4601 Miguel Prigadaa Tel number: 210-250-5078 E-mail: Email: MLGTakataRestraints_International@menloworldwide.com NOTE: For reference purposes only, see steps 1-8 below. **1. Shipping Documents** 5. Shipping Instructions – Prepare the Pallet a) Over-pack Label a) Accumulate and palletize Kits To be supplied b) Arrange Kits on Pallet as pictured here by carrier 20 boxes per row/layer (5x4) To be affixed to the 10 rows/layers per pallet (200 boxes max) outside of each c) Shrink-wrap Kits to Pallet pallet d) Affix Over-pack Label on (1) side of Pallet (Not on Top) e) Kits cannot be shipped in a master carton. If not enough b) Bill of Lading (BOL) to palletize, kits can be returned in their individual To be supplied Boxes with dangerous goods markings visible. Select "via by carrier Print 2 copies: 1 for small package" when shipping individually Dealer Records, 1 for truck Driver 6. Shipping Instructions – Schedule LTL Pickup c) ERG Document To be supplied by carrier a) Upon Accumulating 200 kits (1 Over-pack/Pallet) or 30 days since last To be provided by shipment: the Dealer to the Follow request instructions on pick-up truck Driver for each shipment b) Have the following Information Available Dealer Number Quantity of Over-pack Pallets(200) or individual boxes Quantity of Passenger Inflator Kits on each Over-Pack Pallet 2. Packing Instructions Email Address where shipping Documentation can be received a) Confirm box is in acceptable condition. b) Place the un-deployed air bag inflator in 7. Shipping Instructions - Ship the "cradle" of the box insert. a) Give 1 Copy of BOL and ERG to driver b) Retain 1 Copy of BOL for Dealership records and archive for 2 Years 8. Requesting a New Box / Shipping Labels If a new box or replacement shipping labels are needed, please email to request replacement materials. 3. Closure Instructions E-Mail: MLGTakataRestraints_International@menloworldwide.com To help expedite your request, provide the following information: a) Close the top box flap, per box closure instructions located on front panel of box. a) Serial number on the original box b) What Type of shipping material needed Replacement Box 2" min. Two Part Return Label -* if included This picture may appear different on the box 2" min. c) Dealer Shipping Information Contact name Dealer Address Phone Number 4. Shipping Instructions - Label each Box a) This step is only necessary if label is included in box. CANADIAN DEALER DO NOT CONTACT XPO el off 'Ship To VW/Audi Inflator Kit will co this two-part label: Affix Label to Box. Do not cover up Class 9 Markin Do not ship with label inside the box Label on the box will vary as per country of origin Please file all tracking documents Canadian Dealers - Do not contact XPO as noted on label Contact your Campaign Specialist

NOTE