	GROUP Safety Recall Campaign	MODEL 2019MY Sedona (YP)
	NUMBER SC177	DATE April 2019
SAFETY RECALL CAMPAIGN		
SUBJECT: 2ND ROW CENTER SEAT BELT BUCKLE (SC177)		

This bulletin provides the procedure to inspect and, if necessary, reinstall the second row middle seat belt buckles on certain 2019MY Sedona (YP) vehicles equipped with an 8-passenger seat configuration manufactured from October 31, 2018 through November 28, 2018. The recalled vehicles may not comply with the FMVSS No. 208 (Occupant Crash Protection) requirements that each rear designated seating position contain a functioning Type 2 (or 3-point) seat belt assembly. The seat belt buckles for the second-row middle seat may have been installed on the wrong side of the seat, preventing proper use of the 3-point seat belt. An incorrectly used seat belt can increase the risk of injury in a crash. Before conducting the procedure, verify the vehicle is included in the list of affected VINs.



★ NOTICE

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.

★ NOTICE


To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service → Warranty Coverage → Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

File Under: <Safety Recall Campaign>

- Circulate To:** General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair

Inspection Procedure:


1. While sitting in the 2nd row center seat, locate the center seat belt buckle (A).
 - If the 2nd row center seat belt buckle is located on the right side of the center seat (✓), no further action is required.
 - If the 2nd row center seat belt buckle is located on the left of the center seat (✗), proceed to the Center Seat Belt Buckle Reinstallation Procedure below.

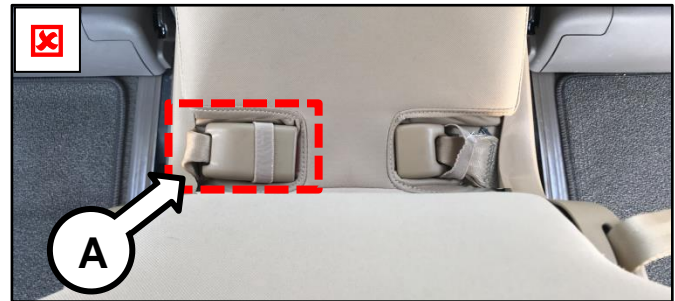**Center Seat Belt Buckle Reinstallation Procedure:**

1. Place the left and right 2nd row seats in the stand-up position.




2. Unclip the rear cover (B) to expose the side cover retaining screws.

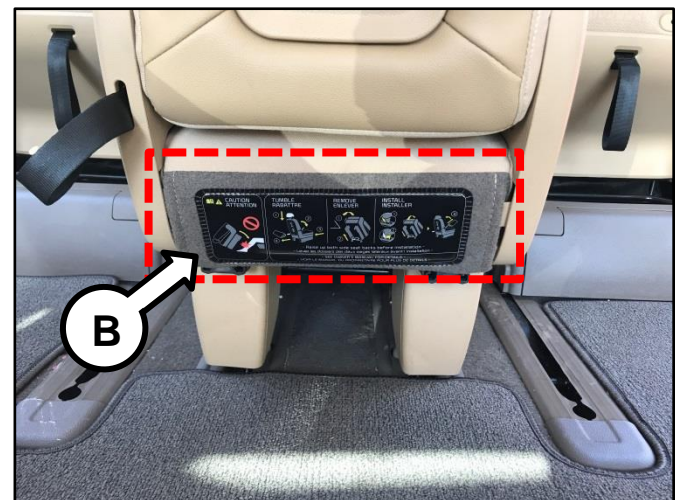


SUBJECT:

2ND ROW CENTER SEAT BELT BUCKLE (SC177)


3. Remove the two (2) side cover retaining screws (C).

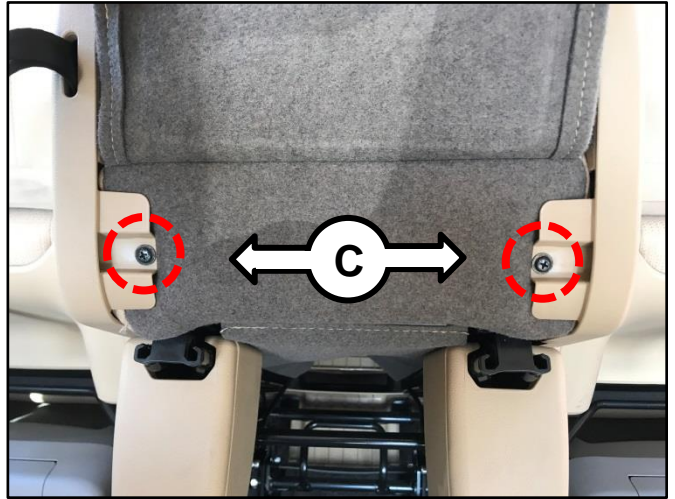

4. Carefully and partially remove the two (2) side covers (D).

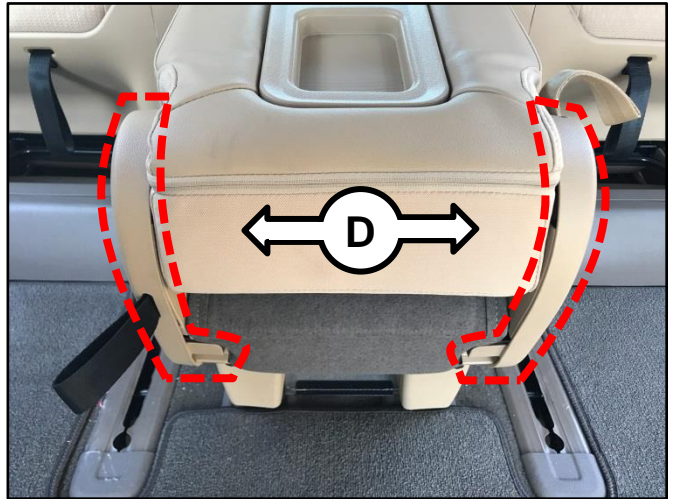

5. Remove the center seat belt buckle retaining bolt (E) and, on the opposite side, the center seat belt anchor connector retaining bolt (F).

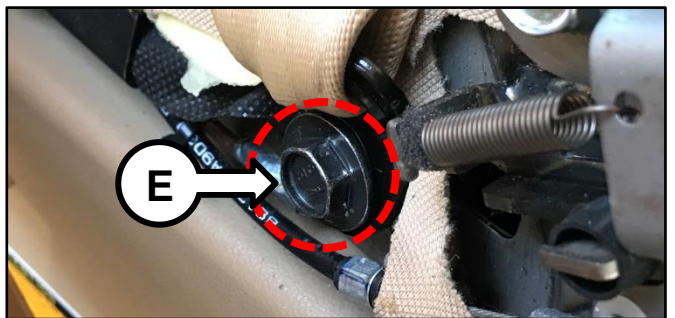

6. Apply a small amount of Permatex® High Strength 27100 (Red), LOCTITE® 263, or equivalent high strength threadlocker onto the center seat belt buckle retaining bolt threads and the center seat belt anchor connector retaining bolt threads.

*** NOTICE**


Be careful not to drip any threadlocker onto the vehicle interior/exterior when applying. Use of a shop towel is recommended, as shown.



7. Reinstall the center seat belt buckle (A) and center seat belt anchor connector (G) at the opposite side of where they were previously installed. Torque the two (2) bolts to specifications.

*** NOTICE**


The center seat belt anchor connector should now be on the left side and the center seat belt buckle should now be on the right side.

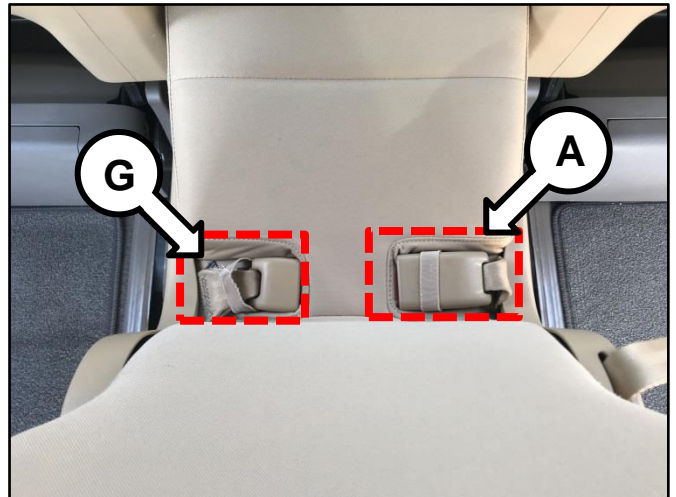

Tightening torque:

32.55 – 39.77 lb.ft (44.13 – 53.93 N.m,
4.5 – 5.5 kgf.m)

8. Reinstall all removed components in the reverse order of removal. Ensure the following are installed properly:
- Rear cover (B): ensure the cover is properly attached to the bottom cover (H).
 - Left strap (I): ensure the strap is routed properly, between the bar (J) and inner side cover and then through the side cover opening, as shown.
 - Right strap (K): ensure the strap is routed properly, between the cushion and bar (L) and then through the side cover opening, as shown.

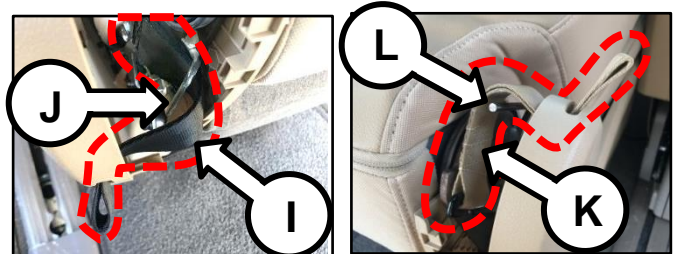

9. Verify proper operation of the straps and folding functions of the center seat.

SUBJECT:

2ND ROW CENTER SEAT BELT BUCKLE (SC177)

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sedona (YP)	October 31, 2018 through November 28, 2018

REQUIRED PART:

Part Name	Figure	Comment
Permatex® High Strength 27100 (Red), LOCTITE® 263, or equivalent	 	Locally sourced

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	89865 A9500DAA	0	(SC177) 2 nd Row Center Seat Belt Buckle <u>Inspection Only</u>	191023R0	0.2 M/H	N/A	N/A
R	89865 A9500DAA	0	(SC177) 2 nd Row Center Seat Belt Buckle <u>Inspection & Reinstallation</u>	191023R1	0.3 M/H	N/A	N/A

*** NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SC177 when accessing the WebDCS system.