




Blower Motor Fuse Replacement

Bulletin Type:	Safety Recall	Publication Date:	April 2019
Bulletin #(s):	Jayco 19V-265 2019-166 Entegra 19V-270 2019-167	Make(s):	Jayco / Entegra
Job Code(s):	9903432	Model(s):	Precept / Alante Precept Prestige Vision / Emblem
Flat Rate(s):	.3 hour	Model Year(s):	2014-2019

PARTS KIT REQUIRED

Incident:	Inadequate overcurrent protection to dash blower motor.
Affected Units:	Please reference listing on last page of Instructions
Parts Kit:	Parts Kit #: 19V-265/270
	Parts Kit Contents: 1 - Fuse 25A Maxi 1 - Label
Misc. Tools & Supplies:	Isopropyl alcohol and clean rag

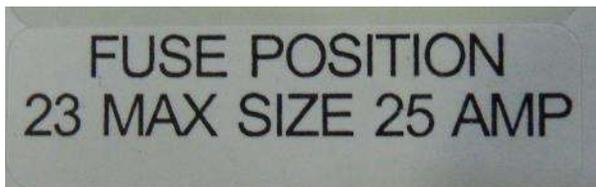

Label for Fuse Box



25A Maxi Fuse
(Quarter indicates fuse size)

REPAIR INSTRUCTIONS

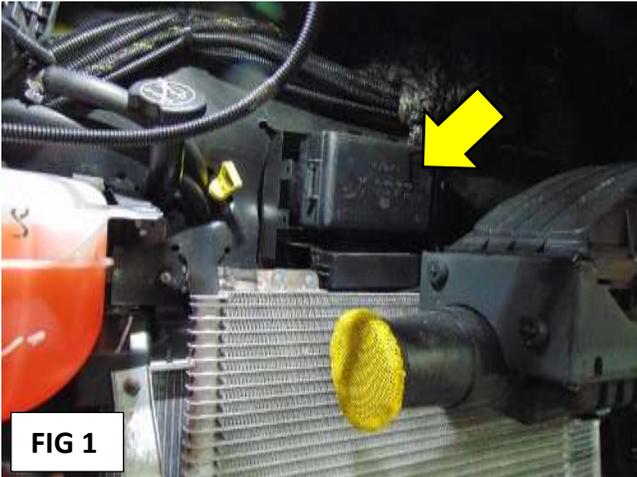


FIG 1



FIG 2

FIG 1:

- Open the engine compartment door on the front of the vehicle.
- Fuse box mounted to the firewall (arrow).

FIG 2:

- Open the fuse box by disengaging the locking tab in the lower right front corner of the box (arrow).

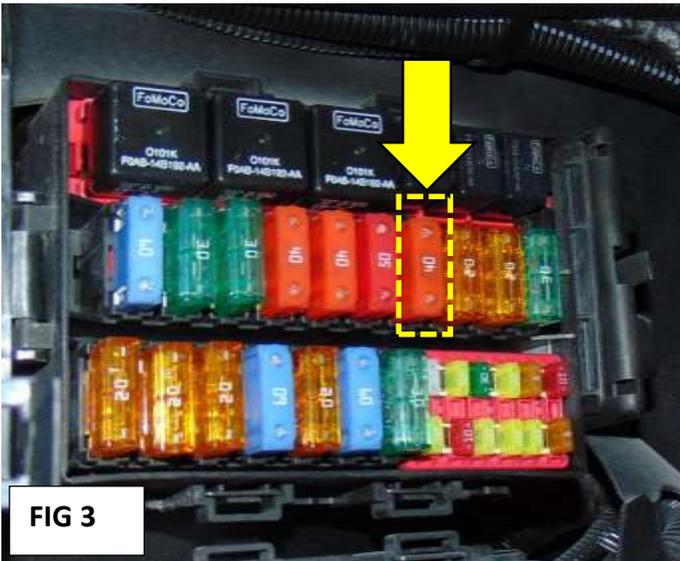


FIG 3

FIG 3:

- 40 Amp red fuse. (4th fuse from the right side).
- This is fuse position #23 as indicated on the fuse box lid (arrow and dashed box in Figure 4).
- Remove the 40A fuse in position #23.
- Save the 40A fuse as a spare as there are other 40A fuses in the box.

FIG 4:

- Fuse box lid showing fuse position #23 (arrow).

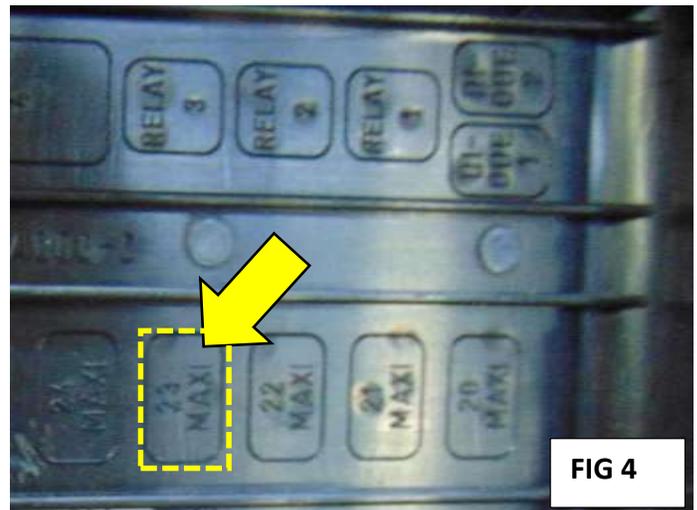


FIG 4



FIG 5:

- Install the 25A Maxi fuse from the kit in place of the 40A fuse in position #23 in fuse box (arrow and dashed box).

FIG 6:

- **Clean the area where the label will go using isopropyl alcohol and clean rag. Let dry 30 seconds.**
- **Place the label (from the kit) in the location shown (arrow).**
- Do not place the label where it will cover up any of the other fuse location callouts.

Close the fuse box and engine compartment door.

Validation of the repair:

Make sure the blower motor and HVAC system operates properly after the fuse change.

Perform a visual inspection to make sure the wiring from the fuse panel (fuse position #23) to the blower motor looks acceptable with no signs of excessive heat (discoloration) or arcing at connectors.

If there are signs of possible damage contact Jayco Customer Service.

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco at our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540